

Ezi-SERVO[®] Plus-R

Closed Loop Stepping System
with Network Based Motion Controller

Ezi-SERVO[®] Plus-R MINI

Closed Loop Stepping System

Ezi-SERVO[®] ALL

Closed Loop Stepping System

User Manual

Text

(Rev.08.06.23)



- Table of Contents -

1. Safety Pre-cautions	5
2. Specifications of the Drive	8
2.1 Characteristic Table	8
2.2 Dimensions	11
3. Specifications of the Motor	12
3.1 EzM-20 Series	12
3.2 EzM-28 Series	13
3.3 EzM-35 Series	14
3.4 EzM-42 Series	15
3.5 EzM-56 Series	17
3.6 EzM-60 Series	19
3.7 EzM-86 Series	21
4. Characteristics of Motor Torque	22
4.1 Ezi-SERVO-PR	22
4.2 Ezi-SERVO PR-MI	24
4.3 Ezi-SERVO-ALL	25
5. Configuration of the Controller	26
5.1 Combination of Motor and Drive	26
5.2 Controller Configuration	31
5.3 External Wiring Diagram	34
6. External Name and Function Setting of Ezi-SERVO-PR	40
6.1 Appearance and Part Name	40
6.2 Status Display LED	41
6.3 Drive ID Switch Selection (SW1)	41
6.4 Communication Speed and Terminal Resistance Select Switch(SW2)	41
6.5 Motor Connection (CN3)	42
6.6 Encoder Connection (CN2)	42
6.7 Power Connection(CN4)	42

6.8 I/O Signal Connection (CN1)	42
6.9 Communication Connection (CN5)	43
7. External Name and Function Setting of Ezi-SERVO-PR-MI	44
7.1 Appearance and Part Name	44
7.2 Drive ID Switch Selection (SW1) and 7-segment.....	44
7.3 Communication Speed and Terminal Resistance Select Switch(SW2)	44
7.4 Motor Connection (CN3)	45
7.5 Encoder Connection (CN2)	45
7.6 Power Connection(CN4)	45
7.7 I/O Signal Connection (CN1)	46
7.8 Communication Connection (CN5)	46
8. External Name and Function Setting of Ezi-SERVO-ALL42 / ALL56.....	47
8.1 Appearance and Part Name	47
8.2 Terminal Resistance Select Switch(SW1)	47
8.3 Drive ID Switch Selection (SW2)	47
8.4 Communication Speed Select Switch(SW3)	47
8.5 I/O Signal Connection (CN1)	48
8.6 Power Connection(CN2)	48
8.7 Communication Connection (CN3, CN4)	48
9. External Name and Function Setting of Ezi-SERVO-ALL60	49
9.1 Appearance and Part Name	49
9.2 Terminal Resistance Select Switch(SW1)	49
9.3 I/O Signal Connection (CN3)	49
9.4 Power Connection(CN1)	50
9.5 Communication Connection (CN5, CN6)	50
10. Control I/O Signal	51
10.1 Signal Cabling (Ezi-SERVO-PR type)	51
10.2 Signal Cabling (Ezi-SERVO-ALL type)	52
10.3 Connection Circuit	53
10.4 Input Signal	55
10.5 Output Signal	64

11. Operation	68
11.1 Power Supply Timing	68
11.2 Servo ON Operation	68
11.3 Operation Mode	68
12. Other Operation Functions	70
12.1 Position Table(PT) Operation Example	70
12.2 Jog Operation Example	70
12.3 Origin Return	71
12.4 Stop Operation	75
12.5 Trigger Pulse Output	75
12.6 Push Motion	77
13. Communication Function	81
13.1 Connection with the PC	81
13.2 Communication Interface Circuit	83
14. Protective Function	84
14.1 Alarm Type	84
14.2 Acquiring Alarm Information	84
14.3 Alarm Check and Release	85
14.4 Alarm Log	86
15. Parameter	87
15.1 Parameter List	87
15.2 Encoder Setup	88
15.3 Parameter Description	89
Appendix	94

Manual Version : [ver08.06.23]

Provided Firmware version : 6.x.063.50 ~

Provided GUI version : 6.25.1.628 ~

First Edition : Oct 02, 2008

Revised Edition : Mar 20, 2018

1. Safety Pre-cautions

※ Before operation ※

- Thank you for your purchasing Ezi-SERVO.
- Ezi-SERVO is an all-in-one Unit. For high-speed and high-precision drive of a stepping motor, Ezi-SERVO is a unique drive that adopts a new control scheme owing to an on-board high-performance 32bit digital signal processor.
- This manual describes handling, maintenance, repair, diagnosis and troubleshooting of Ezi-SERVO.
- Before operating Ezi-SERVO, thoroughly read this manual.
- After reading the manual, keep the manual near the Ezi-SERVO so that any user can read the manual whenever needed.

1. Precautions

◆ General Precautions

- Contents of this manual are subject to change without prior notice for functional improvement, change of specifications or user's better understanding. Thoroughly read the manual provided with the purchased Ezi-STEP.
- When the manual is damaged or lost, please contact with Fastech's agents or our company at the address on the last page of the manual.
- Our company is not responsible for a product breakdown due to user's dismantling for the product, and such a breakdown is not guaranteed by the warranty.

◆ Put the Safety First

- Before installation, operation and repairing the Ezi-STEP, thoroughly read the manual and fully understand the contents. Before operating the Ezi-STEP please, understand the mechanical characteristics of the Ezi-STEP and related safety information and precautions.
- This manual divides safety precautions into **Attention** and **Warning**.

 **Attention** : If user does not properly handle the product, the user may seriously or slightly injured and damages may occur in the machine.

 **Warning** : If user does not properly handle the product, a dangerous situation (such as an electric shock) may occur resulting in deaths or serious injuries.

- Although precaution is only a **Attention**, a serious result could be caused depending on the situation. Follow safety precautions.

◆ Check the Product

 Attention	Check the Product is damaged or parts are missing. Otherwise, the machine may get damaged or the user may get injured.
--	---

◆ Installation

 Attention	Carefully move the Ezi-SERVO. Otherwise the Product may get damaged or User's foot may get injured by dropping the product. Use non-flammable materials such as metal in the place where the Ezi-SERVO is to be installed. Otherwise, a fire may occur. When installing several Ezi-SERVO in a sealed place, install a cooling fan to keep the ambient temperature of the Ezi-SERVO as 50°C or lower. Otherwise, a fire or other kinds of accidents may occur due to overheating.
 Warning	The process of Installation, Connection, Operation, Checking and Repairing should be done with qualified person. Otherwise, a fire or other kinds of accidents may occur.

◆ Connect Cables

 Attention	Keep the rated range of Input Voltage for Ezi-SERVO. Otherwise, a fire or other kinds of accidents may occur. Cable connection should follow the wiring diagram. Otherwise, a fire or other kinds of accidents may occur.
 Warning	Before connecting cables, check if input power is off. Otherwise, an electric shock or a fire may occur. The case of the Ezi-SERVO is insulated from the ground of the internal circuit by the condenser. Ground the Ezi-SERVO. Otherwise, an electric shock or a fire may occur.

◆ Operation

 Attention	If a protection function(alarm) occurs, firstly remove its cause and then release(alarm reset) the protection function. If you operate continuously without removing its cause, the machine may get damaged or the user may get injured. Do not make Motor Free and make input signal to ON during operation. Motor will stop and stop current will become zero. The machine may get damaged or the user may get injured. Make all input signals to OFF before supply input voltage to Ezi-SERVO. The machine may get damaged or the user may get injured by motor operation. All parameter values are set by default factory setting value. Change this value after reading this manual thoroughly. Otherwise, the machine may get damaged or other kinds of accidents may occur.
--	---

◆ Check and Repair**Warning**

Stop to supply power to the main circuit and wait for a while before checking or repairing the Ezi-SERVO.
Electricity remaining in the capacitor may cause danger.

Do not change cabling while power is being supplied.
Otherwise, the user may get injured or the product may get damaged.

Do not reconstruct the Ezi-SERVO.
Otherwise, an electric shock may occur or the reconstructed product can not get After-Service.

Notes on Installation

- 1) This product has been designed for indoor uses. The ambient temperature of the room should be 0°C~55°C.
- 2) If the temperature of the case is 50°C or higher, radiate heat outside to cool down.
- 3) Do not install this product under direct rays or near magnetic or radioactive objects.
- 4) If more than 2 drives are installed in a line, keep the interval of 20mm or more vertically and 50mm or more horizontally at least.

2. Specifications of the Drive

2.1 Characteristic Table

1) Ezi-SERVO-PR

Motor Model	EzM-20 Series	EzM-28 Series	EzM-35 Series	EzM-42 Series	EzM-56 Series	EzM-60 Series	EzM-86 Series
Drive Model	EzS-NDR -20 Series	EzS-NDR -28 Series	EzS-NDR -35 Series	EzS-NDR -42 Series	EzS-NDR -56 Series	EzS-NDR -60 Series	EzS-NDR -86 Series
Input Voltage	24VDC \pm 10%						40~70VDC
Control Method	Closed loop control with 32bit DSP						
Multi Axes Drive	Maximum 16 axes through Daisy-Chain						
Position Table	256 motion command steps (Continuous, Wait, Loop, Jump and External start etc.)						
Current Consumption	Max 500mA(Except motor current)						
Operating Condition	Ambient Temperature	- In Use : 0 ~ 50°C - In Storage : -20 ~ 70°C					
	Humidity	- In Use : 35 ~ 85% RH(Non-Condensing) - In Storage : 10 ~ 90% RH(Non-Condensing)					
	Vib. Resist.	0.5G					
Function	Rotation Speed	0 ~ 3,000rpm					
	Resolution [P/R]	- 4,000/Rev. Encoder model : 500 / 1,000 / 1,600 / 2,000 / 3,600 / 5,000 / 6,400 / 7,200 / 10,000 / 4,000 - 10,000/Rev. Encoder model : 500 / 1,000 / 1,600 / 2,000 / 3,600 / 5,000 / 6,400 / 7,200 / 10,000 - 16,000/Rev. Encoder model : 500 / 1,000 / 1,600 / 2,000 / 3,600 / 5,000 / 6,400 / 7,200 / 10,000 / 16,000 - 20,000/Rev. Encoder model : 500 / 1,000 / 1,600 / 2,000 / 3,600 / 5,000 / 6,400 / 7,200 / 10,000 / 20,000 - 32,000/Rev. Encoder model : 500 / 1,000 / 1,600 / 2,000 / 3,600 / 5,000 / 6,400 / 7,200 / 10,000 / 32,000 (Selectable by parameter)					
	Protection	Over Current Error, Over Speed Error, Position Tracking Error, Over Load Error, Over Temperature Error, Over Regenerated Voltage Error, Motor Connect Error, Encoder Connect Error, Motor Voltage Error, In-Position Error, System Error, ROM Error, Input Voltage Error, Position Overflow Error					
	LED Display	Power status, In-Position status, Servo On status , Alarm status					
	In-Position Selection	0~15(Selectable by parameter)					
	Position Gain Selection	0~15(Selectable by parameter)					
	Rotational Direction	CW/CCW(Selectable by parameter)					
I/O Signal	Input Signal	3 dedicated input(LIMIT+, LIMIT-, ORIGIN), 9 programmable output(Photocoupler input)					
	Output Signal	1 dedicated output(Compare Out), 9 programmable output(Photocoupler output), Brake signal					
Communication Interface	The RS-485 serial communication with PC Transmission speed : 9,600~921,600bps						
Position Control	Incremental mode / Absolute mode (Data Range : -134,217,727 to +134,217,727pulse, Operating speed : Max. 3,000rpm)						
Return to Origin	Origin Sensor, Z phase, \pm Limit sensor, Torque						
GUI	User Interface Program within Windows						
Software	Motion Library (DLL) for windows 2000/XP/7/8/Vista						

2) Ezi-SERVO-PR-MI

Motor Model	EzM-20 Series	EzM-28 Series	EzM-35 Series	EzM-42 Series
Drive Model	EzS-NDR-MI-20 Series	EzS-NDR-MI-28 Series	EzS-NDR-MI-35 Series	EzS-NDR-MI-42 Series
Input Voltage	24VDC \pm 10%			
Control Method	Closed loop control with 32bit DSP			
Multi Axes Drive	Maximum 16 axes through Daisy-Chain			
Position Table	64 motion command steps (Continuous, Wait, Loop, Jump and External start etc.)			
Current Consumption	Max 500mA(Except motor current)			
Operating Condition	Ambient Temperature	- In Use : 0 ~ 50°C - In Storage : -20 ~ 70°C		
	Humidity	- In Use : 35 ~ 85% RH(Non-Condensing) - In Storage : 10 ~ 90% RH(Non-Condensing)		
	Vib. Resist.	0.5G		
Function	Rotation Speed	0 ~ 3,000rpm		
	Resolution [P/R]	- 4,000/Rev. Encoder model : 500 / 1,000 / 1,600 / 2,000 / 3,600 / 5,000 / 6,400 / 7,200 / 10,000 / 4,000 - 10,000/Rev. Encoder model : 500 / 1,000 / 1,600 / 2,000 / 3,600 / 5,000 / 6,400 / 7,200 / 10,000 - 16,000/Rev. Encoder model : 500 / 1,000 / 1,600 / 2,000 / 3,600 / 5,000 / 6,400 / 7,200 / 10,000 / 16,000 - 20,000/Rev. Encoder model : 500 / 1,000 / 1,600 / 2,000 / 3,600 / 5,000 / 6,400 / 7,200 / 10,000 / 20,000 - 32,000/Rev. Encoder model : 500 / 1,000 / 1,600 / 2,000 / 3,600 / 5,000 / 6,400 / 7,200 / 10,000 / 32,000 (Selectable by parameter)		
	Protection	Over Current Error, Over Speed Error, Position Tracking Error, Over Load Error, Over Temperature Error, Over Regenerated Voltage Error, Motor Connect Error, Encoder Connect Error, Motor Voltage Error, In-Position Error, System Error, ROM Error, Position Overflow Error		
	In-Position Selection	0~15(Selectable by parameter)		
	Position Gain Selection	0~15(Selectable by parameter)		
	Rotational Direction	CW/CCW(Selectable by parameter)		
I/O Signal	Input Signal	3dedicated input(LIMIT+, LIMIT-, ORIGIN), 7 programmable output(Photocoupler input)		
	Output Signal	1 dedicated output(Compare Out), 1programmable output(Photocoupler output), Brake signal		
Communication Interface	The RS-485 serial communication with PC Transmission speed : 9,600~921,600bps			
Position Control	Incremental mode / Absolute mode (Data Range : -134,217,727 to +134,217,727pulse, Operating speed : Max. 3,000rpm)			
Return to Origin	Origin Sensor, Z phase, \pm Limit sensor, Torque			
GUI	User Interface Program within Windows			
Software	Motion Library (DLL) for windows 2000/XP/7/8/Vista			

3) Ezi-SERVO-ALL


Input Voltage		24VDC \pm 10%
Control Method		Closed loop control with 32bit DSP
Multi Axes Drive		Maximum 16 axes through Daisy-Chain
Position Table		64 motion command steps (Continuous, Wait, Loop, Jump and External start etc.)
Current Consumption		Max 500mA (Except motor current)
Operating Condition	Ambient Temperature	- In Use : 0 ~ 50°C - In Storage : -20 ~ 70°C
	Humidity	- In Use : 35 ~ 85% RH(Non-Condensing) - In Storage : 10 ~ 90% RH(Non-Condensing)
	Vib. Resist.	0.5G
Function	Rotation Speed	0 ~ 3,000rpm
	Resolution [P/R]	- 10,000/Rev. Encoder model : 500 / 1,000 / 1,600 / 2,000 / 3,600 / 5,000 / 6,400 / 7,200 / 10,000 - 20,000/Rev. Encoder model : 500 / 1,000 / 1,600 / 2,000 / 3,600 / 5,000 / 6,400 / 7,200 / 10,000 / 20,000
	Protection	Over Current Error, Over Speed Error, Step Out Error, Over Load Error, Over Temperature Error, Over Regenerated Voltage Error, Motor Connect Error, Encoder Connect Error, Low Input Voltage Error, Inposition Error, System Error, ROM Error, High Input Voltage Error
	In-Position Selection	0~15(Selectable by parameter)
	Position Gain Selection	0~15(Selectable by parameter)
	Rotational Direction	CW/CCW(Selectable by parameter)
I/O Signal	Input Signal	3 dedicated input(LIMIT+, LIMIT-, ORIGIN), 7 programmable output(Photocoupler input)
	Output Signal	1 dedicated output(Compare Out), 1 programmable output(Photocoupler output), Brake signal
I/O Signal	Input Signal	3 dedicated input(LIMIT+, LIMIT-, ORIGIN), 7 programmable output(Photocoupler input) *1
	Output Signal	1 dedicated output(Compare Out), 3 programmable output(Photocoupler output), Brake signal *1
I/O Signal	Input Signal	3 dedicated input(LIMIT+, LIMIT-, ORIGIN), 6 programmable output(Photocoupler input) *2
	Output Signal	1 dedicated output(Compare Out), 6 programmable output(Photocoupler output), Brake signal *2
Communication Interface		The RS-485 serial communication with PC Transmission speed : 9,600~921,600[bps]
Position Control		Incremental mode/Absolute mode Data Range : -134,217,727 to +134,217,727[pulse], Operating speed : Max. 500[kpps]
Return to Origin		Origin sensor, Z phase, \pm Limit sensor
GUI		User Interface Program within Windows
Software		Motion Library (DLL) for windows 2000/XP/7/8/Vista

*1 : Only for Ezi-SERVO-ALL-60 Series

*2 : Only for Ezi-SERVO-ALL-60L-ABS Series


2.2 Dimensions

1) Ezi-SERVO-PR

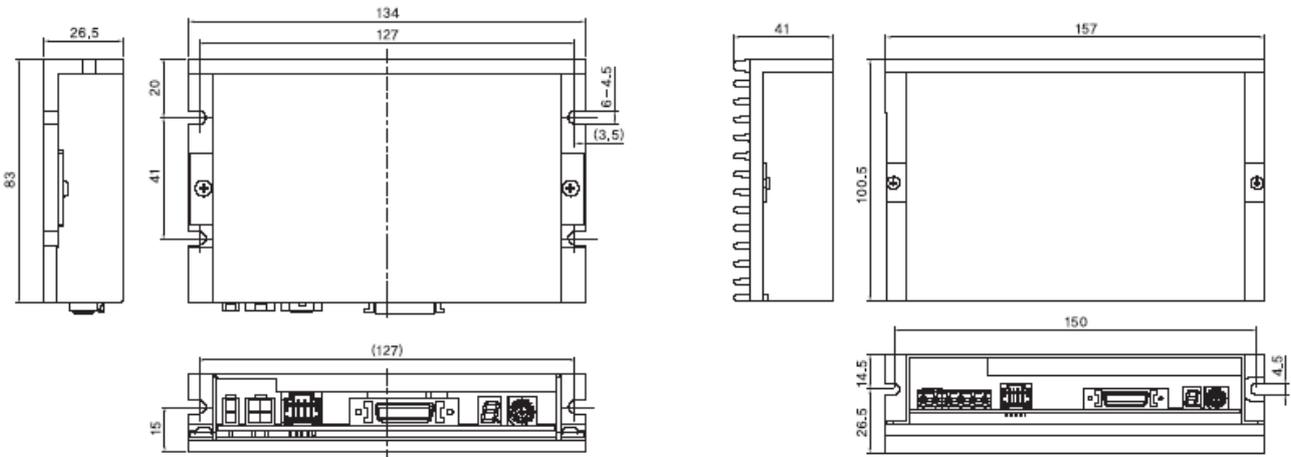

※ Only for 86mm motor drive (EzS-NDR-86 series)

2) Ezi-SERVO-PR-MI

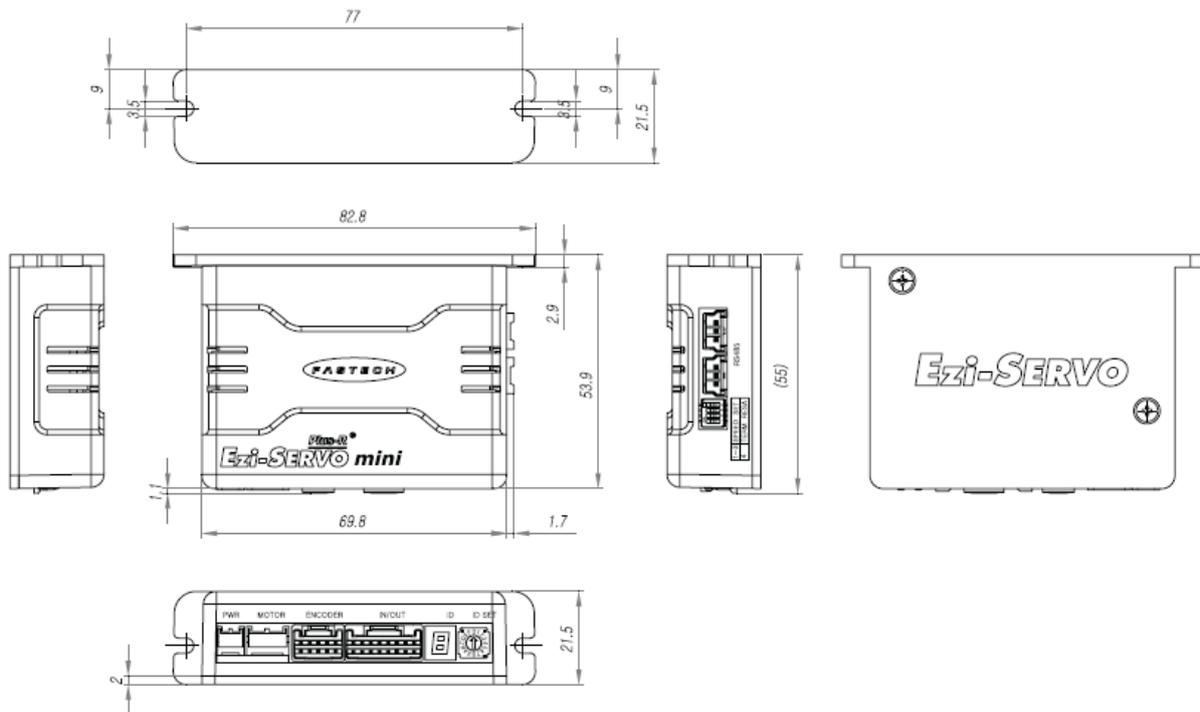

3) Ezi-SERVO-ALL

For more information, refer to ['3.Specifications of Motor'](#) .


3. Specifications of the Motor

3.1 EzM-20 Series

1) Specifications

MODEL	UNIT	EzM-20M-F	EzM-20L-F
DRIVE METHOD	----	BI-POLAR	BI-POLAR
NUMBER OF PHASES	----	2	2
VOLTAGE	VDC	2.9	2.25
CURRENT per PHASE	A	0.5	0.5
RESISTANCE per PHASE	Ohm	5.8	5.5
INDUCTANCE per PHASE	mH	2.5	5
HOLDING TORQUE	Nm	0,018	0,03
ROTOR INERTIA	$g \cdot cm^2$	2.5	3.3
WEIGHTS	g	50	80
LENGTH(L)	mm	28	38
ALLOWABLE THRUST LOAD	N	Lower than motor weight	
INSULATION RESISTANCE	MOhm	100min. (at 500VDC)	
INSULATION CLASS	----	CLASS B (130°C)	
OPERATING TEMPERATURE	°C	0 to 55	

2) Dimensions

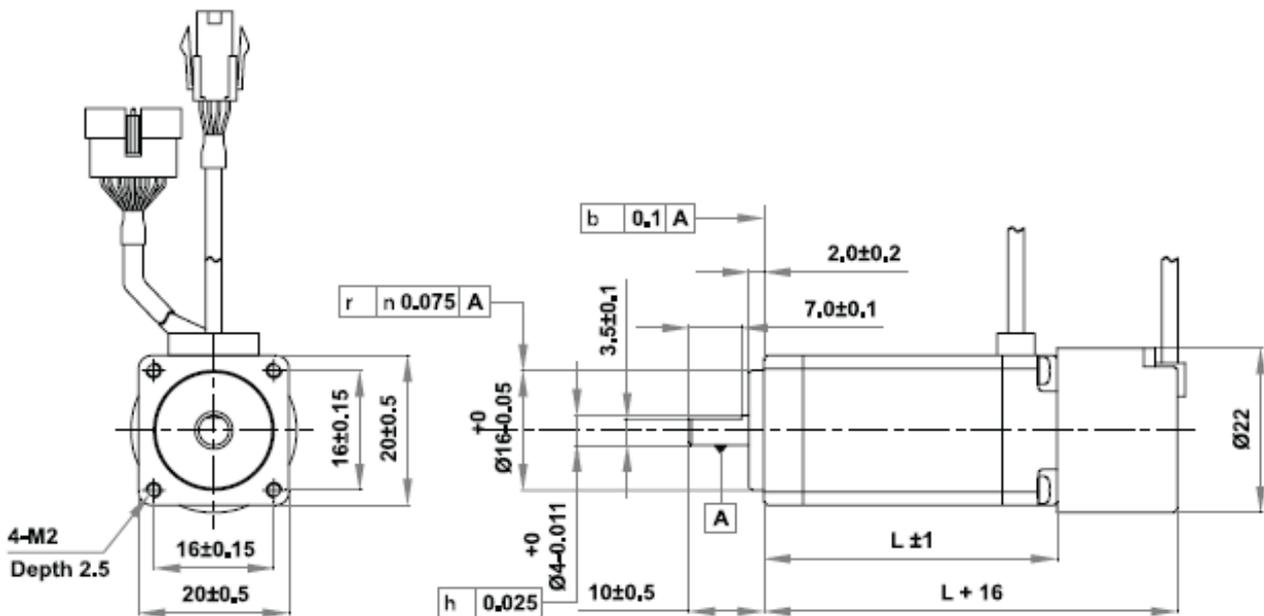


3.2 EzM-28 Series

1) Specifications

M O D E L	UNIT	EzM-28S-D	EzM-28M-D	EzM-28L-D
DRIVE METHOD	----	BI-POLAR	BI-POLAR	BI-POLAR
NUMBER OF PHASES	----	2	2	2
VOLTAGE	VDC	3.04	3.04	3.04
CURRENT per PHASE	A	0.95	0.95	0.95
RESISTANCE per PHASE	Ohm	3,2	3,2	3,2
INDUCTANCE per PHASE	mH	2	5	5,8
HOLDING TORQUE	Nm	0,07	0,12	0,14
ROTOR INERTIA	$g \cdot cm^2$	9	13	18
WEIGHTS	g	110	140	200
LENGTH(L)	mm	32	45	52
ALLOWABLE THRUST LOAD	N	Lower than motor weight		
INSULATION RESISTANCE	MOhm	100min. (at 500VDC)		
INSULATION CLASS	----	CLASS B (130°C)		
OPERATING TEMPERATURE	°C	0 to 55		

2) Dimensions

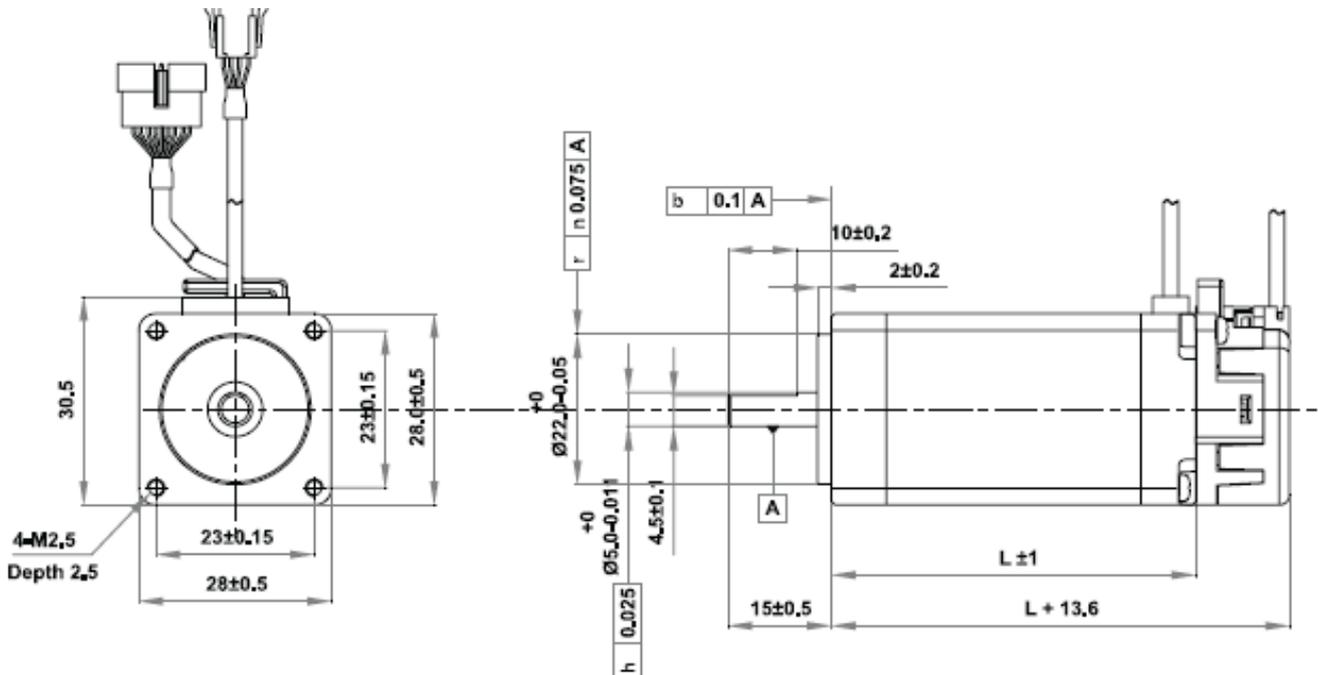


3.3 EzM-35 Series

1) Specifications

MODEL		UNIT	EzM-35S-D	EzM-35M-D	EzM-35L-D	EzM-35XL-D
DRIVE METHOD		---	BI-POLAR	BI-POLAR	BI-POLAR	BI-POLAR
NUMBER OF PHASES		---	2	2	2	2
VOLTAGE		VDC	2,28	2,88	4,59	5,39
CURRENT per PHASE		A	0,6	0,6	0,85	0,7
RESISTANCE per PHASE		Ohm	3,8	4,8	5,4	7,7
INDUCTANCE per PHASE		mH	3,2	6,1	6,5	8,4
HOLDING TORQUE		N · m	0,034	0,050	0,176	0,225
ROTOR INERTIA		g · cm ²	5	8	11	32
WEIGHTS		g	165	180	260	360
LENGTH (L)		mm	22	26	38	53
ALLOWABLE OVERHUNG LOAD (DISTANCE FROM END OF SHAFT)	3mm	N	22	22	22	22
	8mm		26	26	26	26
	13mm		33	33	33	33
	18mm		46	46	46	46
ALLOWABLE THRUST LOAD		N	Lower than motor weight			
INSULATION RESISTANCE		MΩm	100min. (at 500VDC)			
INSULATION CLASS		---	CLASS B (130°C)			
OPERATING TEMPERATURE		°C	0 to 55			

2) Dimensions

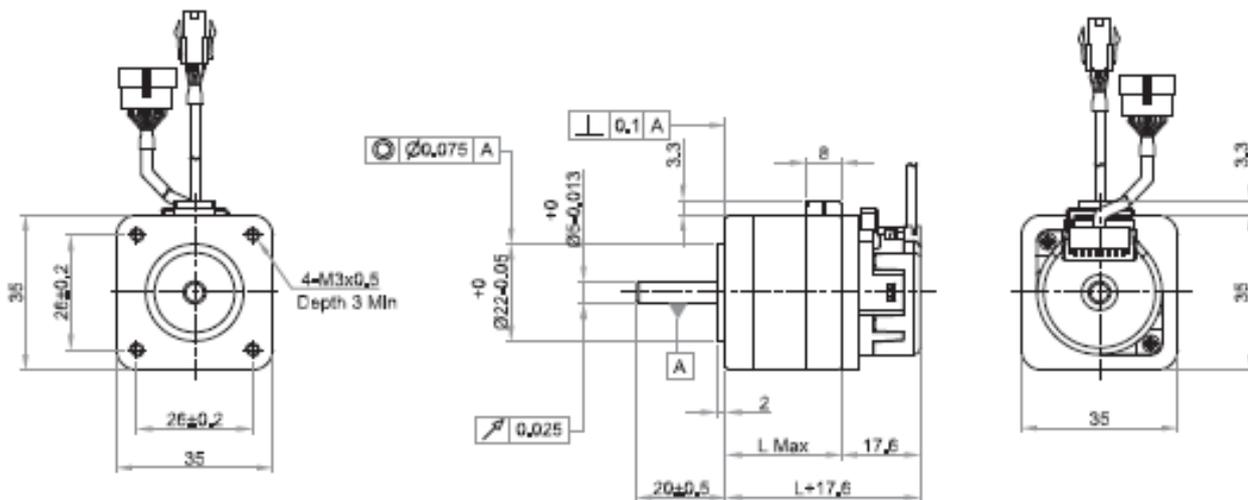


3.4 EzM-42 Series


1) Specifications

MODEL	UNIT	EzM-42S-A EzM-42S-B EzM-42S-C	EzM-42M-A EzM-42M-B EzM-42M-C	EzM-42L-A EzM-42L-B EzM-42L-C	EzM-42XL-A EzM-42XL-B EzM-42XL-C
DRIVE METHOD	----	BI-POLAR	BI-POLAR	BI-POLAR	BI-POLAR
NUMBER OF PHASES	----	2	2	2	2
VOLTAGE	VDC	3,36	4,32	4,56	7,2
CURRENT per PHASE	A	1,2	1,2	1,2	1,2
RESISTANCE per PHASE	Ohm	2,8	3,6	3,8	6
INDUCTANCE per PHASE	mH	2,5	7,2	8	15,6
HOLDING TORQUE	Nm	0,32	0,44	0,54	0,8
ROTOR INERTIA	$g \cdot cm^2$	35	54	77	114
WEIGHTS	g	220	280	350	500
LENGTH(L)	mm	33	39	47	59
ALLOWABLE THRUST LOAD	N	Lower than motor weight			
INSULATION RESISTANCE	Mohm	100min. (at 500VDC)			
INSULATION CLASS	----	CLASS B (130°C)			
OPERATING TEMPERATURE	°C	0 to 55			

2) Dimensions (Ezi-SERVO-PR and Ezi-SERVO-PR-MI)

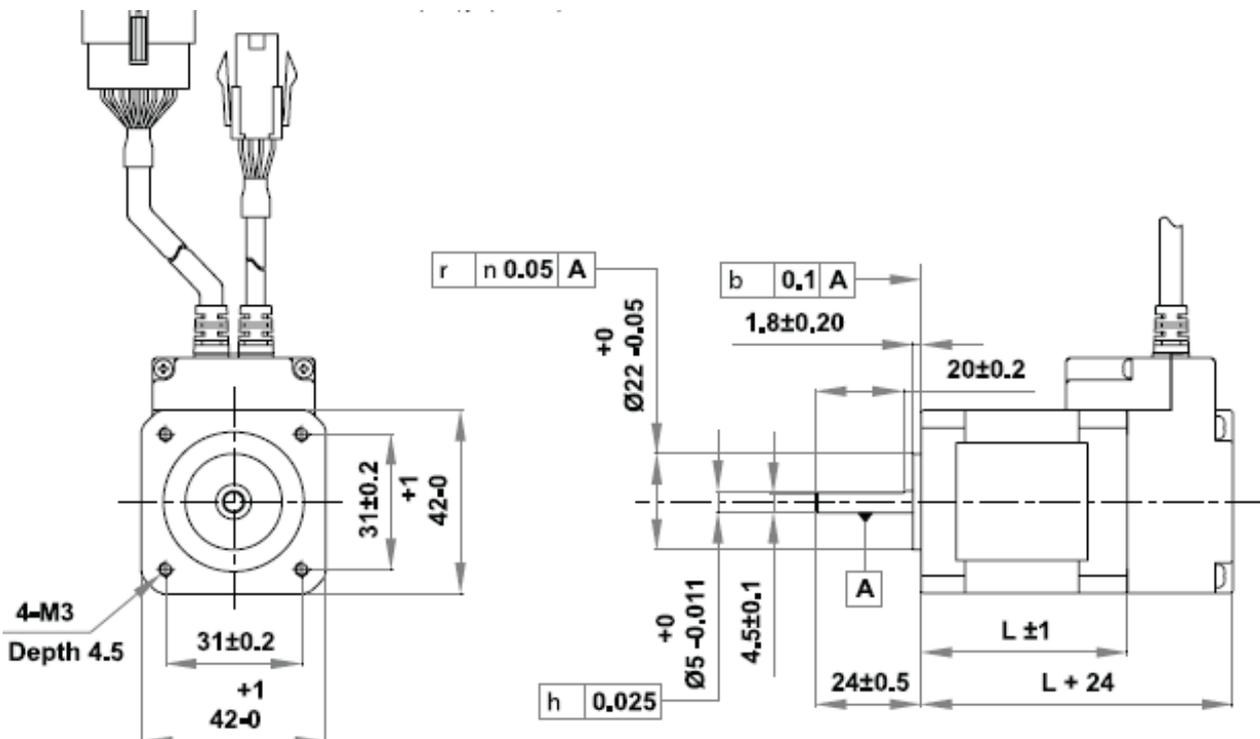

3) Dimensions (Ezi-SERVO-ALL)

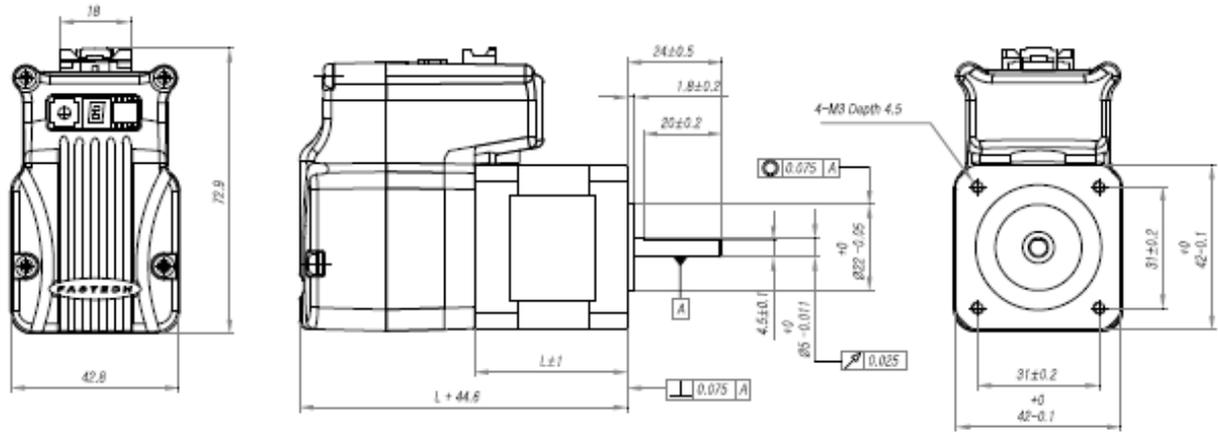


3.5 EzM-56 Series

Ezi-SERVO-PR drive only.

1) Specifications


MODEL	UNIT	EzM-56S-A EzM-56S-B EzM-56S-C	EzM-56M-A EzM-56M-B EzM-56M-C	EzM-56L-A EzM-56L-B EzM-56L-C	EzM-56XL-A EzM-56XL-B EzM-56XL-C
DRIVE METHOD	----	BI-POLAR	BI-POLAR	BI-POLAR	BI-POLAR
NUMBER OF PHASES	----	2	2	2	2
VOLTAGE	VDC	1.56	2.1	2.7	3.57
CURRENT per PHASE	A	3	3	3	3
RESISTANCE per PHASE	Ohm	0.52	0.7	0.9	1.19
INDUCTANCE per PHASE	mH	1	2	3.8	7.97
HOLDING TORQUE	Nm	0.64	1	2	3.5
ROTOR INERTIA	$g \cdot cm^2$	120	200	480	737
WEIGHTS	g	500	700	1150	1580
LENGTH(L)	mm	46	54	80	138.5
ALLOWABLE THRUST LOAD	N	Lower than motor weight			
INSULATION RESISTANCE	MOhm	100min. (at 500VDC)			
INSULATION CLASS	----	CLASS B (130°C)			
OPERATING TEMPERATURE	°C	0 to 55			

2) Dimensions (Ezi-SERVO-PR and Ezi-SERVO-PR-MI)

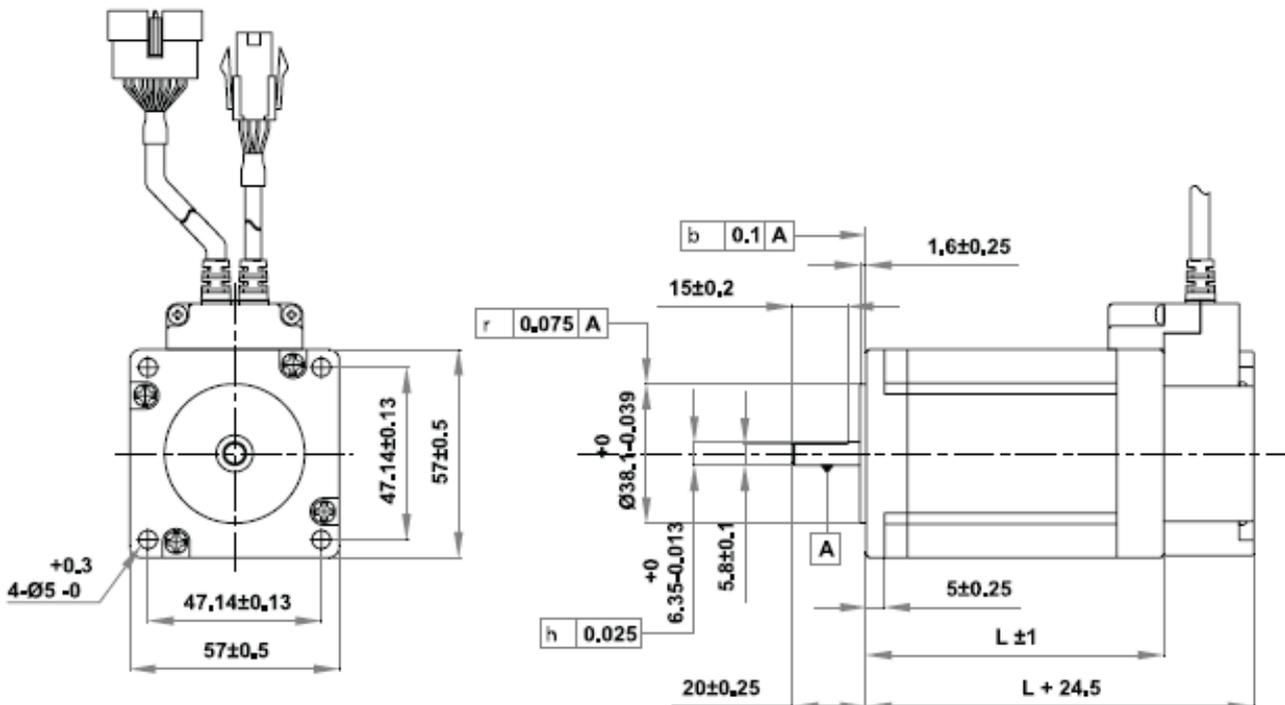

* : There are 2 kinds size of front shaft diameter for EzM-56 series as $\varnothing 6.35$ and $\varnothing 8.0$.

3) Dimensions (Ezi-SERVO-ALL)

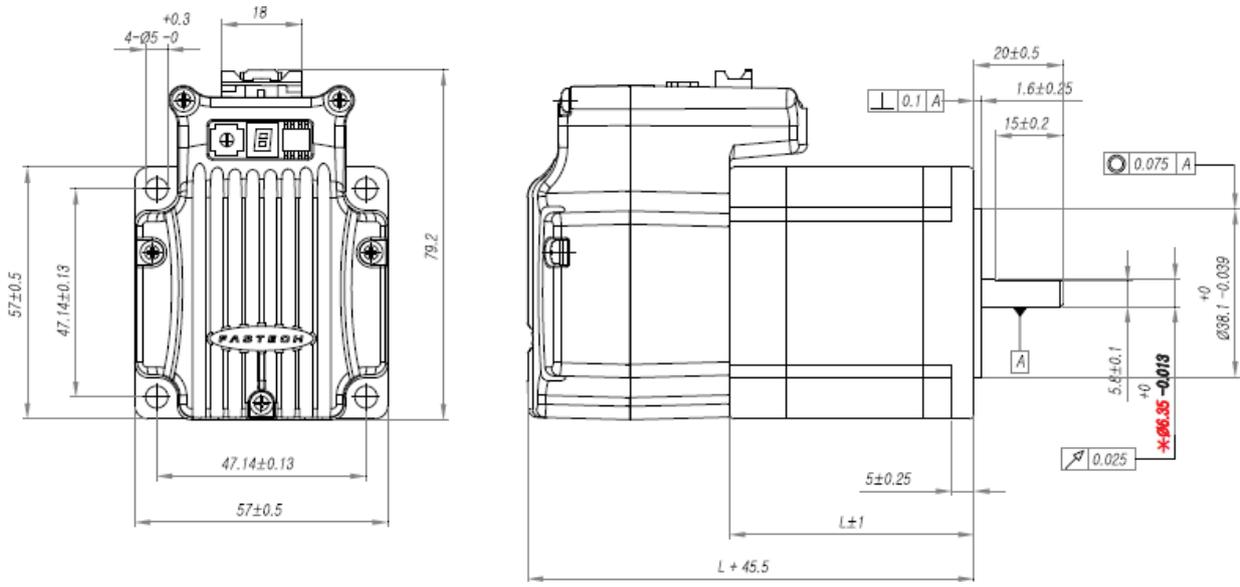


3.7 EzM-86 Series

Ezi-SERVO-PR drive only.

1) Specifications

MODEL	UNIT	EzM-86M-A	EzM-86L-A	EzM-86XL-A
DRIVE METHOD	----	BI-POLAR	BI-POLAR	BI-POLAR
NUMBER OF PHASES	----	2	2	2
VOLTAGE	VDC	2.4	3.6	4.38
CURRENT per PHASE	A	6.0	6.0	6.0
RESISTANCE per PHASE	Ohm	0.4	0.6	0.73
INDUCTANCE per PHASE	mH	3.5	6.5	8.68
HOLDING TORQUE	mN·m	4500	8500	12000
ROTOR INERTIA	$g \cdot \text{cm}^2$	1400	2700	4000
WEIGHTS	kg	2.4	3.9	5.4
LENGTH(L)	mm	79	119	159
ALLOWABLE THRUST LOAD	N	Lower than motor weight		
INSULATION RESISTANCE	MOhm	100min. (at 500VDC)		
INSULATION CLASS	----	CLASS B (130°C)		
OPERATING TEMPERATURE	°C	0 to 55		


2) Dimensions

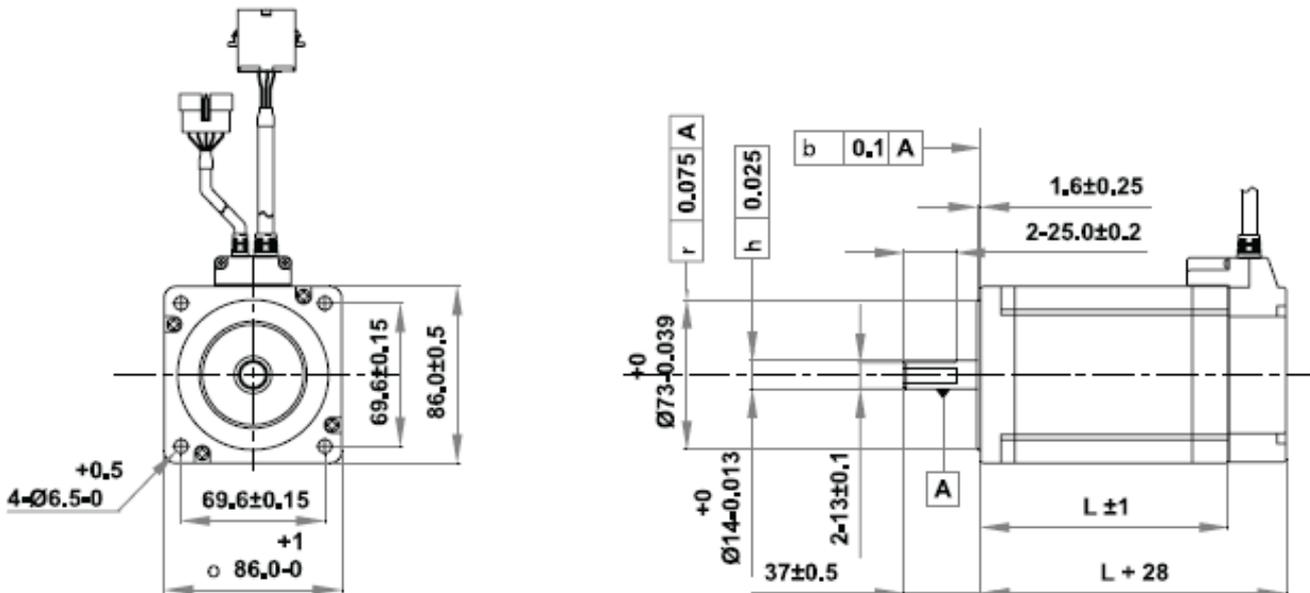


4. Characteristics of Motor Torque

4.1 Ezi-SERVO-PR


Ezi-SERVO PR_ 20M Series

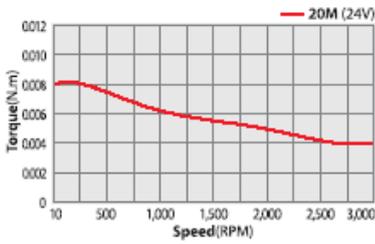


Ezi-SERVO PR_ 20L Series

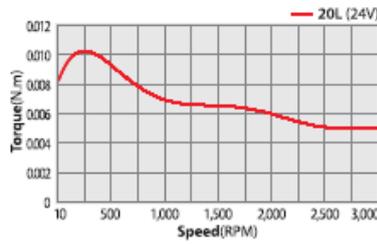


Ezi-SERVO PR_ 28S Series

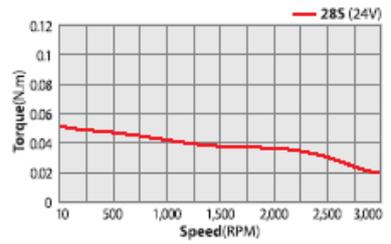


Ezi-SERVO PR_ 28M Series

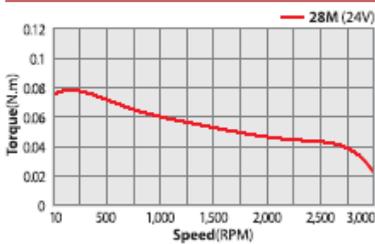


Ezi-SERVO PR_ 28L Series

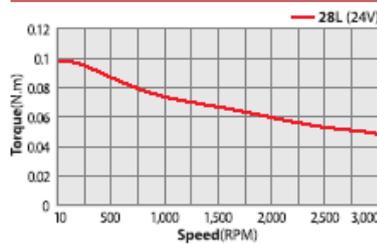


Ezi-SERVO PR_ 35S Series

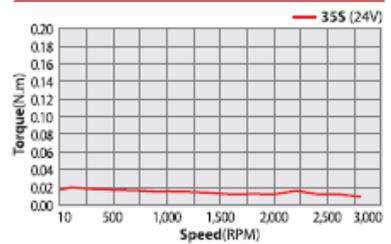


Ezi-SERVO PR_ 35M Series

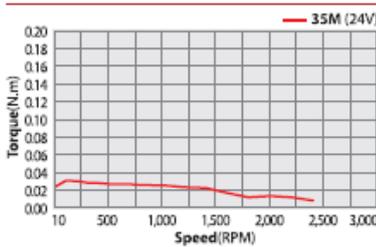


Ezi-SERVO PR_ 35L Series

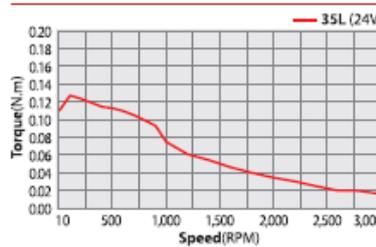


Ezi-SERVO PR_ 35XL Series

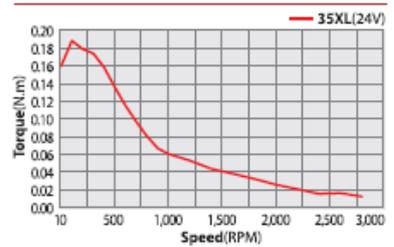


Ezi-SERVO PR_ 42S Series

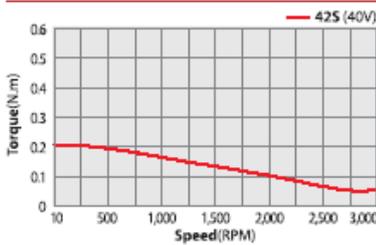


Ezi-SERVO PR_ 42M Series

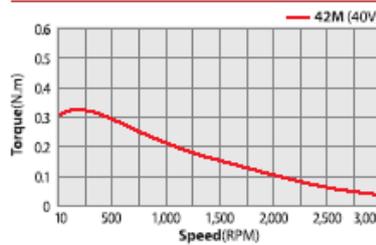


Ezi-SERVO PR_ 42L Series

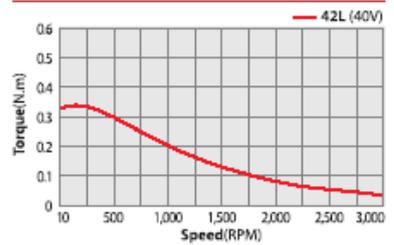


Ezi-SERVO PR_ 42XL Series

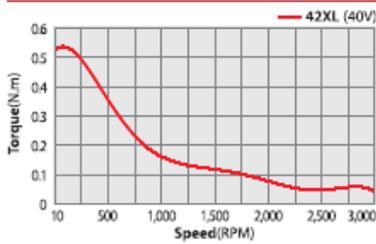


Ezi-SERVO PR_ 56S Series

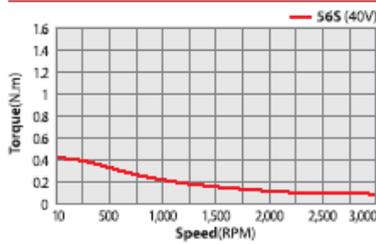


Ezi-SERVO PR_ 56M Series

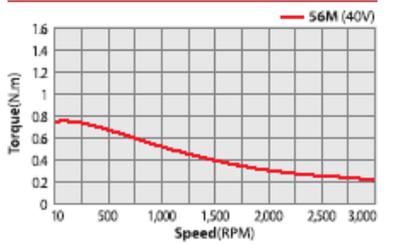


Ezi-SERVO PR_ 56L Series

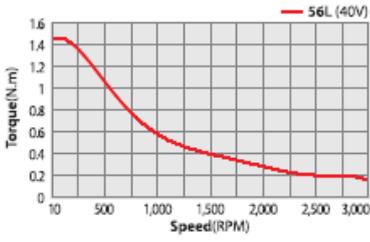


Ezi-SERVO PR_ 60S Series

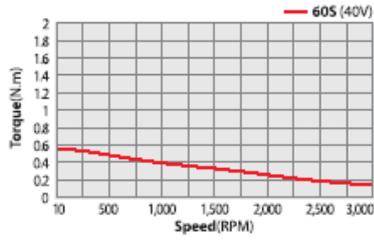


Ezi-SERVO PR_ 60M Series

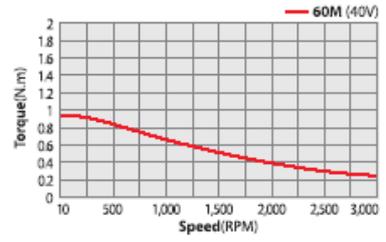


Ezi-SERVO PR_ 60L Series

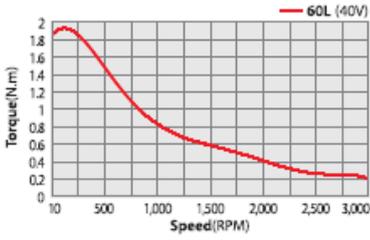


Ezi-SERVO PR_ 86M Series

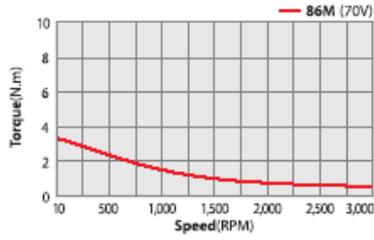

Ezi-SERVO PR_ 86L Series

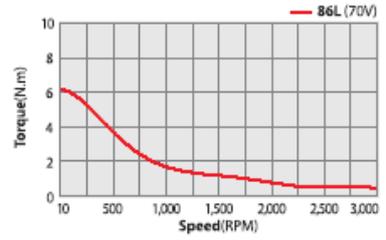


Ezi-SERVO PR_ 86XL Series

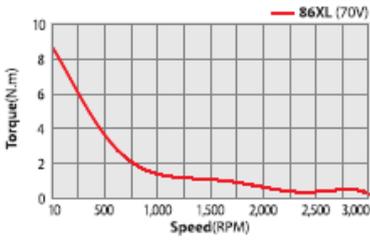


4.2 Ezi-SERVO PR-MI


Ezi-SERVO PR-MI_ 20M Series

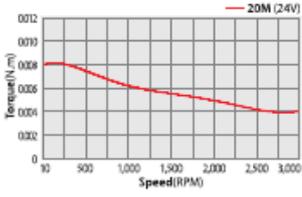


Ezi-SERVO PR-MI_ 20L Series

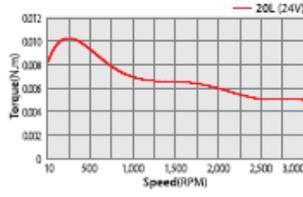


Ezi-SERVO PR-MI_ 28S Series

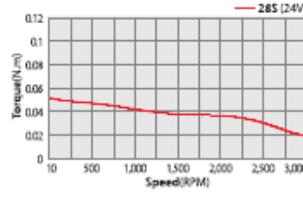


Ezi-SERVO PR-MI_ 28M Series

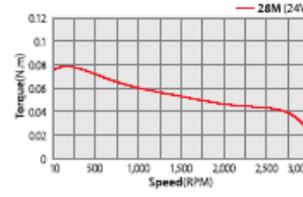


Ezi-SERVO PR-MI_ 28L Series

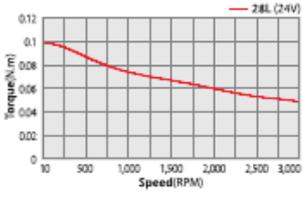


Ezi-SERVO PR-MI_ 35S Series

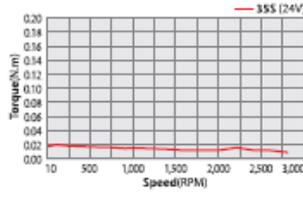


Ezi-SERVO PR-MI_ 35M Series

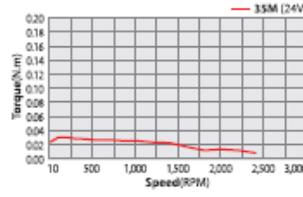


Ezi-SERVO PR-MI_ 35L Series

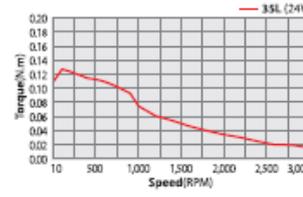


Ezi-SERVO PR-MI_ 35XL Series

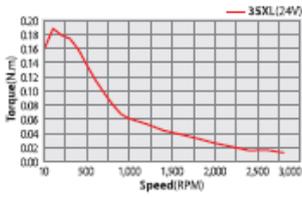


Ezi-SERVO PR-MI_ 42S Series

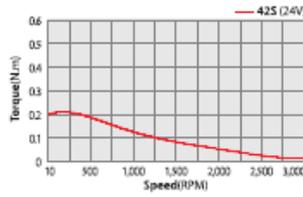


Ezi-SERVO PR-MI_ 42M Series

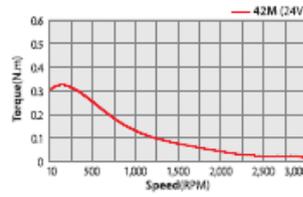

Ezi-SERVO PR-MI_ 42L Series

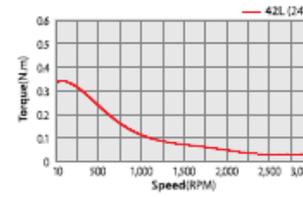


Ezi-SERVO PR-MI_ 42XL Series

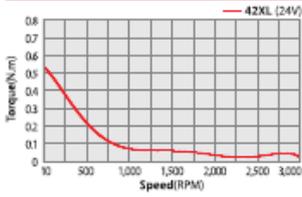


4.3 Ezi-SERVO-ALL


Ezi-SERVO-ALL_ 42S Series

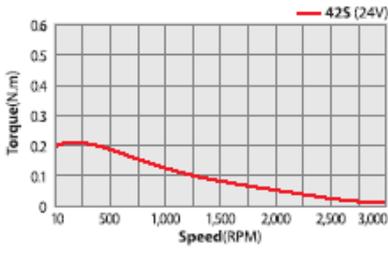


Ezi-SERVO-ALL_ 42M Series

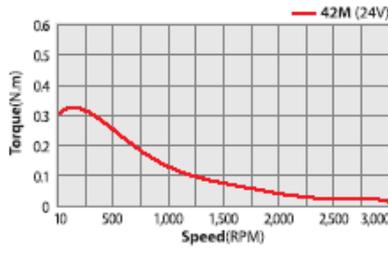


Ezi-SERVO-ALL_ 42L Series

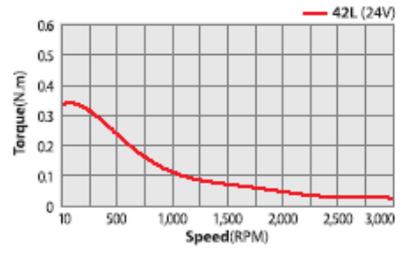


Ezi-SERVO-ALL_ 42XL Series

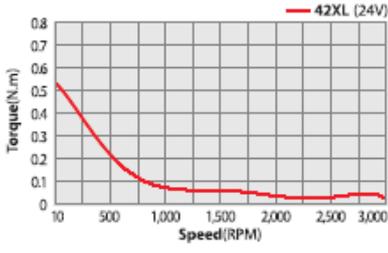


Ezi-SERVO-ALL_ 56S Series

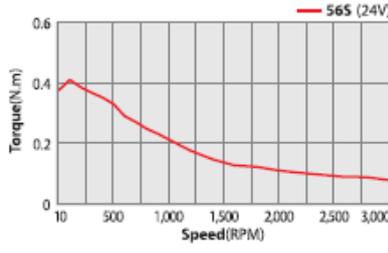


Ezi-SERVO-ALL_ 56M Series

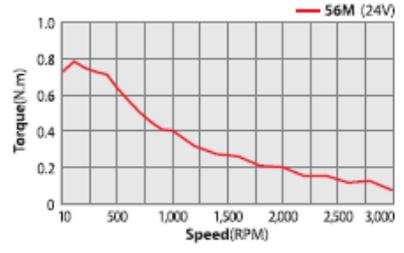


Ezi-SERVO-ALL_ 56L Series

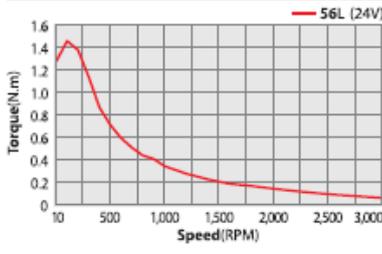


Ezi-SERVO-ALL_ 60S Series

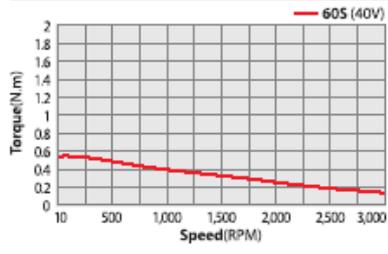

Ezi-SERVO-ALL_ 60M Series

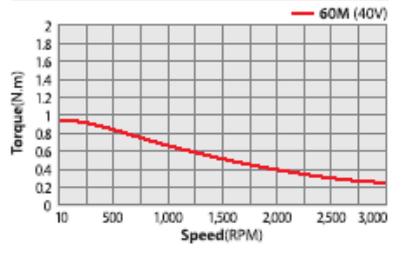

Ezi-SERVO-ALL_ 60L Series

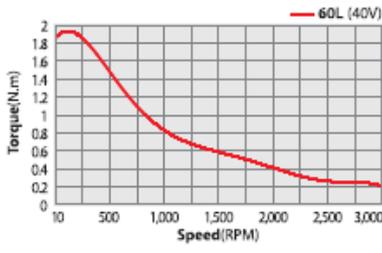


5. Configuration of the Controller

5.1 Combination of Motor and Drive


1) Ezi-SERVO-PR

Ezi-SERVO-PR-56L-A-BK-PN05-□

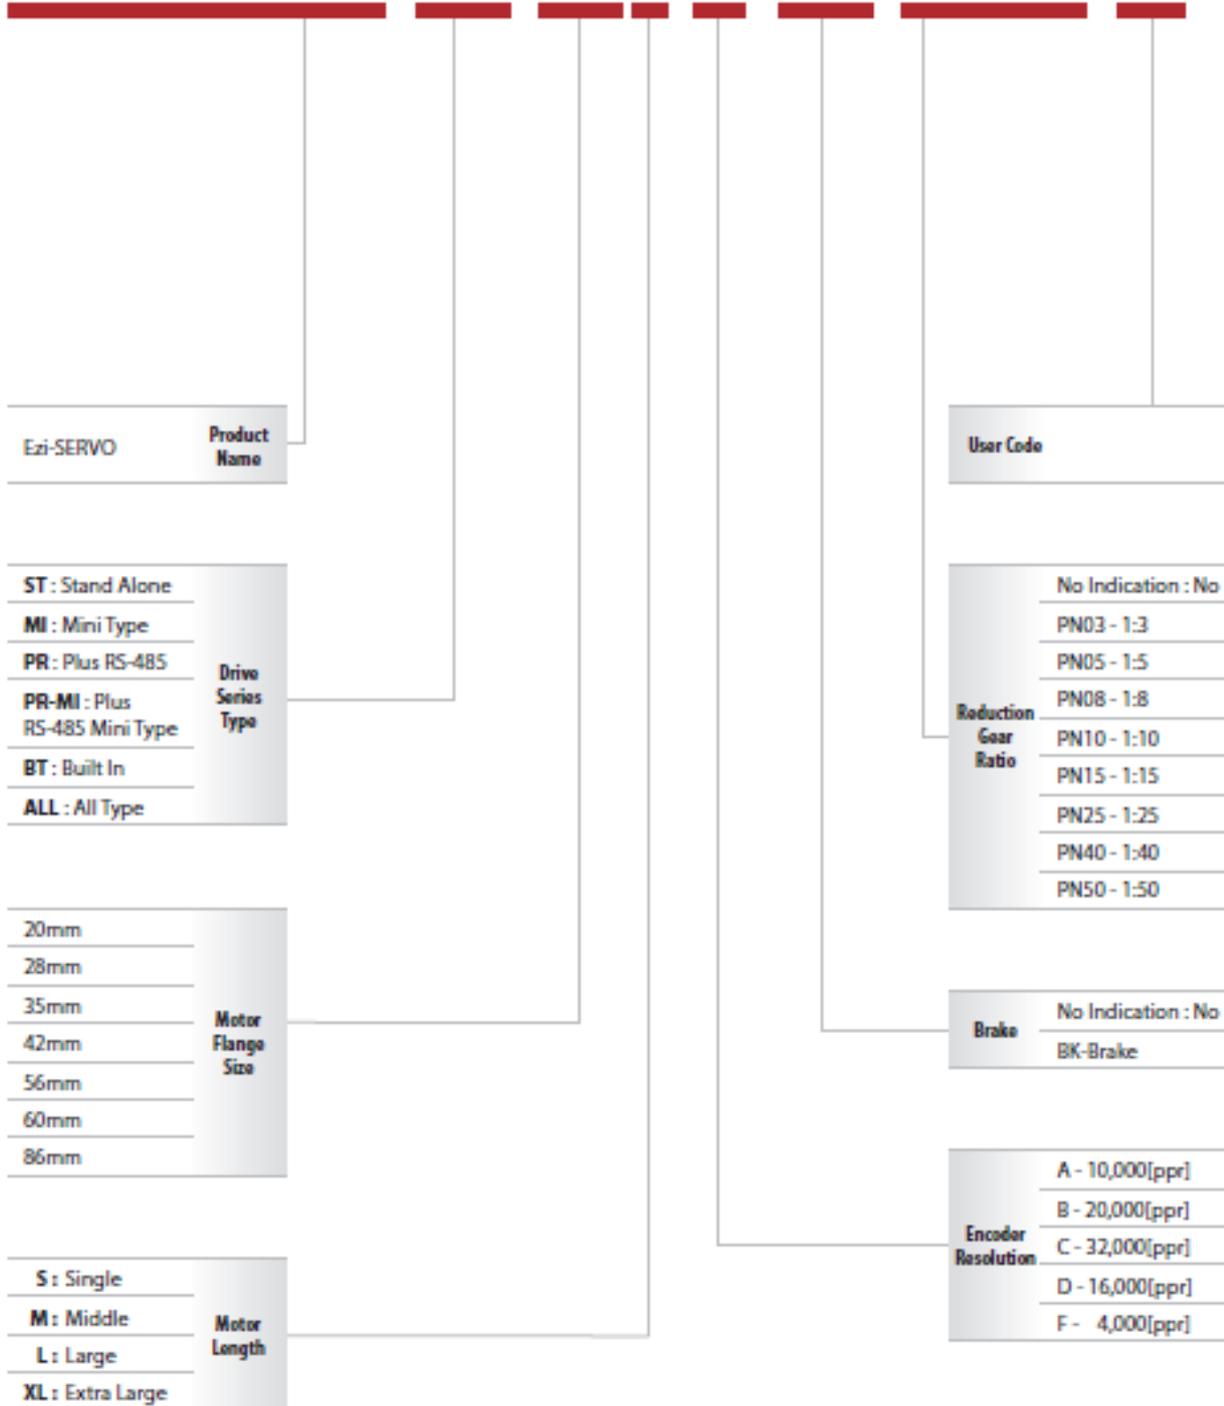


2) Ezi-SERVO-PR-MI

Ezi-SERVO-PR-MI-20M-F-BK-PN05-□

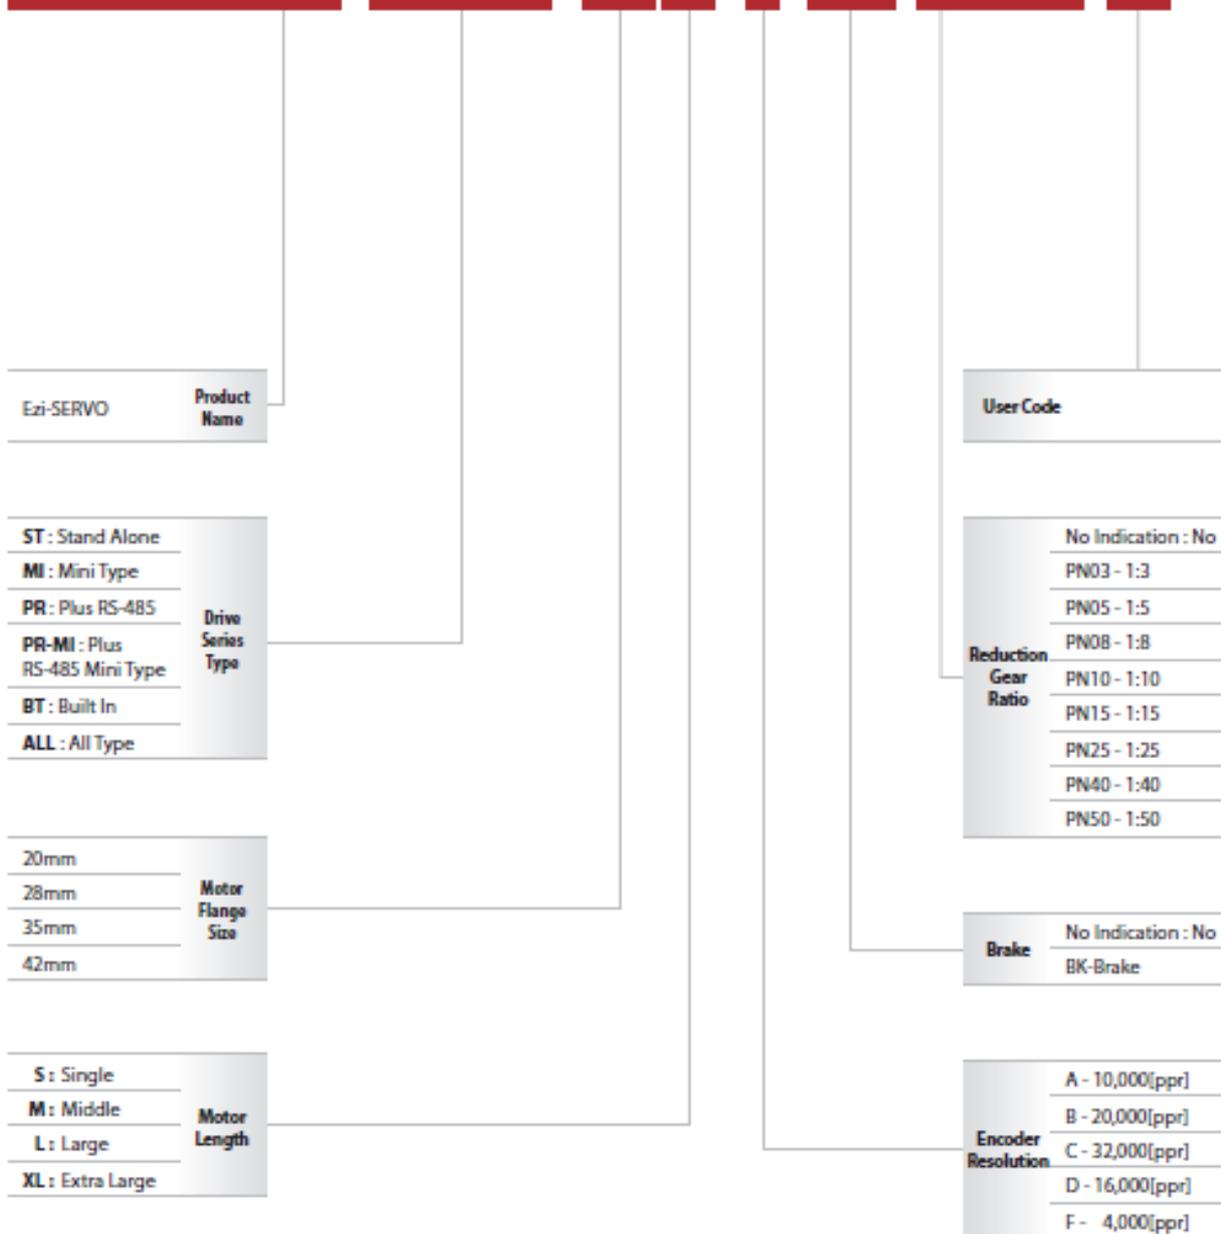

3) Ezi-SERVO-ALL

Ezi-SERVO-ALL-56L-A-BK-PN05-□

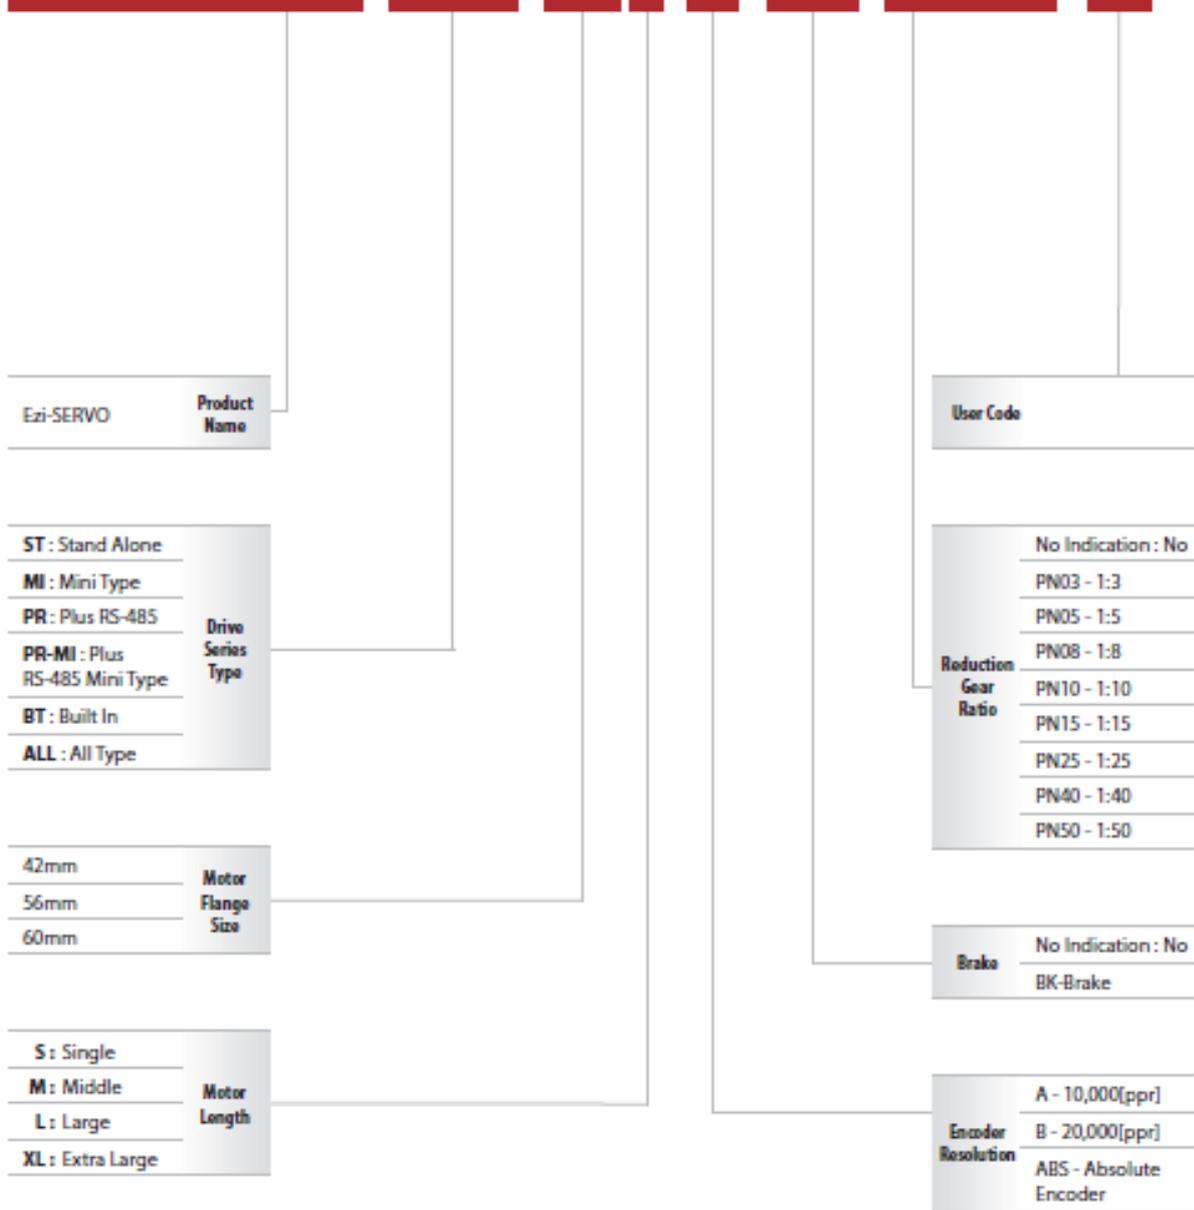

4) Combination of Ezi-SERVO-PR

UNIT No.	MOTOR No.	DRIVE No.
Ezi-SERVO-PR-20M-F	EzM-20M-F	EzS-NDR-20M-F
Ezi-SERVO-PR-20L-F	EzM-20L-F	EzS-NDR-20L-F
Ezi-SERVO-PR-28S-D	EzM-28S-D	EzS-NDR-28S-D
Ezi-SERVO-PR-28M-D	EzM-28M-D	EzS-NDR-28M-D
Ezi-SERVO-PR-28L-D	EzM-28L-D	EzS-NDR-28L-D
Ezi-SERVO-PR-35S-D	EzM-35S-D	EzS-NDR-35S-D
Ezi-SERVO-PR-35M-D	EzM-35M-D	EzS-NDR-35M-D
Ezi-SERVO-PR-35L-D	EzM-35L-D	EzS-NDR-35L-D
Ezi-SERVO-PR-35XL-D	EzM-35XL-D	EzS-NDR-35XL-D
Ezi-SERVO-PR-42S-A	EzM-42S-A	EzS-NDR-42S-A
Ezi-SERVO-PR-42S-B	EzM-42S-B	EzS-NDR-42S-B
Ezi-SERVO-PR-42S-C	EzM-42S-C	EzS-NDR-42S-C
Ezi-SERVO-PR-42M-A	EzM-42M-A	EzS-NDR-42M-A
Ezi-SERVO-PR-42M-B	EzM-42M-B	EzS-NDR-42M-B
Ezi-SERVO-PR-42M-C	EzM-42M-C	EzS-NDR-42M-C
Ezi-SERVO-PR-42L-A	EzM-42L-A	EzS-NDR-42L-A
Ezi-SERVO-PR-42L-B	EzM-42L-B	EzS-NDR-42L-B
Ezi-SERVO-PR-42L-C	EzM-42L-C	EzS-NDR-42L-C
Ezi-SERVO-PR-42XL-A	EzM-42XL-A	EzS-NDR-42XL-A
Ezi-SERVO-PR-42XL-B	EzM-42XL-B	EzS-NDR-42XL-B
Ezi-SERVO-PR-42XL-C	EzM-42XL-C	EzS-NDR-42XL-C
Ezi-SERVO-PR-56S-A	EzM-56S-A	EzS-NDR-56S-A
Ezi-SERVO-PR-56S-B	EzM-56S-B	EzS-NDR-56S-B
Ezi-SERVO-PR-56S-C	EzM-56S-C	EzS-NDR-56S-C
Ezi-SERVO-PR-56M-A	EzM-56M-A	EzS-NDR-56M-A
Ezi-SERVO-PR-56M-B	EzM-56M-B	EzS-NDR-56M-B
Ezi-SERVO-PR-56M-C	EzM-56M-C	EzS-NDR-56M-C
Ezi-SERVO-PR-56L-A	EzM-56L-A	EzS-NDR-56L-A
Ezi-SERVO-PR-56L-B	EzM-56L-B	EzS-NDR-56L-B
Ezi-SERVO-PR-56L-C	EzM-56L-C	EzS-NDR-56L-C

5) Combination of Ezi-SERVO-PR-MI


UNIT No.	MOTOR No.	DRIVE No.
Ezi-SERVO-PR-MI-20M-F	EzM-20M-F	EzS-NDR-MI-20M-F
Ezi-SERVO-PR-MI-20L-F	EzM-20L-F	EzS-NDR-MI-20L-F
Ezi-SERVO-PR-MI-28S-D	EzM-28S-D	EzS-NDR-MI-28S-D
Ezi-SERVO-PR-MI-28M-D	EzM-28M-D	EzS-NDR-MI-28M-D
Ezi-SERVO-PR-MI-28L-D	EzM-28L-D	EzS-NDR-MI-28L-D
Ezi-SERVO-PR-MI-35S-D	EzM-35S-D	EzS-NDR-MI-35S-D
Ezi-SERVO-PR-MI-35M-D	EzM-35M-D	EzS-NDR-MI-35M-D
Ezi-SERVO-PR-MI-35L-D	EzM-35L-D	EzS-NDR-MI-35L-D
Ezi-SERVO-PR-MI-35XL-D	EzM-35XL-D	EzS-NDR-MI-35XL-D
Ezi-SERVO-PR-MI-42S-A	EzM-42S-A	EzS-NDR-MI-42S-A
Ezi-SERVO-PR-MI-42S-B	EzM-42S-B	EzS-NDR-MI-42S-B
Ezi-SERVO-PR-MI-42S-C	EzM-42S-C	EzS-NDR-MI-42S-C
Ezi-SERVO-PR-MI-42M-A	EzM-42M-A	EzS-NDR-MI-42M-A
Ezi-SERVO-PR-MI-42M-B	EzM-42M-B	EzS-NDR-MI-42M-B
Ezi-SERVO-PR-MI-42M-C	EzM-42M-C	EzS-NDR-MI-42M-C
Ezi-SERVO-PR-MI-42L-A	EzM-42L-A	EzS-NDR-MI-42L-A
Ezi-SERVO-PR-MI-42L-B	EzM-42L-B	EzS-NDR-MI-42L-B
Ezi-SERVO-PR-MI-42L-C	EzM-42L-C	EzS-NDR-MI-42L-C
Ezi-SERVO-PR-MI-42XL-A	EzM-42XL-A	EzS-NDR-MI-42XL-A
Ezi-SERVO-PR-MI-42XL-B	EzM-42XL-B	EzS-NDR-MI-42XL-B
Ezi-SERVO-PR-MI-42XL-C	EzM-42XL-C	EzS-NDR-MI-42XL-C

6) Combination of Ezi-SERVO-ALL


UNIT No.	MOTOR No.	DRIVE No.
Ezi-SERVO-ALL-42S-A	Motor & Drive & Controller Integrated	
Ezi-SERVO-ALL-42S-B		
Ezi-SERVO-ALL-42M-A		
Ezi-SERVO-ALL-42M-B		
Ezi-SERVO-ALL-42L-A		
Ezi-SERVO-ALL-42L-B		
Ezi-SERVO-ALL-42XL-A		
Ezi-SERVO-ALL-42XL-B		
Ezi-SERVO-ALL-56S-A		
Ezi-SERVO-ALL-56S-B		
Ezi-SERVO-ALL-56M-A		
Ezi-SERVO-ALL-56M-B		
Ezi-SERVO-ALL-56L-A		
Ezi-SERVO-ALL-56L-B		
Ezi-SERVO-ALL-60S-A		
Ezi-SERVO-ALL-60S-B		
Ezi-SERVO-ALL-60M-A		
Ezi-SERVO-ALL-60M-B		
Ezi-SERVO-ALL-60L-A		
Ezi-SERVO-ALL-60L-B		
Ezi-SERVO-ALL-60L-ABS		

5.2 Controller Configuration


1) Configuration of Ezi-SERVO-PR20/ Ezi-SERVO-PR28/ Ezi-SERVO-PR42/ Ezi-SERVO-PR56/ Ezi-SERVO-PR60

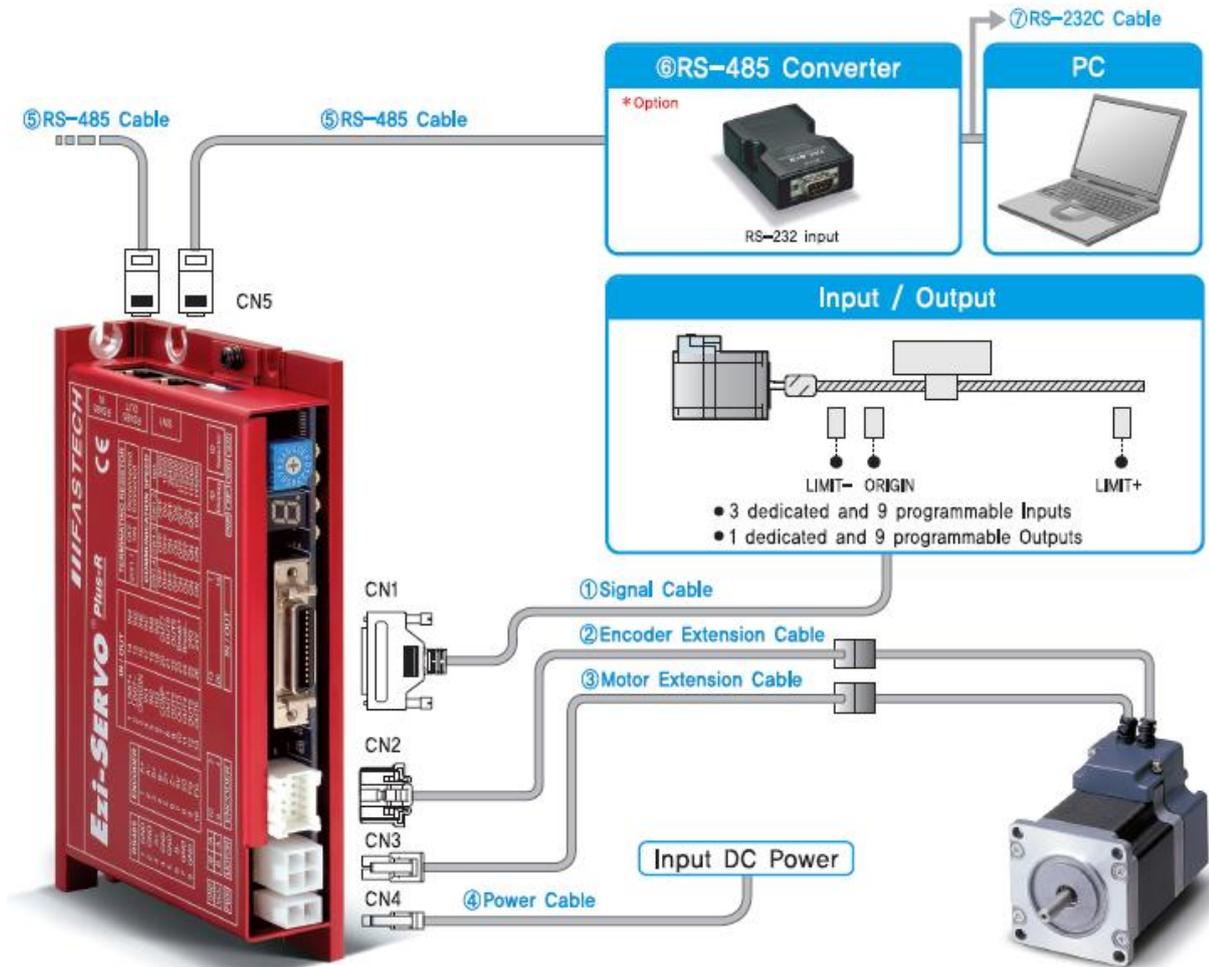


2) Configuration of Ezi-SERVO-PR86

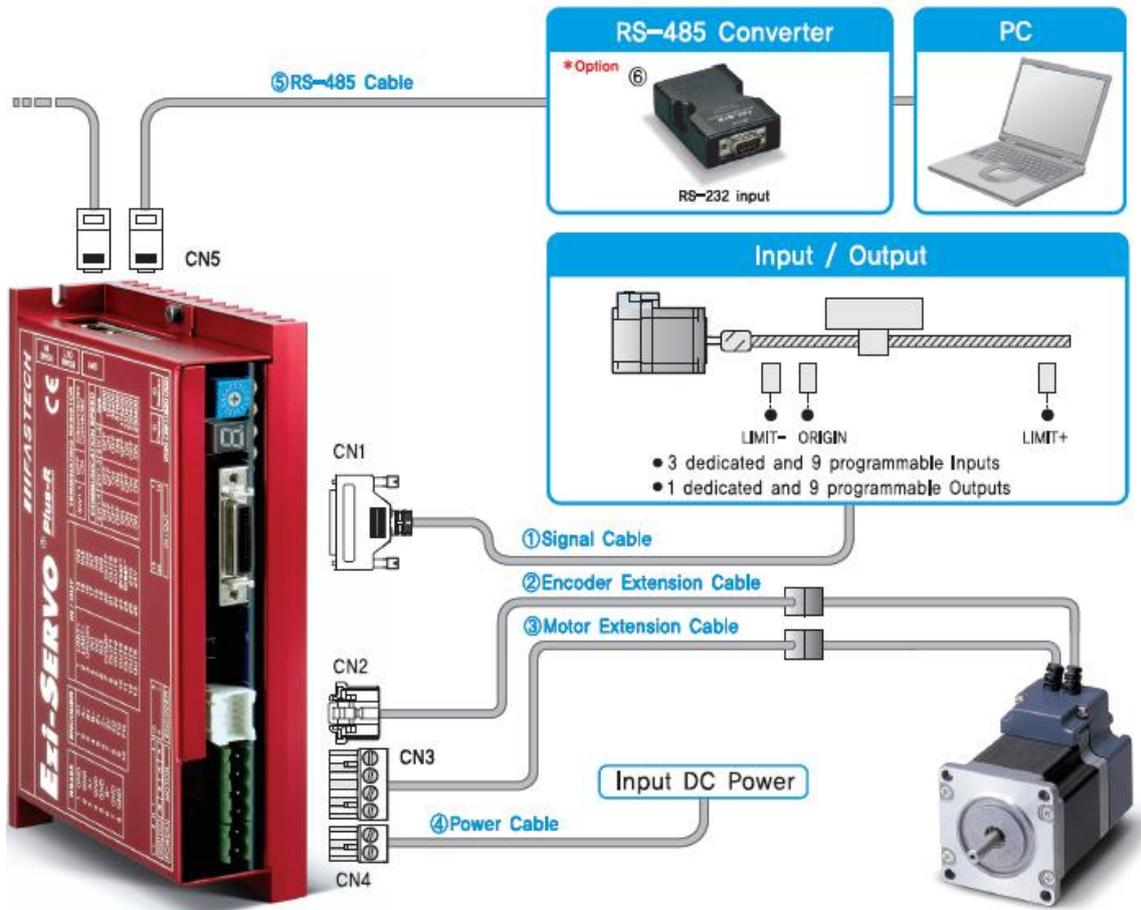


3) Configuration of Ezi-SERVO-PR-MI

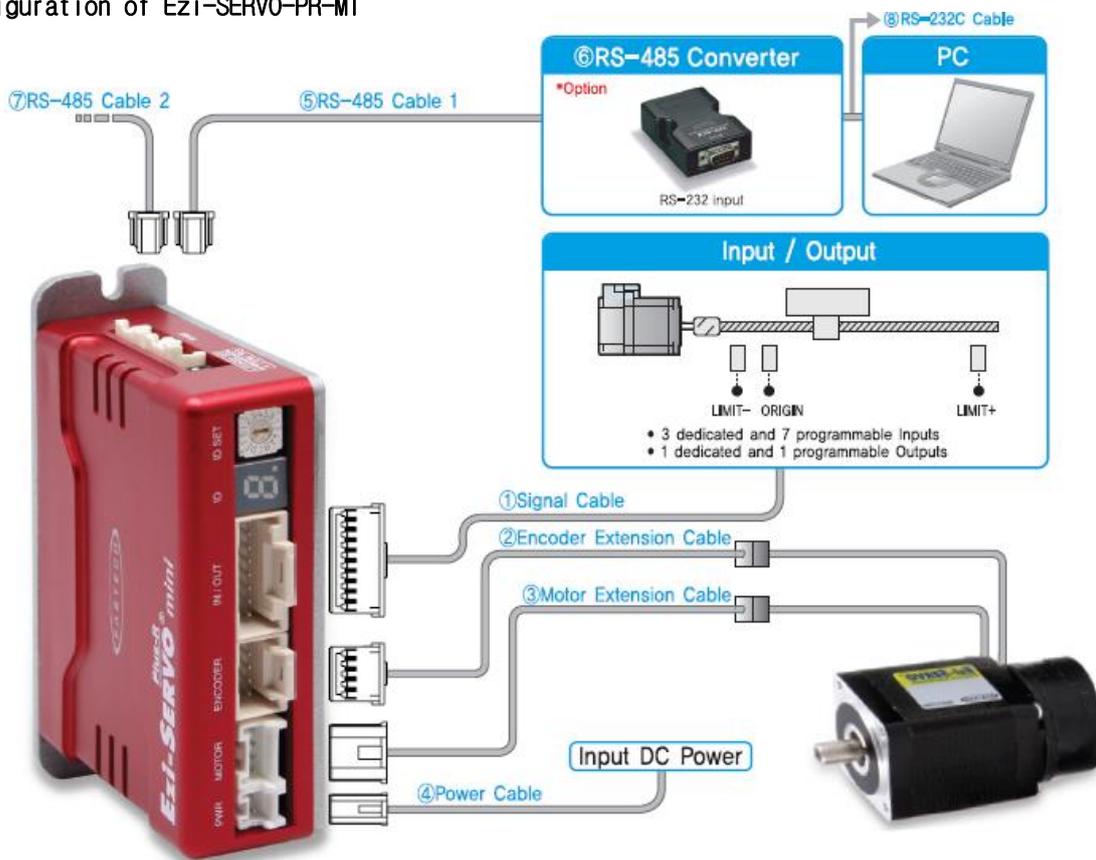

4) Configuration of Ezi-SERVO-ALL42 / Ezi-SERVO-ALL56

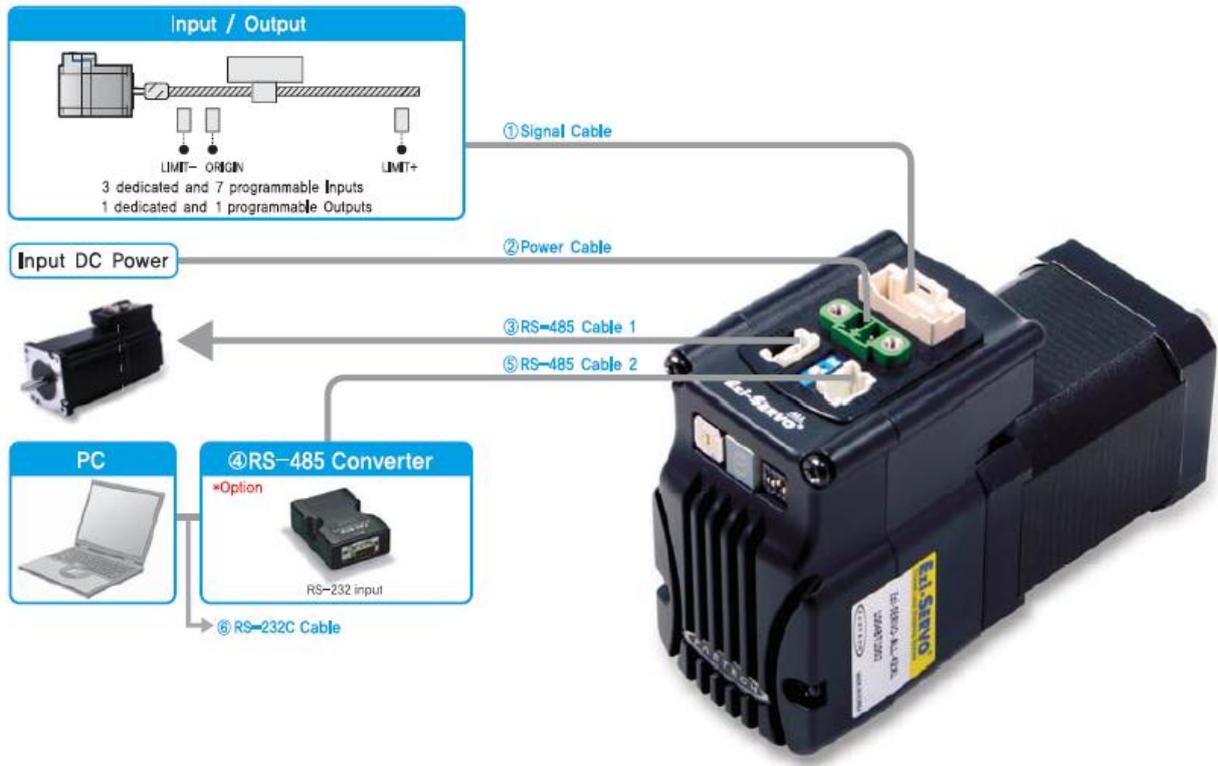


5) Configuration of Ezi-SERVO-ALL60

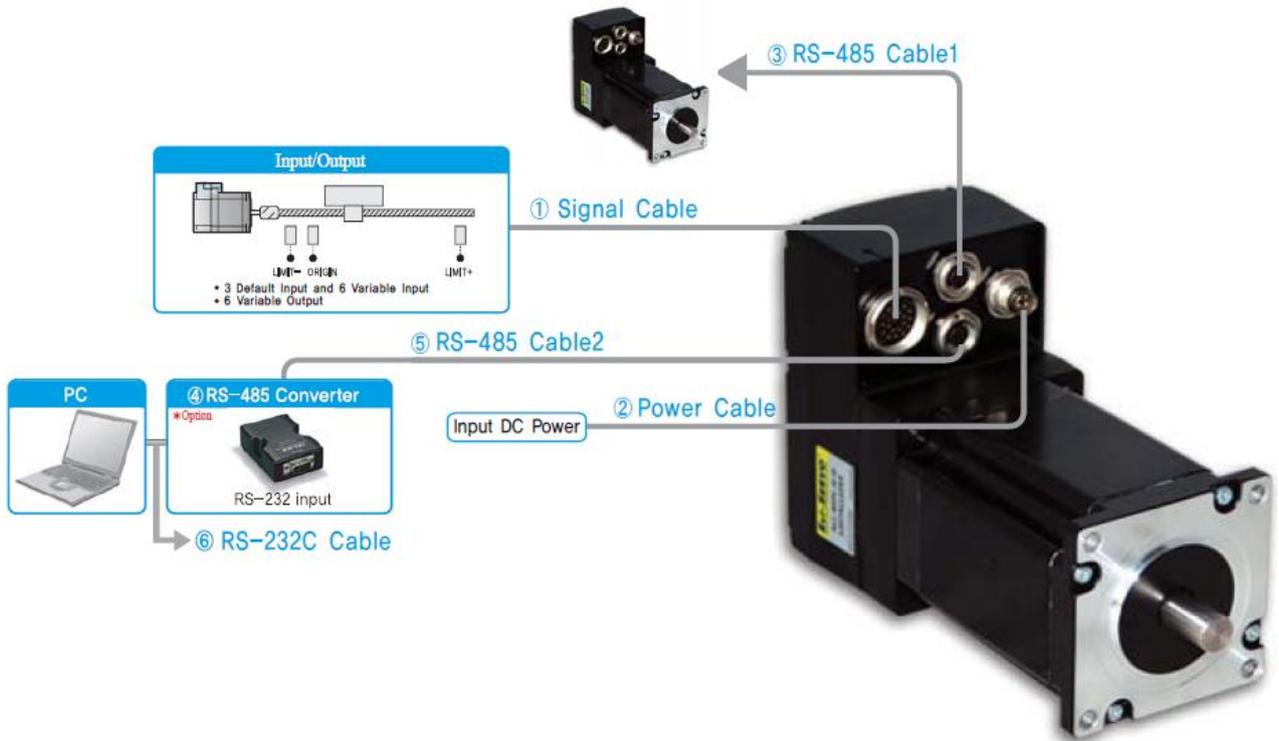


5.3 External Wiring Diagram

1) Wiring of Ezi-SERVO-PR20/ Ezi-SERVO-PR28/ Ezi-SERVO-PR42/ Ezi-SERVO-PR56/ Ezi-SERVO-PR60

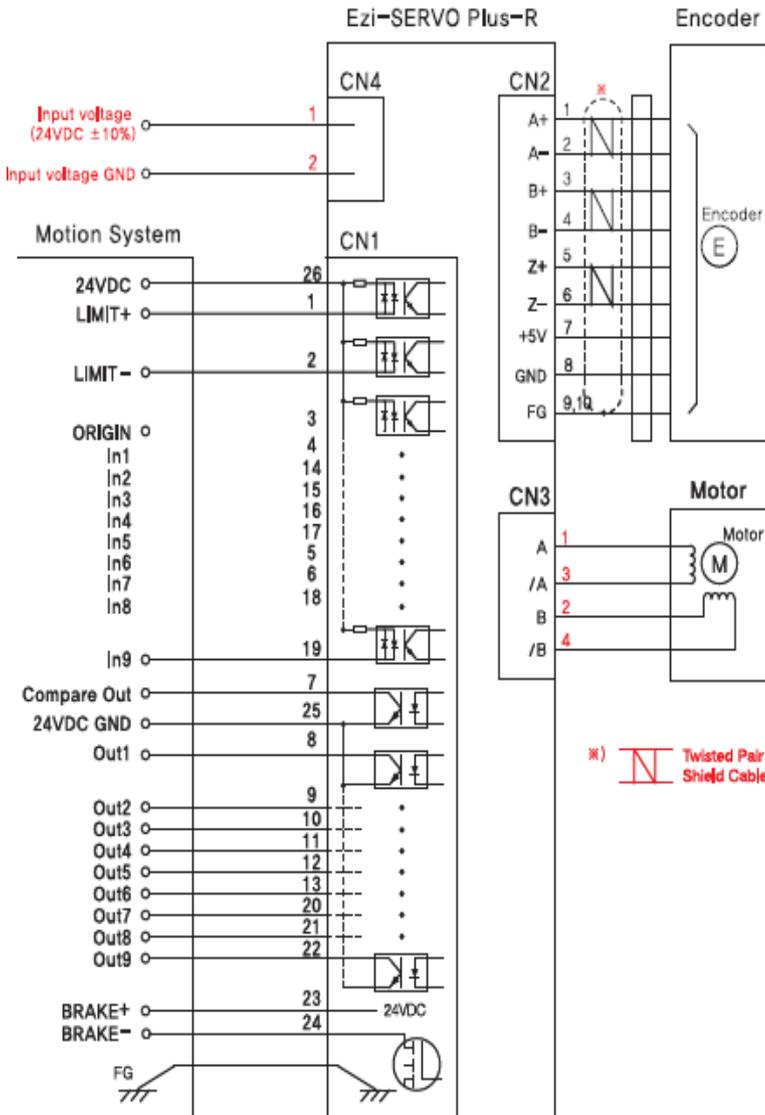

※ CAUTION ※
 Please refer to the Manual when connects motor extension cable. Careful connection will be required to protect any damages.


2) Wiring of Ezi-SERVO-PR86

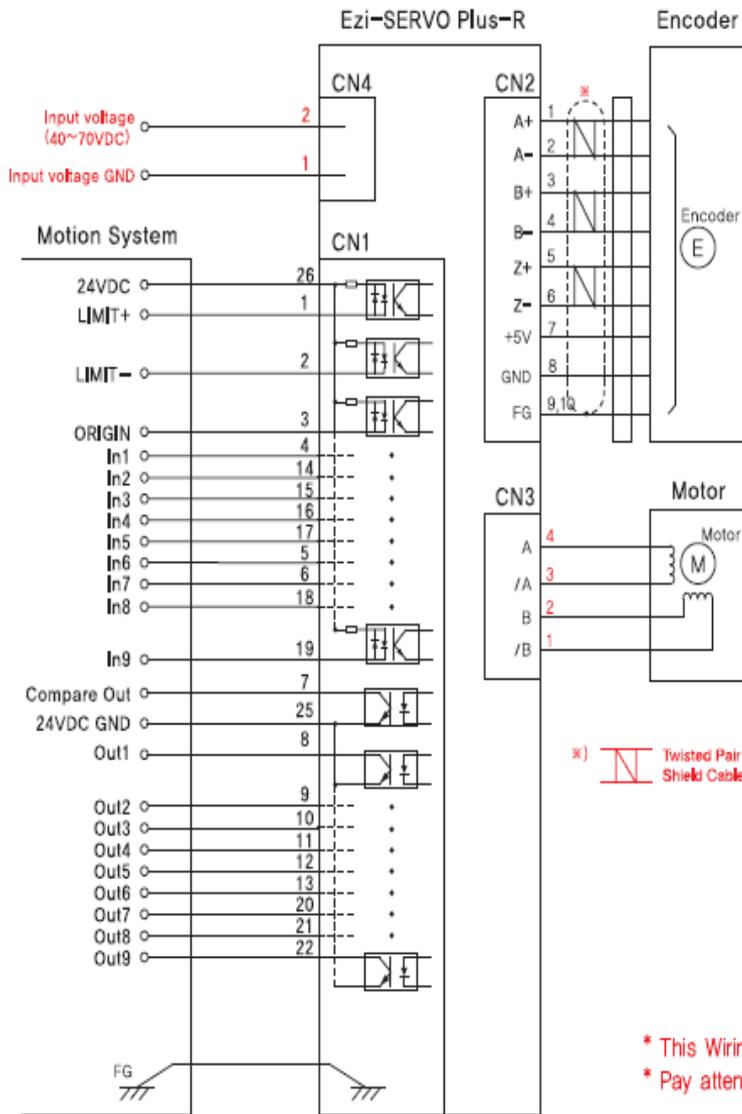


※ CAUTION ※
 Please refer to the Manual when connects motor extension cable. Careful connection will be required to protect any damages.

* This Wiring Diagram is only for 86mm motor drive(EzS-NDR-86 series).
 * Pay attention to red color that describe the difference.


3) Wiring of Ezi-SERVO-PR-MI

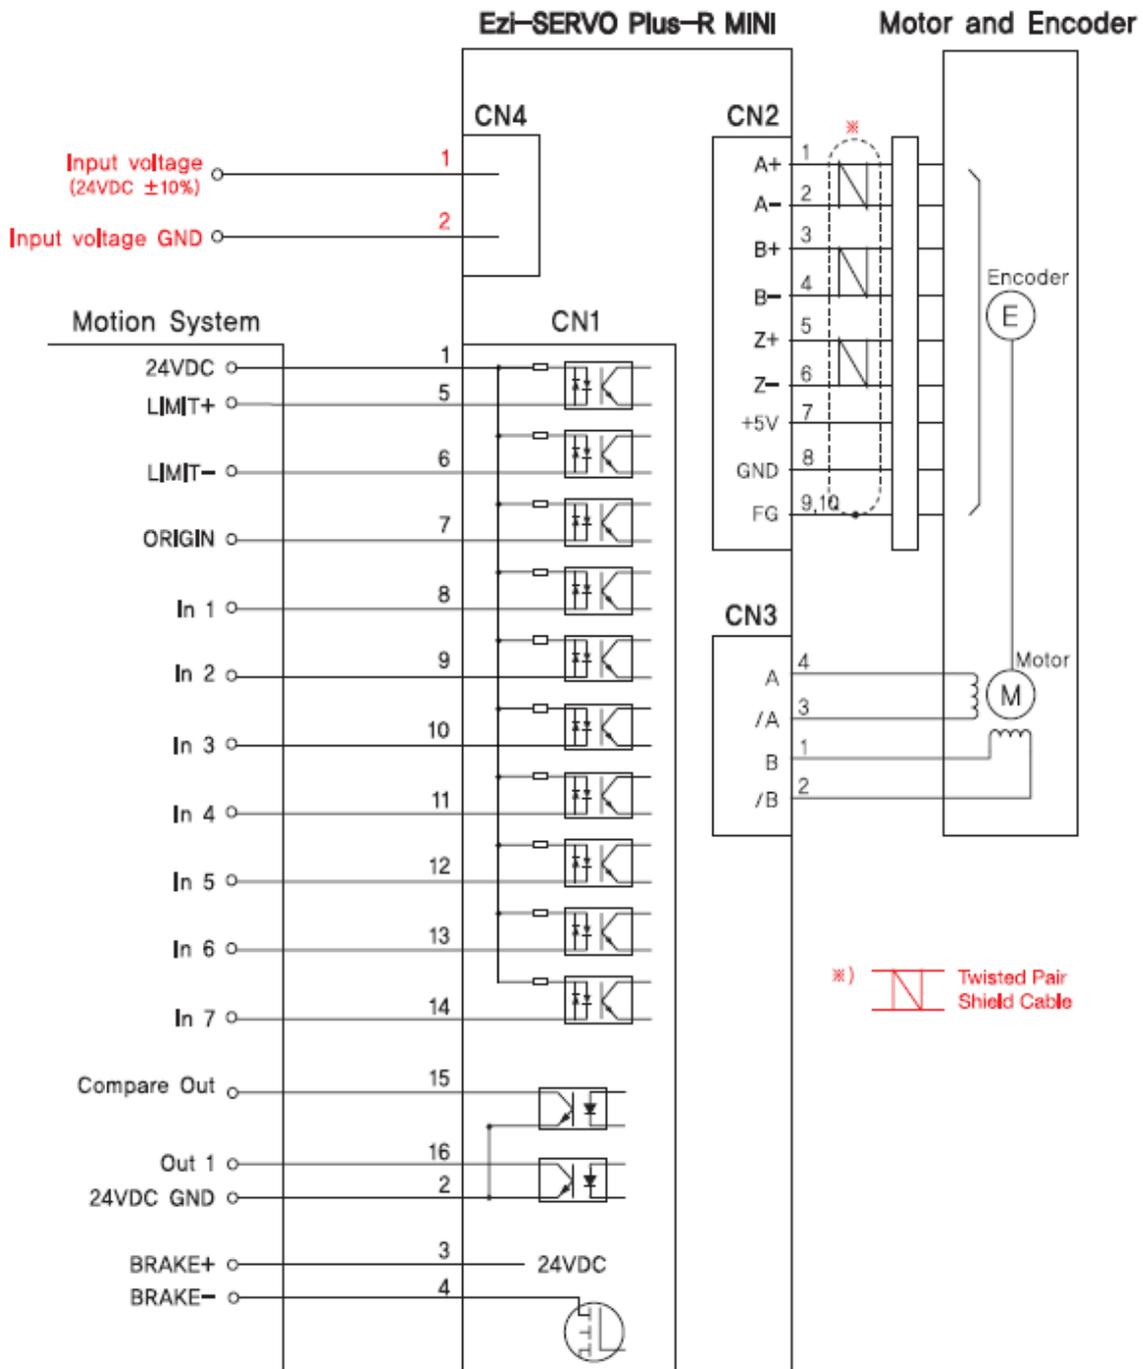


4) Wiring of Ezi-SERVO-ALL42 / Ezi-SERVO-ALL56

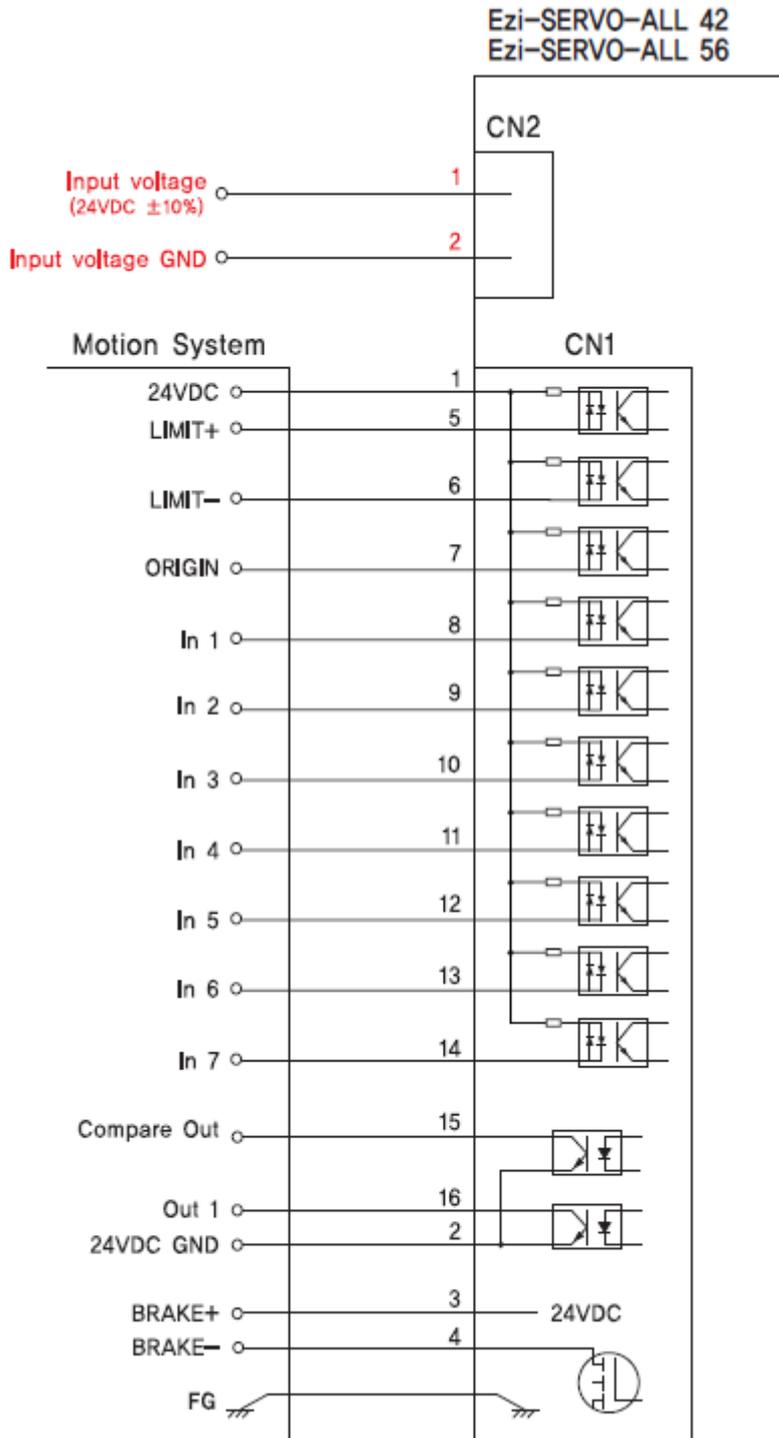

5) Wiring of Ezi-SERVO-ALL60

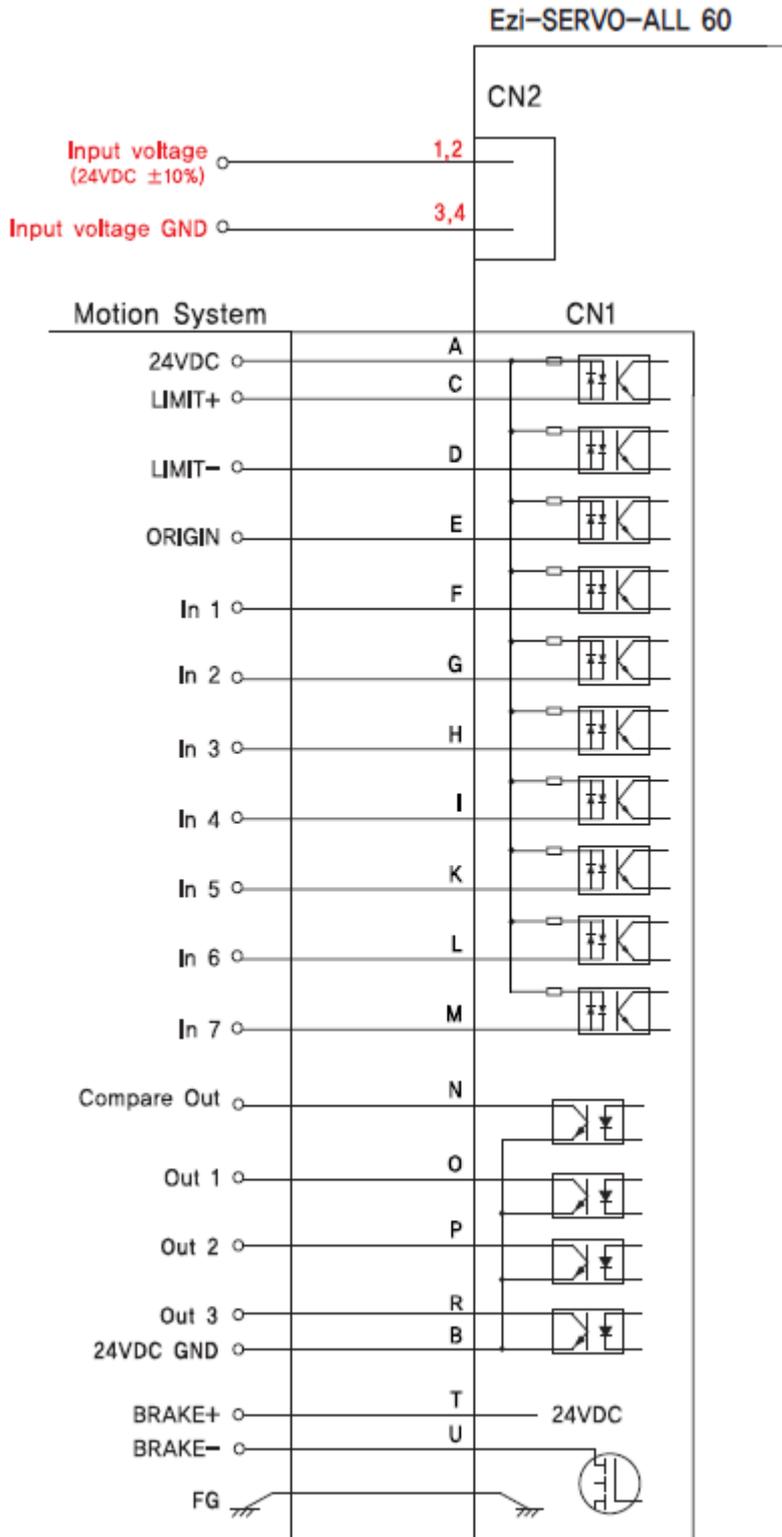


6) Wiring of Ezi-SERVO-ALL60-ABS

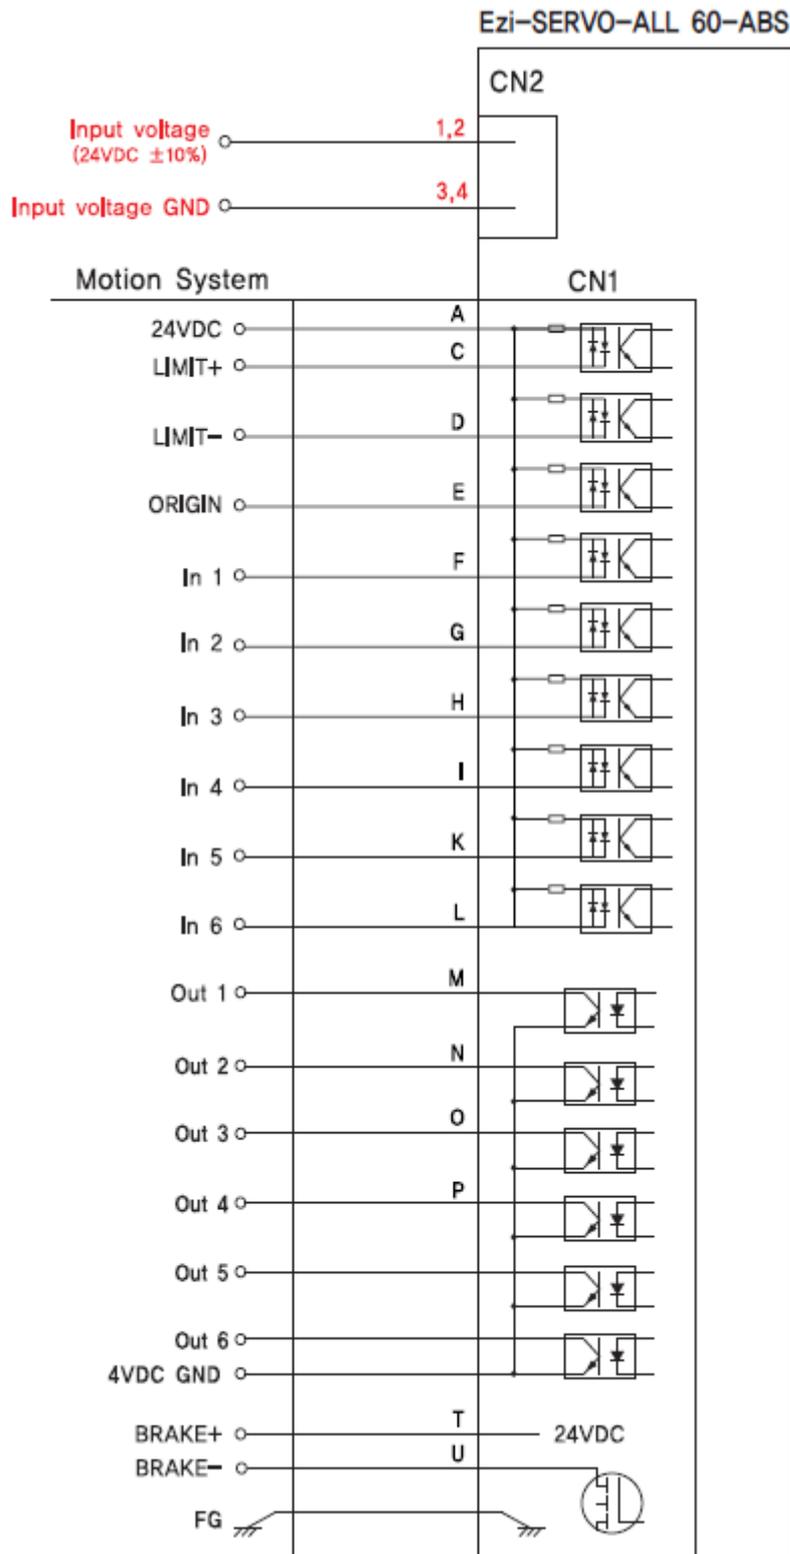

6. External Name and Function Setting of Ezi-SERVO-PR


6.1 Appearance and Part Name

- 1) External setting of Ezi-SERVO-PR20/ Ezi-SERVO-PR28/ Ezi-SERVO-PR42/ Ezi-SERVO-PR56/ Ezi-SERVO-PR60

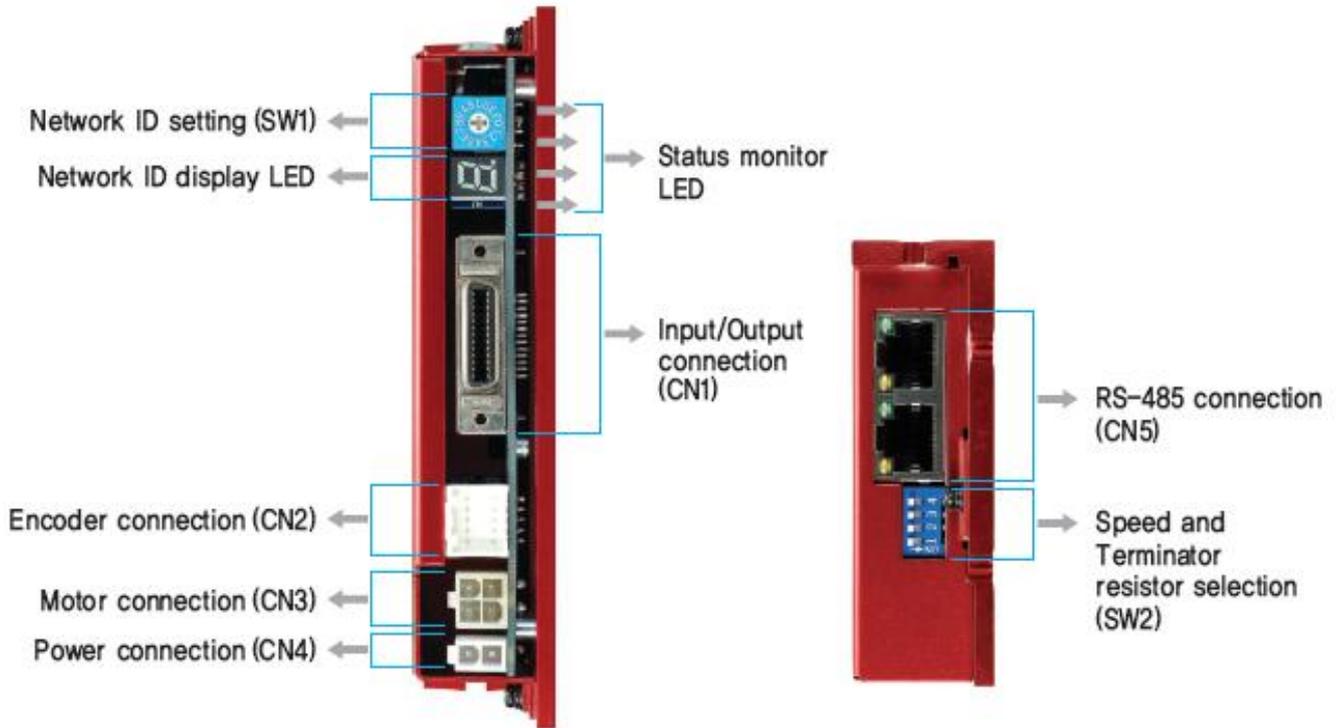

- 2) External setting of Ezi-SERVO-PR86

◆ 86mm motor drive only(EzS-NDR-86 Series)

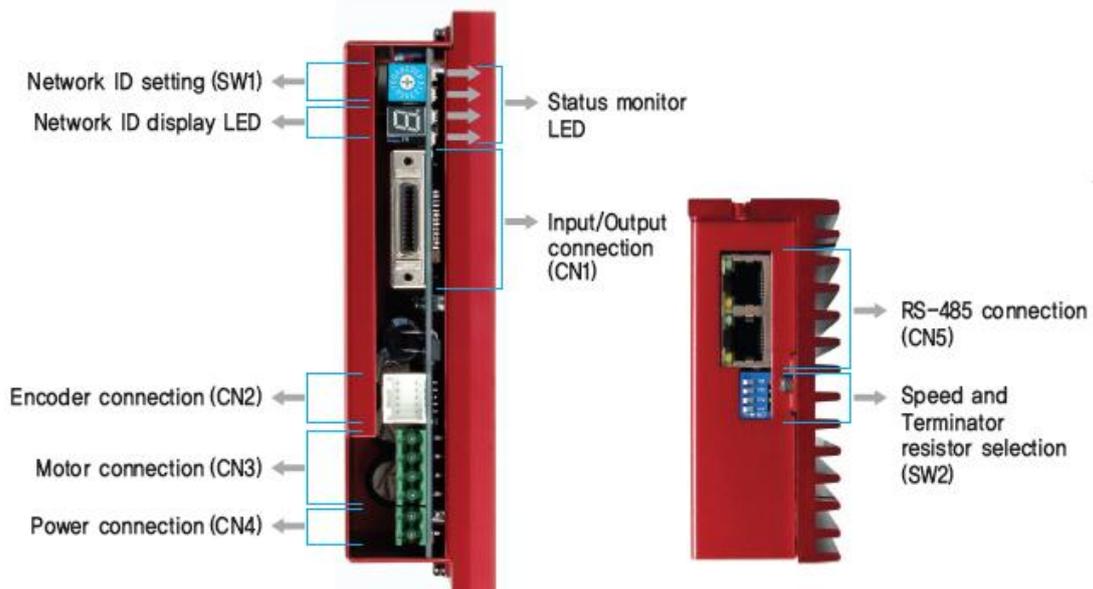

6.2 Status Display LED

Display	Color	Function	On/Off Condition
① POW	Green	Power input indication	Lights On when power is applied.
② INP	Yellow	Complete Positioning motion	When position command pulse input and then the position deviation is within the value set by the parameter, this lights On.
③ SON	Orange	Servo On/Off indication	Servo On : light On Servo Off : light Off
④ ALM	Red	Alarm indication	Flash when protective function is activated. (If you count LED flash time, you can check what protective function is run.)

6.3 Drive ID Switch Selection (SW1)

- When several modules are connected to one daisy chain network, this switch is to set intrinsic ID to each module.
- The switch can set intrinsic ID to each module up to 16 numbers from 0 to F(15).


Position	ID No.	Position	ID No.
0	0	8	8
1	1	9	9
2	2	A	10
3	3	B	11
4	4	C	12
5	5	D	13
6	6	E	14
7	7	F	15



6.4 Communication Speed and Terminal Resistance Select Switch(SW2)

SW2 is to set the communication speed between central controller(PC) and Drive. If corresponding drive module is connected to the end of one network segment, SW2 sets whether terminal resistance is used. SW2.1 is to set the use of terminal resistance, and SW2.2~SW2.4 is to set the communication speed as follows.

SW2.1	SW2.2	SW2.3	SW2.4	Baud rate [bps]	*1 : default setting value.
X	OFF	OFF	OFF	9600	
X	ON	OFF	OFF	19200	
X	OFF	ON	OFF	38400	
X	ON	ON	OFF	57600	
X	OFF	OFF	ON	115200 *1	
X	ON	OFF	ON	230400	SW2.1 is OFF.: Terminal resistance is Off.
X	OFF	ON	ON	460800	SW2.1 is ON. : Terminal resistance is On.
X	ON	ON	ON	921600	

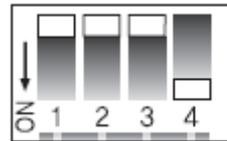

Caution

The communication speed of drive modules connected to one segment must be set with same value.



Caution

Support max. 115200[bps] when using RS-232 to RS-485 conveter.

6.5 Motor Connection (CN3)

Motor connector


(Connector Type : Molex 5569-04A2)

(86mm)

No.	Function
1	A Phase
2	B Phase
3	/A Phase
4	/B Phase




No.	Function
1	/B Phase
2	B Phase
3	/A Phase
4	A Phase

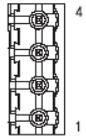

6.6 Encoder Connection (CN2)

Encoder connector (Connector Type : Molex 55959-1030)

No.	Function
1	A+
2	A-
3	B+
4	B-
5	Z+
6	Z-
7	5VDC
8	5VDC GND
9	Frame GND
10	Frame GND

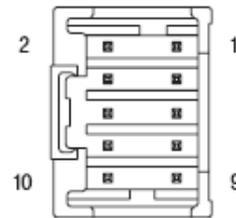

To setup connected encoder resolution, refer to 「13 Parameter」.

6.7 Power Connection(CN4)

Power supply connector (Connector Type : Molex 5569-02A2)


No.	Function
1	Power input : 24VDC \pm 10%
2	Power input : GND



(86mm : PTR AK950-2)

6.8

No.	Function
1	Power input : GND
2	Power input : 40~70VDC

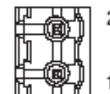

1/0

Signal Connection (CN1)

Input/output signal connector (Connector Type : 3M 10226-5A2JL)


The programmable input/output pin is set by using user program(GUI) or DLL library.



Connect the Brake (current consumption is under 200[mA]) for pin 24.
Refer to [8.4 Output signal](#) for the Brake that is over 200[mA].

Function	No	No	Function
LIMIT+ (Dedicated Input)	1	14	Digital In2 (Programmable Input)
LIMIT- (Dedicated Input)	2	15	Digital In3 (Programmable Input)
ORIGIN (Dedicated Input)	3	16	Digital In4 (Programmable Input)
Digital In1 (Programmable Input)	4	17	Digital In5 (Programmable Input)
Digital In6 (Programmable Input)	5	18	Digital In8 (Programmable Input)
Digital In7 (Programmable Input)	6	19	Digital In9 (Programmable Input)
Compare Out/COMP (Dedicated Output)	7	20	Digital Out7 (Programmable Output)
Digital Out1 (Programmable Output)	8	21	Digital Out8 (Programmable Output)
Digital Out2 (Programmable Output)	9	22	Digital Out9 (Programmable Output)
Digital Out3 (Programmable Output)	10	23	+24V for Brake system(Output)
Digital Out4 (Programmable Output)	11	24	Control signal of Brake system(Output)
Digital Out5 (Programmable Output)	12	25	GND external(Input)
Digital Out6 (Programmable Output)	13	26	+24V external(Input)

* This connector fixed pin is connected to frame GND through a mount hall.

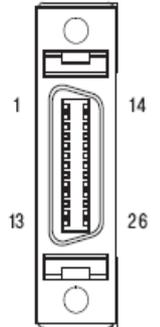


6.9 Communication Connection (CN5)

Connector Type : RJ45

Cable Type : UTP/STP CAT5E


Pin No.	Function
1,2,4,5,7,8	GND
3	Data+
6	Data-
case	Frame GND

LED No.	Display	Color	Lighting Condition
1,3	RUN	Green	Flash when CPU in the drive operates
2,4	COMM	Yellow	Flash when this communicates with the upper controller

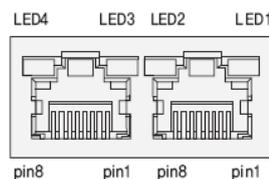

7. External Name and Function Setting of Ezi-SERVO-PR-MI

7.1 Appearance and Part Name

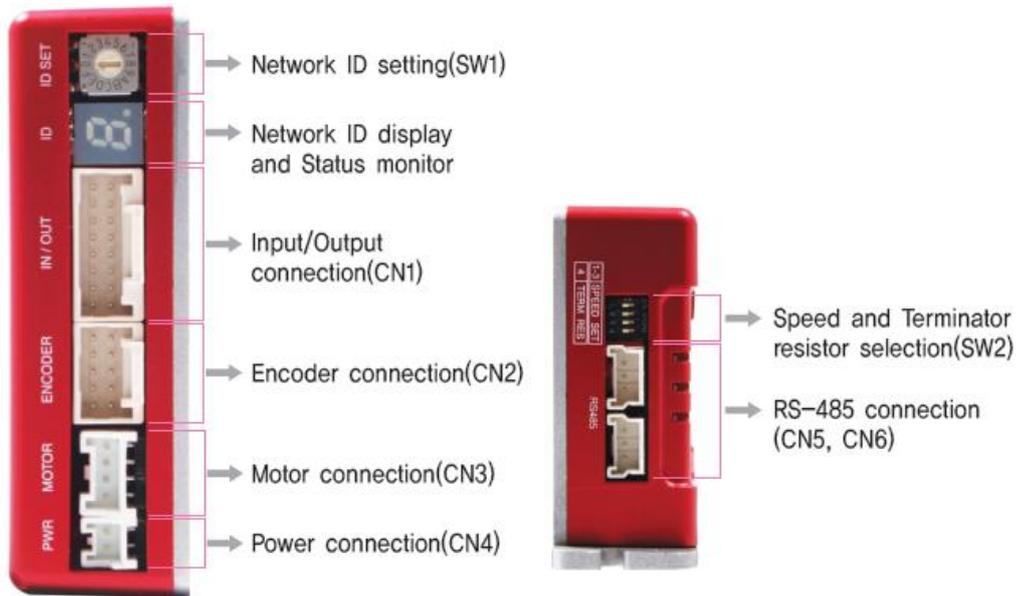

7.2 Drive ID Switch Selection (SW1) and 7-segment


- 1) When several modules are connected to one daisy chain network, this switch is to set intrinsic ID to each module.
- 2) The switch can set intrinsic ID to each module up to 16 numbers from 0 to F(15).
- 3) 7-segment of status monitor is display the ID number in normal status, but in alarm status it display the protection number by flash times.

Position	ID No.	Position	ID No.
0	0	8	8
1	1	9	9
2	2	A	10
3	3	B	11
4	4	C	12
5	5	D	13
6	6	E	14
7	7	F	15



7.3 Communication Speed and Terminal Resistance Select Switch(SW2)

SW2 is to set the communication speed between central controller(PC) and Drive. If corresponding drive module is connected to the end of one network segment, SW2 sets whether terminal resistance is used. SW2.1 is to set the use of terminal resistance, and SW2.2~SW2.4 is to set the communication speed as follows.

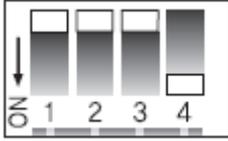SW2.1	SW2.2	SW2.3	SW2.4	Baud rate [bps]	*1 : default setting value.
X	OFF	OFF	OFF	9600	 <p>SW2.1 is OFF.: Terminal resistance is Off. SW2.1 is ON. : Terminal resistance is On.</p>
X	ON	OFF	OFF	19200	
X	OFF	ON	OFF	38400	
X	ON	ON	OFF	57600	
X	OFF	OFF	ON	115200 *1	
X	ON	OFF	ON	230400	
X	OFF	ON	ON	460800	
X	ON	ON	ON	921600	

**Caution**


The communication speed of drive modules connected to one segment must be set with same value.

**Caution**

Support max. 115200[bps] when using RS-232 to RS-485 converter


7.4 Motor Connection (CN3)

No.	Function
1	B Phase
2	A Phase
3	/A Phase
4	/B Phase

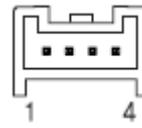

7.5 Encoder Connection (CN2)


No.	Function
1	A+
2	A-
3	B+
4	B-
5	Z+
6	Z-
7	5VDC
8	5VDC GND
9	Frame GND
10	Frame GND

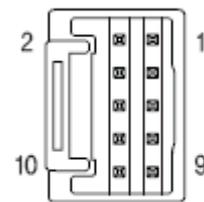

To setup connected encoder resolution, refer to 「13 Parameter」.


7.6 Power Connection(CN4)

No.	Function
1	Power input : 24VDC \pm 10%
2	Power input : GND

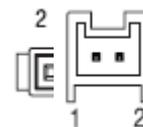

7.7 I/O Signal Connection (CN1)

No.	Function	Input/Output
1	24VDC	Input
2	24VDC GND	Input
3	BRAKE+	Output
4	BRAKE-	Output
5	+Limit sensor	Input
6	-Limit sensor	Input
7	Origin sensor	Input
8	Digital IN1	Input
9	Digital IN2	Input
10	Digital IN3	Input
11	Digital IN4	Input
12	Digital IN5	Input
13	Digital IN6	Input
14	Digital IN7	Input
15	Compare Out (COMP)	Output
16	Digital OUT1	Output

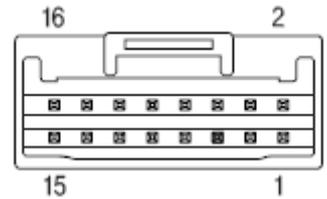


The programmable input/output pin is set by using user program(GUI) or DLL library.

 Caution	<p>Connect the Brake (current consumption is under 200[mA]) for pin 24. Refer to 8.4 Output signal for the Brake that is over 200[mA].</p>
--	--


7.8 Communication Connection (CN5)

No.	Function
1	Data+
2	Data-
3	GND

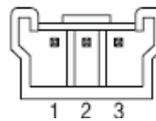

8. External Name and Function Setting of Ezi-SERVO-ALL42 / ALL56

8.1 Appearance and Part Name

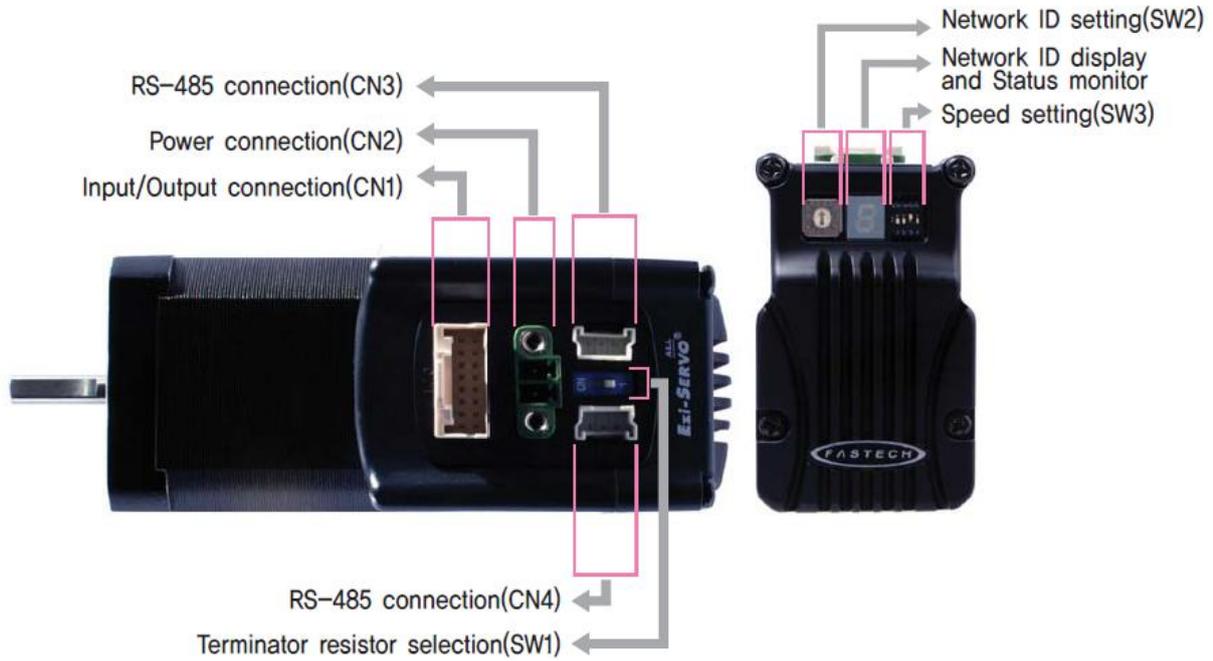

8.2 Terminal Resistance Select Switch(SW1)

Terminator resistor selection switch under RS-485 communication.
Please set ON for Terminator Controller of Network.



8.3 Drive ID Switch Selection (SW2)

Position	ID number	Position	ID number
0	0	8	8
1	1	9	9
2	2	A	10
3	3	B	11
4	4	C	12
5	5	D	13
6	6	E	14
7	7	F	15



※Maximum 16 axis can be connected in one network.


8.4 Communication Speed Select Switch(SW3)

SW 3,1	SW 3,2	SW 3,3	Baud rate[bps]
OFF	OFF	OFF	9600
ON	OFF	OFF	19200
OFF	ON	OFF	38400
ON	ON	OFF	57600
OFF	OFF	ON	115200*1
ON	OFF	ON	230400
OFF	ON	ON	460800
ON	ON	ON	921600

※Possible to use common PCI Bus type RS-485 communication board for High speed communication, (Please contact with Distributor)


*1 : Default setting value

*2 : SW3,4 is not available to use

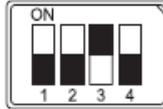


8.5 I/O Signal Connection (CN1)

NO.	Function	I/O
1	24VDC	Input
2	24VDC GND	Input
3	BRAKE+	Output
4	BRAKE-	Output
5	LIMIT+	Input
6	LIMIT-	Input
7	ORIGIN	Input
8	Digital IN1	Input
9	Digital IN2	Input
10	Digital IN3	Input
11	Digital IN4	Input
12	Digital IN5	Input
13	Digital IN6	Input
14	Digital IN7	Input
15	Compare Out	Output
16	Digital OUT1	Output

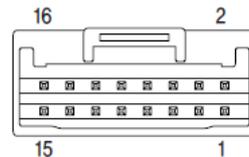


8.6 Power Connection(CN2)

NO.	Function
1	Input Voltage : 24VDC \pm 10%
2	Input Voltage : GND

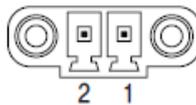

8.7 Communication Connection (CN3, CN4)

NO.	Function
1	+DATA
2	-DATA
3	GND

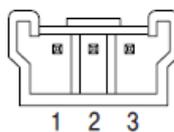

9. External Name and Function Setting of Ezi-SERVO-ALL60

9.1 Appearance and Part Name




9.2 Terminal Resistance Select Switch(SW1)

Terminator resistor selection switch under RS-485 communication. Please set ON for Terminator Controller of Network.



9.3 I/O Signal Connection (CN3)

No.	Function*1	Function*2	I/O*1	I/O*2
A	24VDC	24VDC	Input	Input
B	24VDC GND	24VDC GND	Input	Input
C	LIMIT+	LIMIT+	Input	Input
D	LIMIT-	LIMIT-	Input	Input
E	ORIGIN	ORIGIN	Input	Input
F	Digital IN1	Digital IN1	Input	Input
G	Digital IN2	Digital IN2	Input	Input
H	Digital IN3	Digital IN3	Input	Input
I	Digital IN4	Digital IN4	Input	Input
K	Digital IN5	Digital IN5	Input	Input
L	Digital IN6	Digital IN6	Input	Input
M	Digital IN7	Digital OUT1	Input	Output
N	Compare Out	Digital OUT2	Output	Output
O	Digital OUT1	Digital OUT3	Output	Output
P	Digital OUT2	Digital OUT4	Output	Output
R	Digital OUT3	Digital OUT5	Output	Output
S	N · C	Digital OUT6	Output	Output
T	BRAKE+	BRAKE+	Output	Output
U	BRAKE-	BRAKE-	Output	Output

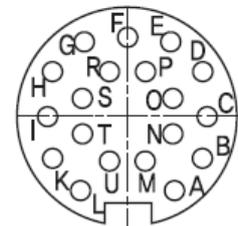


*1 Ezi-SERVO-ALL-60 Series

*2 Ezi-SERVO-ALL-60L-ABS Series


9.4 Power Connection(CN1)

No.	Function
1	Input Voltage : 24VDC \pm 10%
2	Input Voltage : 24VDC \pm 10%
3	Input Voltage : GND
4	Input Voltage : GND

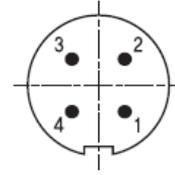

9.5 Communication Connection (CN5, CN6)

No.	Function
1	+DATA
2	-DATA
3	GND

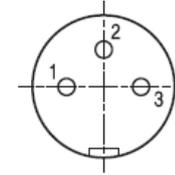

10. Control I/O Signal

10.1 Signal Cabling (Ezi-SERVO-PR type)

All control I/O signals use connector CN1 as specified below.

1) **Input** : 「Limit+」, 「Limit-」, 「Origin」 signals are fixed to CN1 No. 1,2,3.

Other signals as like 'Clear Pos' are assigned to IN1~IN9 terminal blocks.

(3 dedicated input + 9 programmable input = total 12 input pins.)

Ezi-SRERVO-PR : 3 dedicated In + 9 programmable In = 12 Inputs

Ezi-SRERVO-PR-MI : 3 dedicated In + 7 programmable In = 10 Inputs

Ezi-SERVO-PR CN1 No.	Ezi-SERVO-PR- MI CN1 No.	Signal Name	Function
1	5	Limit+	Positive limit sensor signal
2	6	Limit-	Negative limit sensor signal
3	7	Origin	Origin sensor signal
4	8	IN1	Clear Pos Position table A0 ~ Position table A7 (PT A0~PT A7) Position table start execution (PT Start) Soft Stop(Stop) Jog+ Jog- AlarmReset ServoON Pause Origin Search Teaching Emergency Stop(E-Stop) Jump Position Table input 0 ~ Jump Position Table input 2 (JPT IN 0~ JPT IN 2) Jump Position Table start (JPT Start) User input 0 ~ User input 8 (User IN 0 ~ User IN 8)
14	9	IN2	
15	10	IN3	
16	11	IN4	
17	12	IN5	
5	13	IN6	
6	14	IN7	
18	None	IN8	
19	None	IN9	

2) **Output** : 「COMP」 signal is dedicated to CN1 No.7. Other signals like

Inposition are assigned to OUT1~OUT9 terminal blocks.

Ezi-SRERVO-PR : 1 dedicated Out + 9 programmable Out = 10 Outputs

Ezi-SRERVO-PR-MI : 1 dedicated Out + 1 programmable Out = 2 Outputs

Ezi-SERVO-PR CN1 No.	Ezi-SERVO-PR-MI CN1 No.	Signal Name	Function
7	15	COMP	Specific output signal (Compare Out)
8	16	OUT1	InPosition Alarm Moving Acc/Dec ACK END AlarmBlink OriginSearchOK ServoReady Brake Position Table output 0 ~ Position Table output 2 (PT OUT 0 ~ PT OUT 2) User Output 0 ~ User Output 8
9	None	OUT2	
10	None	OUT3	
11	None	OUT4	
12	None	OUT5	
13	None	OUT6	
20	None	OUT7	
21	None	OUT8	
22	None	OUT9	

10.2 Signal Cabling (Ezi-SERVO-ALL type)

All control I/O signals use connector CN1 as specified below.

- 1) **Input** : 「Limit+」, 「Limit-」, 「Origin」 signals are fixed to CN1 No. 1,2,3.
Other signals as like 'Clear Pos' are assigned to IN1~IN7 terminal blocks.
(3 dedicated input + 9 programmable input = total 12 input pins.)

Ezi-SRERVO-ALL42 / ALL56 : 3 dedicated In + 7 programmable In = 10 Inputs

Ezi-SRERVO-ALL60 : 3 dedicated In + 7 programmable In = 10 Inputs

Ezi-SERVO-ALL 42/ALL56 CN1 No.	Ezi-SERVO- ALL60 CN1 No.	Signal Name	Function
5	C	Limit+	Positive limit sensor signal
6	D	Limit-	Negative limit sensor signal
7	E	Origin	Origin sensor signal
8	F	IN1	ClearPos Position Table A0 ~ Position Table A7 (PT A0~PT A7) Position Table start execution (PT Start) Soft Stop(Stop) Emergency Stop(E-Stop) Jog+, Jog- AlarmReset, ServoON OriginSearch Teaching, Pause Jump Position Table input 0 ~ Jump Position Table input 2 (JPT IN 0~ JPT IN 2) Jump Position Table start (JPT Start) User input 0 ~ User input 8 (User IN 0 ~ User IN 8)
9	G	IN2	
10	H	IN3	
11	I	IN4	
12	K	IN5	
13	L	IN6	
14	M	IN7	

- 2) **Output** : 「COMP」 signal is dedicated to CN1 No.7. Other signals like
Inposition are assigned to OUT1~OUT9 terminal blocks.

Ezi-SRERVO- ALL42/ALL56 : 1 dedicated Out + 1 programmable Out = 2 Outputs

Ezi-SRERVO-ALL60 : 1 dedicated Out + 3 programmable Out = 4 Outputs


Ezi-SERVO-ALL 42/ALL56 CN1 No.	Ezi-SERVO-ALL60 CN1 No.	Signal Name	Function
15	N	COMP	Specific output signal (Compare Out)
16	O	OUT1	InPosition, Moving Alarm, Acc/Dec ACK, END AlarmBlink OriginSearchOK ServoReady, Brake Position Table output 0 ~ Position Table output 2 (PT OUT 0 ~ PT OUT 2) User Output 0 ~ User Output 8
None	P	OUT2	
None	R	OUT3	

10.3 Connection Circuit

All drive I/O signals are insulated by a photocoupler. The signals display the internal photocoupler status - [ON: Conduction] and [OFF: Non-Conduction], not the signal voltage level.


1) Input Circuit

Input circuit power of $DC24V \pm 10\%$ (consumed current : about 5mA/circuit) should be separately prepared.

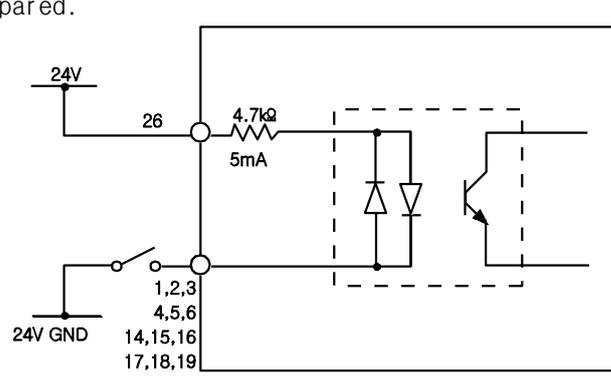


- Connect NPN type Input signal

Connect the '+24V external' signal of drive to '+24V' of Controller .

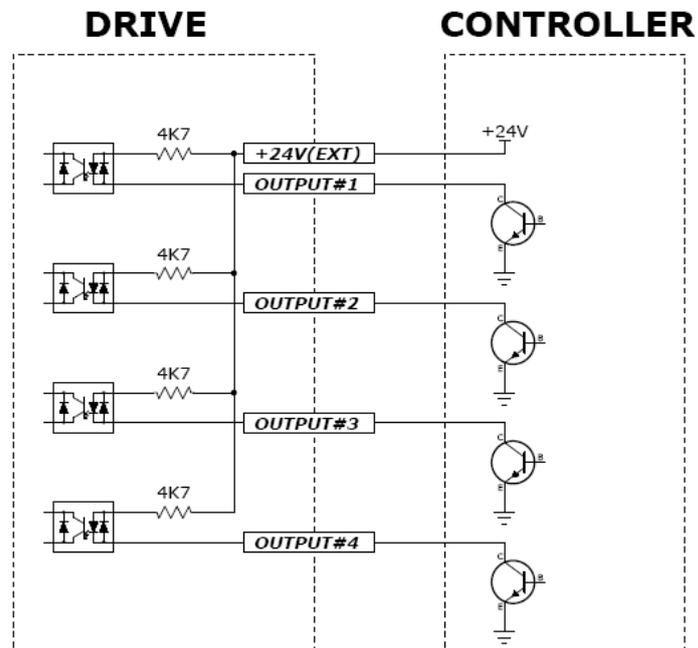

- Connect PNP type Input signal

Connect the '+24V external' signal of drive to 'GND' of Controller .

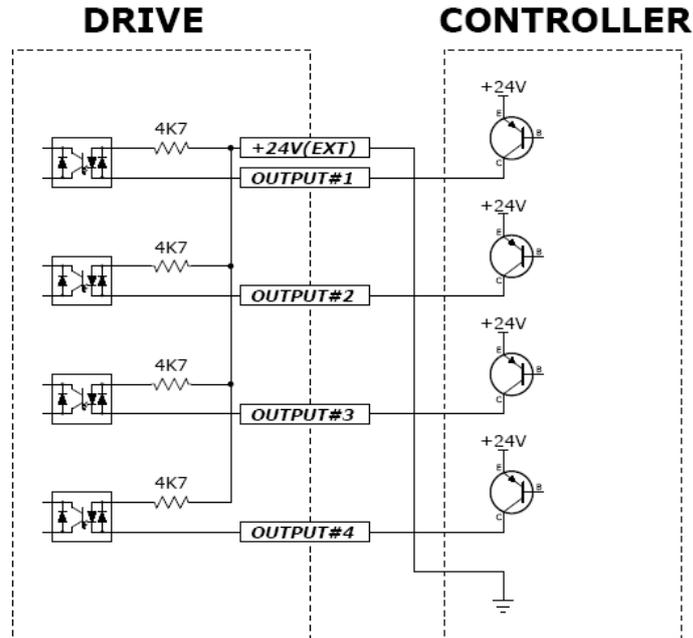


2) Output Circuit

Output circuit power should be separately prepared. This may share input circuit power. In this case, working power capacity should add output power capacity to input power capacity.

Applied voltage and power capacity in the control output port are as follows.


- Applied voltage $\leq 30V$
- Electrified current $\leq 15mA$

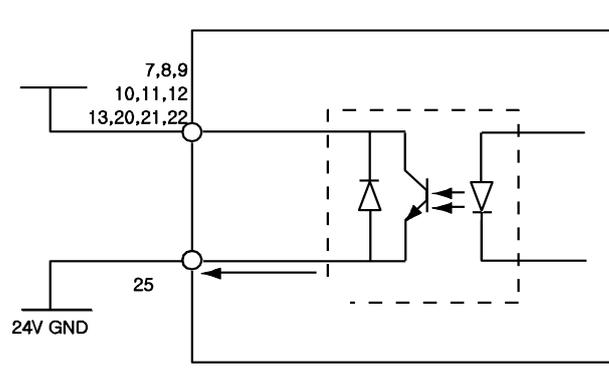

10.4 Input Signal

1) 'Limit' Sensor and 'Origin' Sensor

Limit sensor and origin sensor are assigned to LIMIT+, LIMIT-, and ORIGIN pin in the CN1 connector respectively. LIMIT+ and LIMIT- sensors are used to limit the motion of each axis clockwise and counterclockwise to prevent mechanical collision. Origin sensor is to set the origin of equipment.

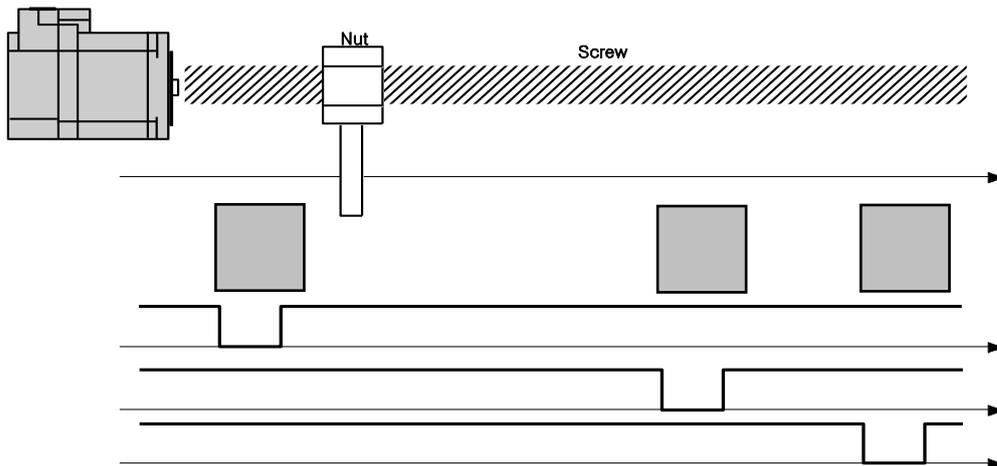

2) 'Clear Pos' Input

This input signal sets the command position and the actual position to 0 in relation to motion position control. The reset signal pulse scale is 10ms or more.



3) 'Position Table A0 - A7 (PT A0~A7)' Input

The position table supports the machine so that its motion can be controlled by I/O signals of central controller. It can directly transmit commands such as position table number, start/stop and origin return to the machine through the PLC. Also, the user can check output signals such as in-position, completion of origin return and Servo ready through the PLC.

「Position Table A0~A7」 inputs are total 8 bits of input signal. It is used to set 256 position table numbers. There are two application methods as follows.

* Ezi-SRERVO-PR-MI / Ezi-SERVO-ALL : maximum 64 position table numbers can be set.

- 1) To set position table number(0~255) to be set by 'PT start' input signal.
- 2) To set position table number(0~255) to save current position values by 'Teaching' input signal.

By using PT A0~A7 signals, the position table address can be set from 0 to 255 with a

binary number. A0 is least significant bit and A7 is most significant bit. The following table shows how to assign position table number.

- *1. Save signal cabling : If 'PT A0~A7' signal is not connected when motioning by 'PT Start' signal, the position table number will be '0'

A7	A6	A5 ~ A3	A2	A1	A0	PT No.
0	0	0	0	0	0	0
0	0	0	0	0	1	1
0	0	0	0	1	0	2
0	0	0	0	1	1	3
... ..						
1	1	1	1	1	0	254
1	1	1	1	1	1	255


- *2. 'PT A5/User IN 6' 'PT A6/User IN 7' 'PT A7/User IN 8' signal setting :
This signal can be used as 'PT A5~A7' , and also can be used as 'User IN6~IN8' signal when the input signal 'User IN0~IN5' is not enough.

4) 'Position Table Start (PT Start)' Input


By using PT A0~A7 signals, set and input the running PT start number. Then the motion pattern corresponds to the PT No. will be executed.

Following example shows that total 6 motion patterns are in order executed from No.0 to No.32 and then stopped.

- 1) All of PT A0~A7 is set to '0' and PT number is set to '0' .
- 2) Set PT Start signal to [ON], and PT No.0 motion pattern will be executed.
- 3) When the motion pattern is started by PT, ACK signal and END signal are displayed to [ON] at CN1 output port as illustrated below. The signal is kept until one motion pattern loop is stopped. After all motions are stopped, the output signal level is set to [OFF].
- 4) PT Start signal is **edge trigger** type and pulse scale is 10ms or more.

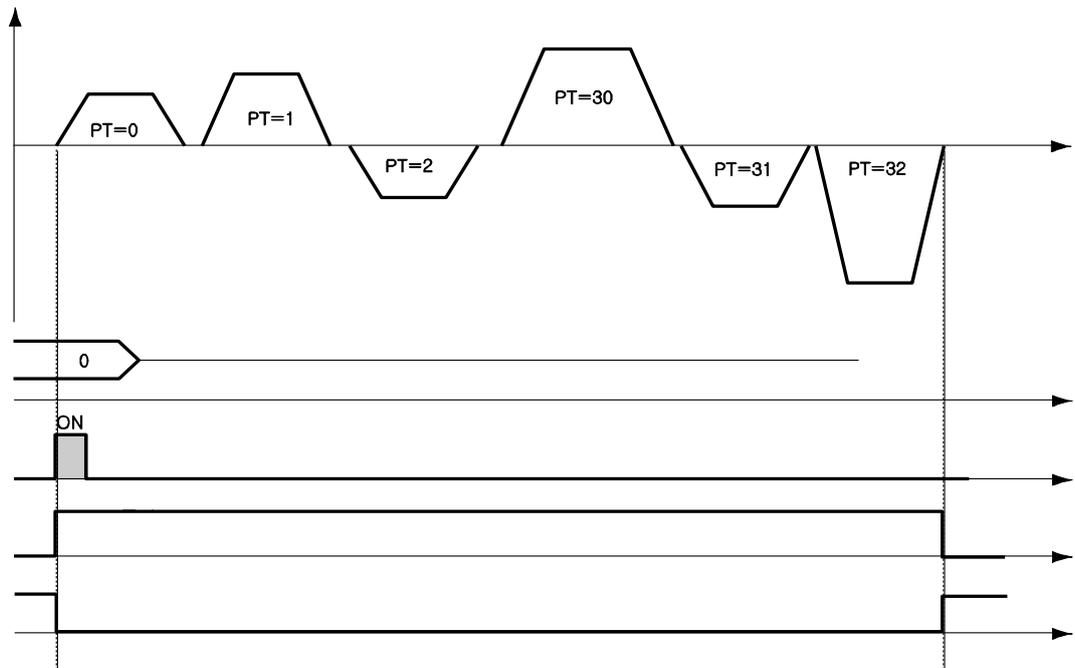


- *1. Timing of signals : PT A0~A7 signals must be set before(50msec)
PT Start signal set to [ON].
- *2. If the PT A0~A7 signals are not used and the PT Start signal set to [ON],
the PT No. 0 will be executed.

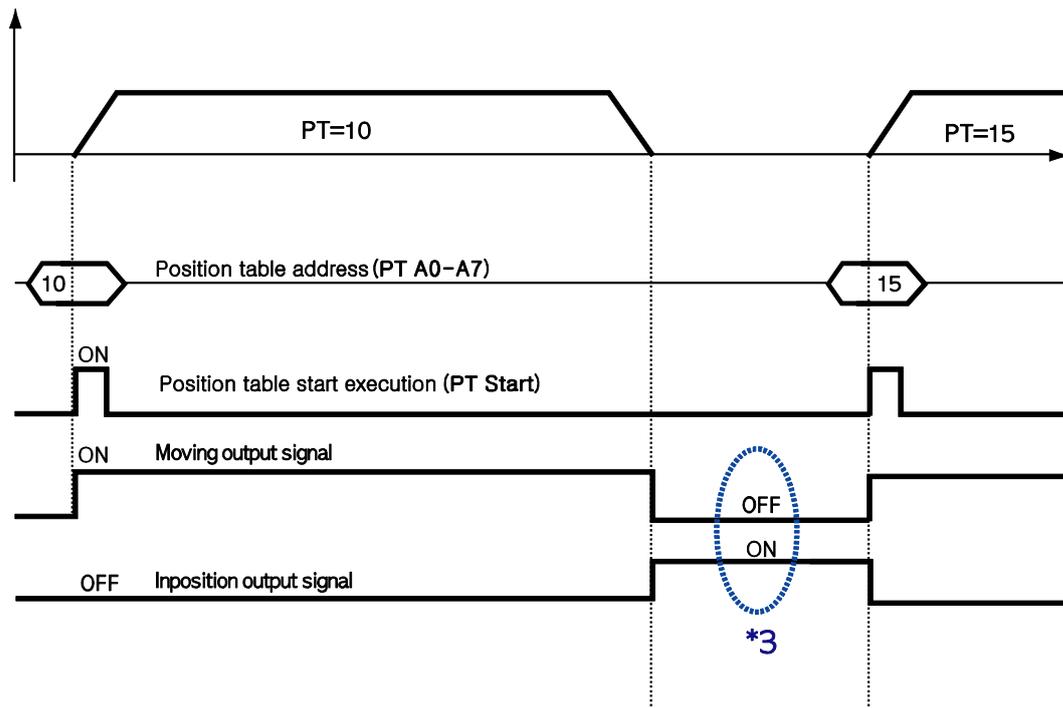

- *3. Checking the 'Moving' and 'Inposition' signals :
Between sequential 'PT Start' motion command signal, the checking step
for motion status(Moving, Inposition) is needed before next motion command.


5) 'Soft Stop' Input

Soft stop input signal is to stop motion patterns under operation. The deceleration condition until they stop complies with the deceleration time value and the start speed value set previously. The soft stop signal is active in ON level and pulse scale is 10ms or more.

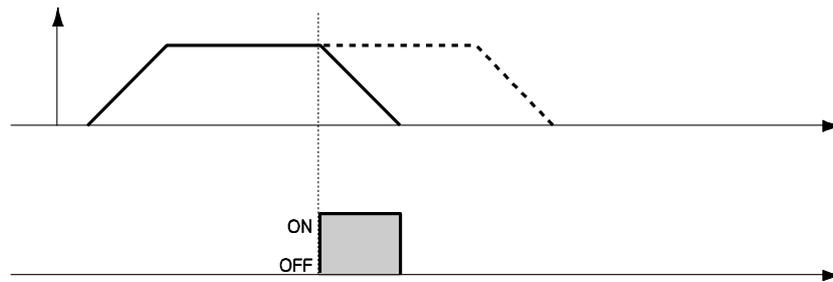

6) 'Jog+' and 'Jog-' Input

When Jog+ or Jog- signal is ON, the motor rotates clockwise or counterclockwise until it reaches the hardware limit or the software limit. Jog motion pattern is subject to jog related parameters (No.7: start speed, No.6: speed, No.8: Acc Dec time).

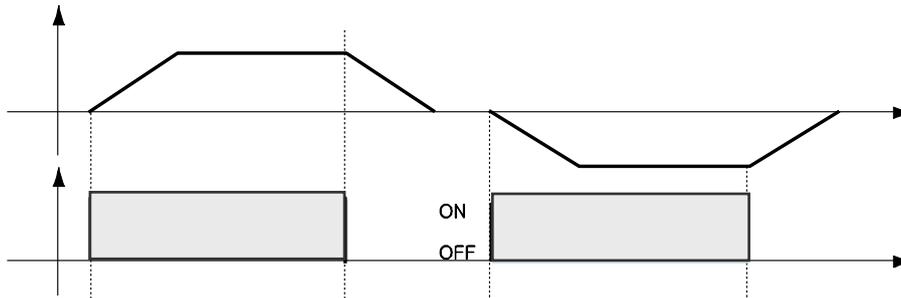


7) 'Servo ON' and 'AlarmReset' Input

When the protective function of drive executes, alarm output is released. When AlarmReset input is set to ON, alarm output and alarm blink output are released. Before releasing alarm output, the user must remove any cause of alarm operating.

When Servo ON/OFF signal is set to OFF, the drive stops supplying the current to the motor and so the user can directly adjust the output position. When Servo ON/OFF signal is set to ON, the drive restarts to supply the current to the motor and its torque is recovered. Before operating the motor, the user must set it to ON.

When the drive is set to Servo ON, CN1 connector' s ServoReady output signal is set to ON. Servo ON signal is **edge trigger** type and pulse scale is 10ms or more.

 Caution	<p>If the 'Servo ON' signal is assigned to input pin, ServoON command from GUI or DLL library will not executed.</p>
--	--

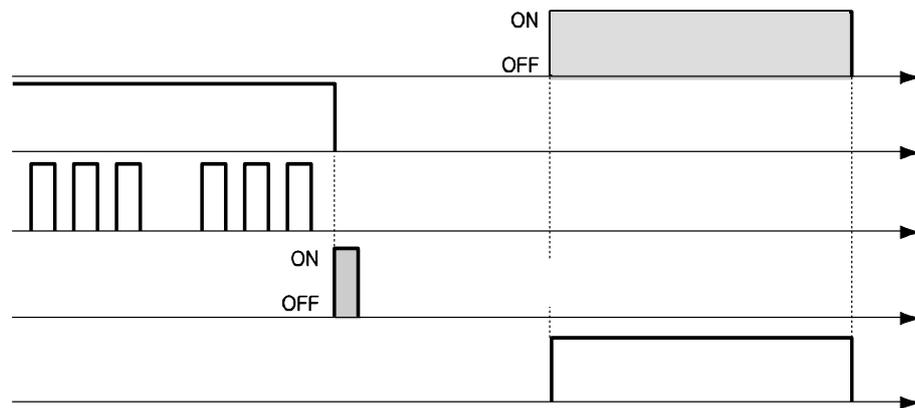


- *1. If 'No.0: Pulse per Revolution' in the parameter list is changed, the motor is set to Servo OFF.
- *2. After 'ServoON' signal is assigned to input pin, it is impossible to use 'SERVO ON' button in UserProgram(GUI).
- *3. After 'ServoON' is executed, the 'Command Position' value will change as same as 'Actual Position' value to remove 'Position Error'.

8) 'Pause' Input

When Pause signal is set to ON, the motion in service is stopped. There are two pause signal operation modes as follows.

- ① Case A : When Pause signal is set to ON, the motor starts to decelerate. Pause signal becomes OFF before the motor is completely stopped. To start motion, Pause signal should be set to ON.
- ② Case B : When Pause signal is set to ON, the motor starts to decelerate. The signal is continuously maintained since the motor is completely stopped. To start motion, Pause signal should be set to OFF.

Pause signal pulse scale is 10ms or more.

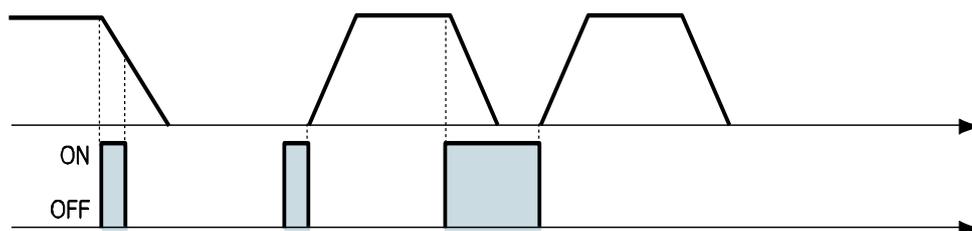


- *1. This function is not applied while 'Repeat Test' of the User Program(GUI) is executing.
- *2. This function is not applied while 'Push Motion' positioning.

9) 'Origin Search' Input

When 'Origin Search' signal is set to ON (10ms or more), it starts to search the origin position according to selected conditions. The conditions are subject to parameters such as No.20:Org Method, No.17:Org Speed, No.18:Org Search Speed, No.19:Org AccDec Time, No.21:Org Dir. (For more information, refer to '15.Parameter'.) When the


origin search command is completed, 'Origin Search OK' signal is set to ON to CN1 connector's output port.

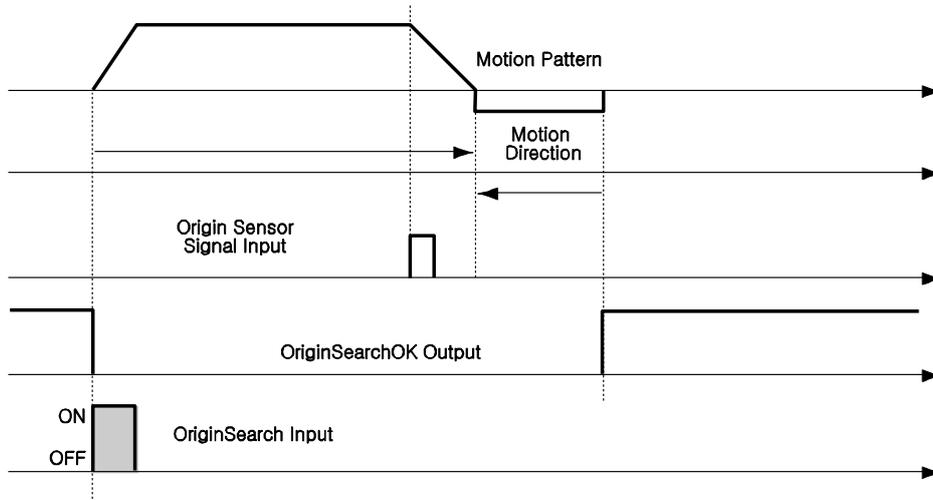

10) 'Teaching' Input

Teaching signal functions that the position value[pulse] being working can be automatically inputted into a 'position' value of a specific position table. If it is hard to calculate the exact moving distance(position value) of specific motion mechanically, the user can measure and set the distance(position value) easily by using this signal.

- 1) By using User Program(GUI), set a command type of corresponding PT number among 4 kinds of **absolute moving commands(Absolute Move)**.
- 2) By using input signal(PT A0~A7), select corresponding PT number.
- 3) When Teaching signal is set to ON, the position value[pulse] is save to the position value of corresponding PT. At this time, it becomes the absolute position value.
- 4) Teaching signal pulse scale is 10ms or more.

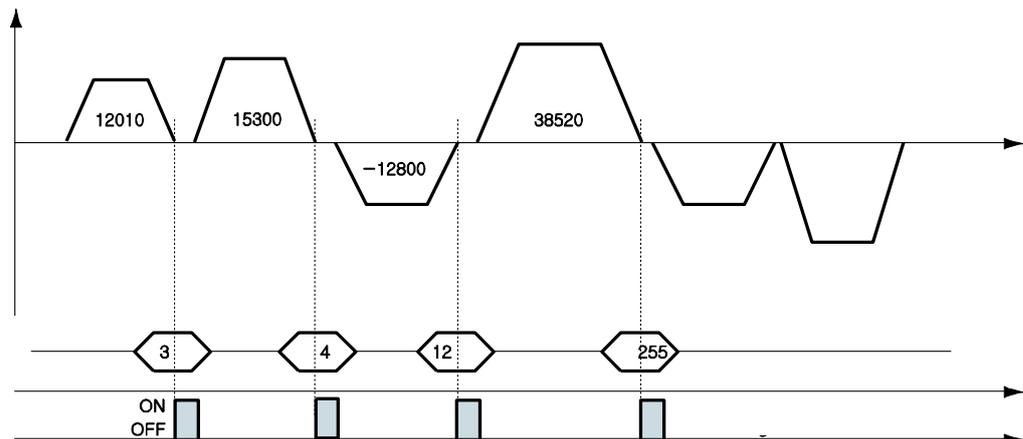


PT No.	Position Value [pulse] of Corresponding PT
3	12010
4	15300
12	-12800
255	38520

- * After executing Teaching, click 'Refresh' icon, and the position value will be displayed to the position table.
- * Click 'Save to ROM' icon, and the position value will be saved to the ROM area.

- * Teaching signal can be used by two methods; the user assigns actual signal to the motor, or he clicks 'Teaching' icon at the 'I/O Monitoring' window of User Program(GUI).

11) 'E-Stop' Input

When 'Emergency stop' signal is set to ON, the current motion is stopped immediately without deceleration. E-Stop signal is active in ON level and pulse scale is 10ms or more.

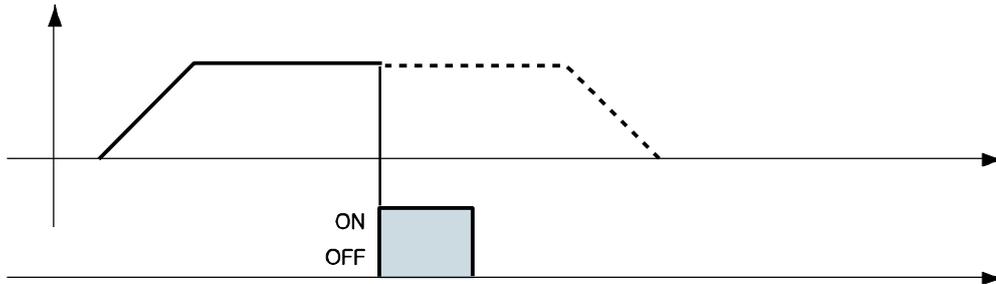


12) 'JPT Input0~Input2 (Jump Position Table Input)' Input

Select motion pattern(position table number) to be subsequently executed according to input signal conditions.

【Example】 If PT 14 motion operates, when there is no other input signal, next motion becomes PT 15 as shown in Figure 1). However, if 'JPT Input0~Input2' input signal is set to ON while PT 14 is executing, each corresponding position number is executed as shown in Figure 2)~4).

PT No.	...	JP Table No.	JPT 0	JPT 1	JPT 2
14	...	15	115	116	225

PT 14 Data

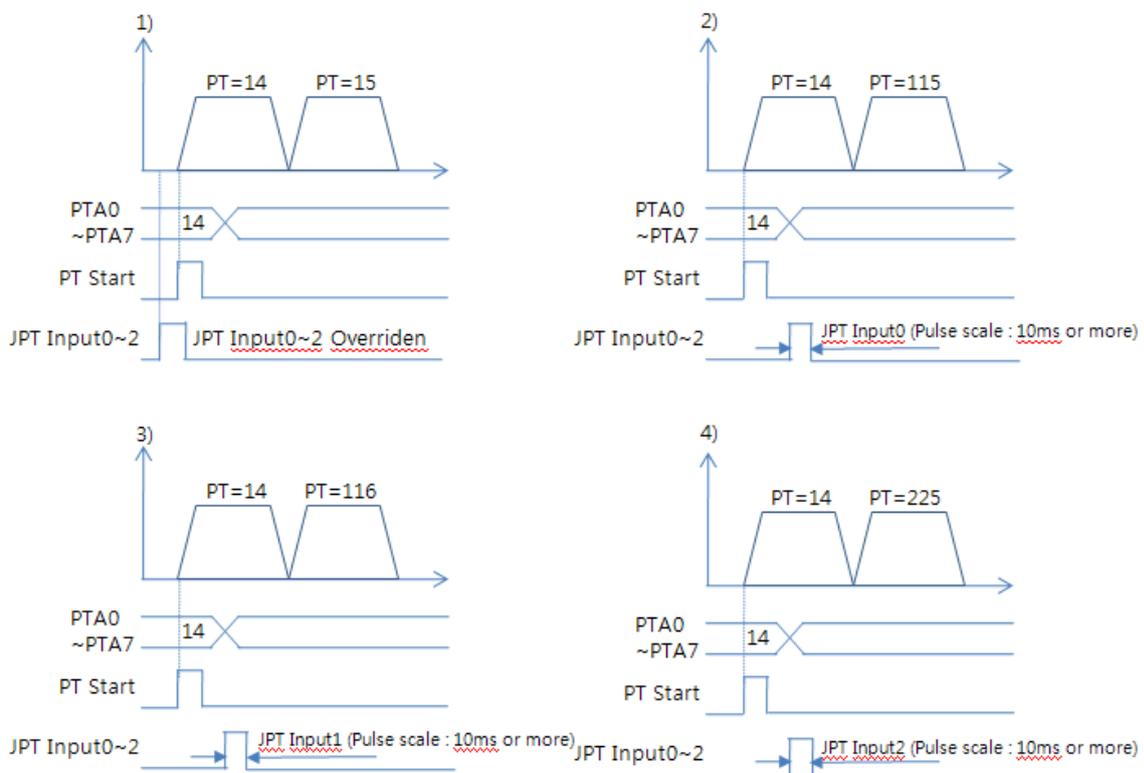

13) 'JPT(Jump Position Table) Start' Input


To select motion pattern(position table number) to be subsequently executed according to input signal conditions. The difference from Paragraph 「13) 'JPT Input0~Input2 Input」 is:

- 1) PT number to be jumped must be composed to 10XXX;
- 2) Next motion is not executed until 'JPT Start' is set to ON. If 'Wait Time' value of PT data is more than '0' , the time lapses additionally and then next motion is executed.

【Example】

PT 14 Data

PT No.	...	Wait Time	JP Table No	JPT 0	JPT 1	JPT 2
14	...	500	10015	10115	10116	10255

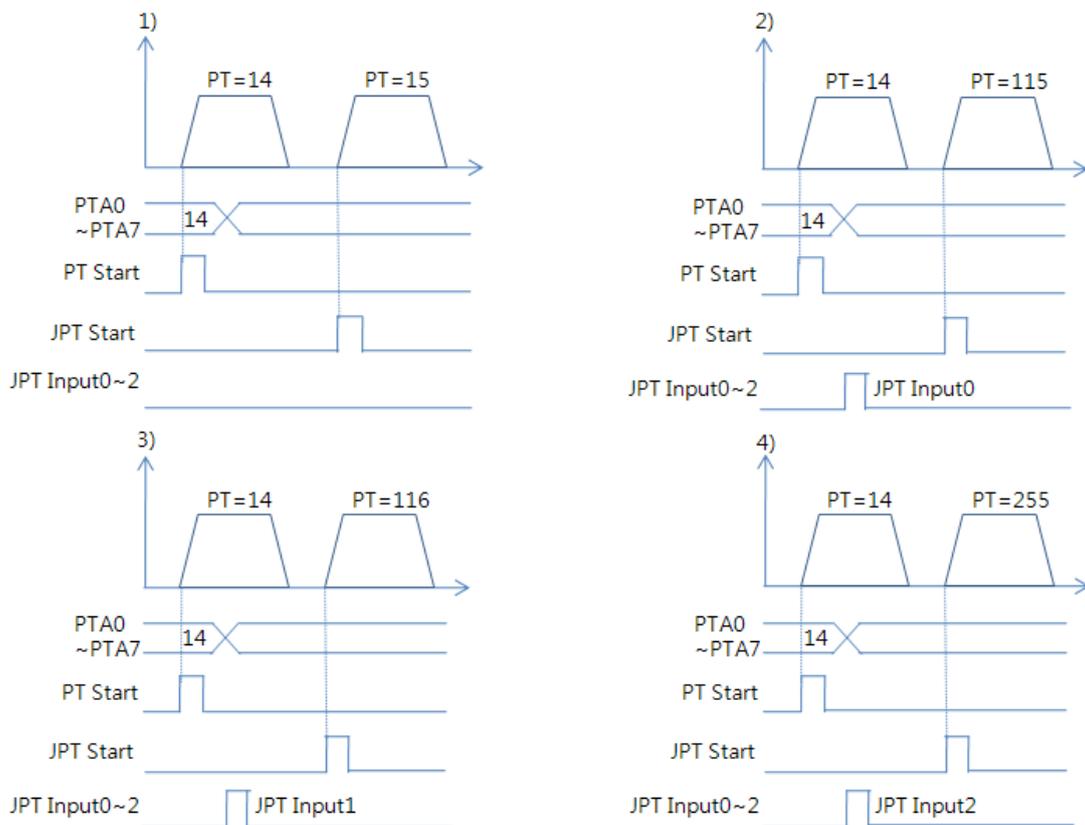


10.5 Output Signal

1) 'Compare Out' / 'Trigger Pulse Output' Output

'Trigger Pulse Output' signal is displayed when specific conditions are performed. It is fixed to CN1 connector's COMP (Compare Out) pin. And it is available when the motor needs to be synchronously controlled by an external controller. Refer to 「12.5 Trigger Pulse Output」.

2) 'Inposition' Output

After the motor stop in target position exactly on Servo ON status, the signal becomes [ON]. The condition of this signal depends on parameter 'Position Loop Gain' and 'Inpos Value'.

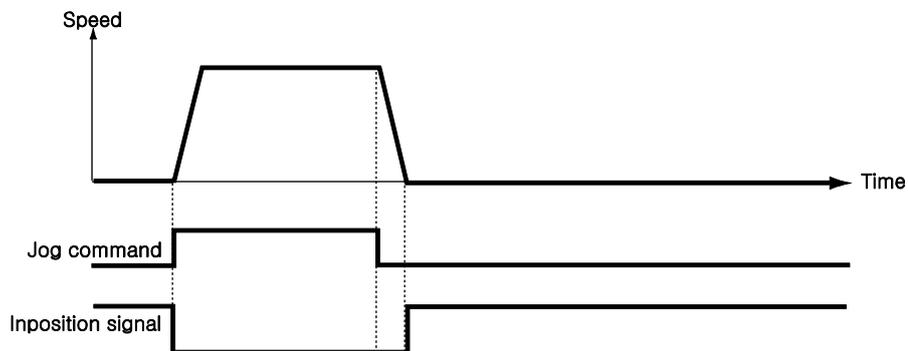

* Time delay of Output signal depends on the parameter 'Inpos Value' :

Value	Mode	Description
0~7	Fast mode	Output the signal in 1[msec] after the motor stop in target position.
8~15	Accurate mode	Output the signal in maximum 100[msec] after the motor stop in target position. (Time is needed to check find exact positioning)

3) 'Alarm' & 'AlarmBlink' Output

When the motor operates normally, alarm output becomes OFF. When the protective function operates, alarm output becomes ON. The upper controller being used by the user detects this alarm and then stops motor operation command. If overload or overcurrent occurs while the motor is operating, the drive detects it and cuts off the motor's current. And alarm output is set to ON and also 'AlarmBlink' flash so that the user can check abnormality type. The following table shows alarm type according to LED flash count.

Flash Count	Alarm Name	Description
1	Overcurrent	The current through power devices in inverter exceeds the limit value
2	Overspeed	Command speed for motor exceeds 3300[rpm].
3	Position Tracking	Position error value is higher than specified value*1 in position command status. *1
4	Overload	The motor is continuously operated more than 5 second under a load exceeding the max. torque.
5	Overheat	The internal temperature of the drive exceeds 85°C.
6	Over regenerative voltage	Back-EMF more than limit value. *2
7	Motor connection	The connection of drive and motor is defective.
8	Encoder connection	The connection of drive and encoder is defective.
9	Motor voltage error	The power supplied to the motor is less than low limit value.*3
10	Inposition error	After operation is finished, a position error occurs.
11	System error	Drive system is halted(Watch Dog Timer).
12	ROM error	Read/Write error on ROM device in drive system.
15	Pos. Error Overflow	Position error value is higher than specified value*1 in motor stop status. *5

*1 Values[pulse] of parameter 'Pos Tracking Limit[No.27]

*2 70V : EzS-NDR-20, EzS-NDR-28, EzS-NDR-42, EzS-NDR-56, EzS-NDR-60 model
90V : EzS-NDR-86 model

*3 20V : EzS-NDR-20, EzS-NDR-28, EzS-NDR-42, EzS-NDR-56, EzS-NDR-60 model
40V : EzS-NDR-86 model

*5 Values[pulse] of parameter 'Pos. Error Overflow Limit[No.33]


4) 'PT ACK' and 'PT End' Output

'PT ACK' and 'PT End' signals are available only when the motion is executed by position table. When PT ACK signal is set to ON and PT End signal is set to OFF, all motion loops are finished. Then PT ACK signal becomes OFF and PT End signal becomes ON. If the 'Wait time' value in PT item is not 0, the defined time is needed to PT End signal becomes ON.

Refer to 「Ezi-SERVO Plus-R User Manual - 'Position Table Function' 」.

5) 'Moving' and 'Acc/Dec' Output

As shown below, the position starts to move by motion command, and Moving signal becomes ON and Acc/Dec signal becomes ON in the acceleration and deceleration section only.

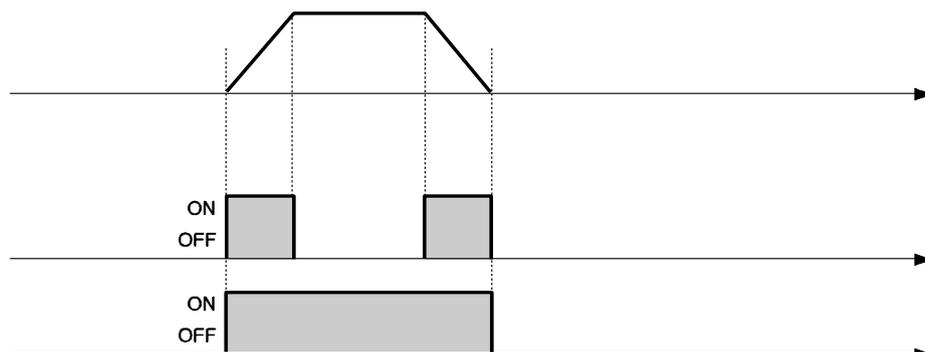

- * Moving signal is not related to actual position. The signal becomes to [OFF] Just after the 'position command' is finished.

6) 'Org Search OK' Output

When the origin return motion is executed by origin search command, 'Origin Search OK' signal is set to OFF. When the origin return motion is normally finished by the origin sensor, 'Origin Search OK' is set to ON. When the alarm happens, this signal is set to OFF. Refer to 「[10.3 Input Signal - 9\) Origin Search Input](#)」.

7) 'Servo Ready' Output

When the drive supplies power to the motor by Servo ON signal or command and is ready to perform motion command, 'ServoReady' signal displays ON signal. Refer to 「[10.3 Input Signal - 7\) Servo On and AlarmReset Input](#)」.

8) 'PT(Position Table) Output 0~2' Output

Control output used for 'Start/Stop Message Function'. When these items are set, this signal enables the user to check if corresponding PT motion starts or stops through control output signal. If 'Start/Stop Message Function' is not used, this signal should be set to 0 or 8. At the position set with other values, the motion operates as follows.


- If PT set items are set to '1~7', when the position starts to move, PT Output HEX value is displayed to 'PT Output 0 ~ PT Output 2'.
- If PT set items are set to '9~15', the position motion is finished and then PT Output HEX value is displayed to 'PT Output 0 ~ PT Output 2'.

For more information, refer to 「[Ezi-SERVO Plus-R User Manual - Position Table Function](#)」.

9) 'BRAKE+' and 'BRAKE-' Output

This function is used to protect motor rotation in Servo ON status by pin23 And pin24 of CN1 connector. DC +24V is connect to 'BRAKE+' for brake logic and brake control signal is connect to 'BRAKE-'.

This output function must be used to the Brake that is under 200[mA]/DC24V of current consumption.

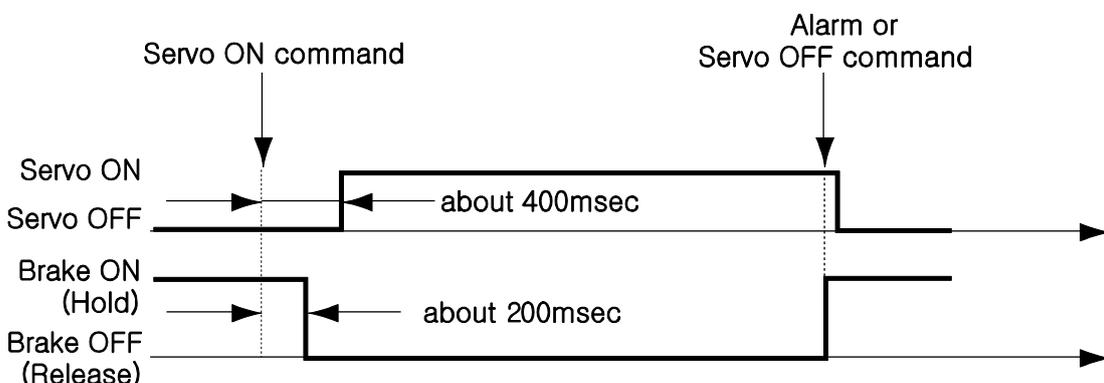


- * The delay time of 'Brake OFF' process after Servo ON command is define in '[Brake Delay Time \[No.34\]](#)' parameter.

10) 'Brake' Output for high current

This function can be used when the Brake signal is assigned to one of OUTPUT1~OUTPUT9 of CN1 connector. This is used for protect motor rotation in Servo ON status. The signal timing diagram between Servo ON command and Brake signal is same as 9) 'BRAKE+' and 'BRAKE-' Output.

This signal used for the Brake that is over 200[mA]/DC24V of current consumption. Brake, Relay and diode is needed for this function and the signal connection diagram is as follows.

- *1 Brake : User selected Brake
- *2 Relay : under 15[mA] / DC24V
- *3 Diode : 1N4004 or equivalent

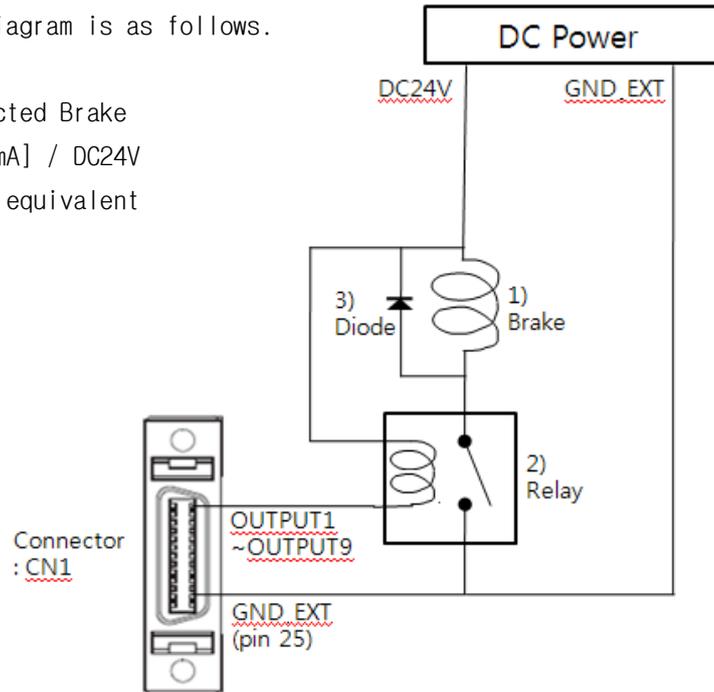

11. Operation

11.1 Power Supply Timing

Ezi-SERVO Plus-R is supplied power through drive module to motor. Therefore, connect the drive and the motor with a cable and then supply power to the drive module. After power is supplied, the motor is basically set to Servo OFF.

11.2 Servo ON Operation

After power is supplied, set the drive module to Servo ON as follows.

- ① Click 'Servo OFF' button at the User Program(GUI).
- ② Give the drive a command through DLL library.
- ③ Assign 'Servo ON' to a control input pin, and supply the drive with the signal through the pin.

After Servo ON command is given, In-position is finished to the time as shown below.



't1' is the time until Servo ON command is given and then the position is decided. It is about 400 [msec] with factory default value and it can be change with 'Servo ON Method [No.33]' parameter. It is subject to the rising time of supplying power and the motor status.

 Caution	<p>If the 'Servo ON' signal is assigned to input pin, ServoON command from GUI or DLL library will not executed.</p>
--	--

11.3 Operation Mode

This controller can do three control operations such as I/O command, communication command(DLL program), and User Program(GUI)

(1) I/O Command Mode

This controller can execute control operation like in-position by I/O command transmitted from the upper controller. The in-position control operation is executed by operating position table with I/O command.

(2) Communication Command Mode

This controller can execute control operation like in-position by command transmitted from the upper controller. The in-position control operation is executed by operating position table with I/O command

Position Table Operation Sequence

In case of Ezi-SERVO Plus-R, the system can execute continuous operation by position table at the I/O command mode.

- ① By using PT A0 ~ PT A7 input signal or DLL program, set PT number to be operated.
- ② In case of Servo OFF, set the controller to Servo ON by communication program or Servo ON control input.
- ③ Start to operate by rising edge of PT Start input signal or communication program.

Stopping Continuous Operation of Position Table

When the motor is executing continuous operation of position table with Ezi-SERVO Plus-R, stop executing position table by following methods.

- ① To use DLL program or control input signal corresponding to 'Stop' and 'E-Stop' . In this case, operation is completely finished and is not connected to next operation.
- ② The user can click 「Pause」 at User Program(GUI) to temporarily stop operating. In this case, click 「Pause」 again, and remaining operation will be executed again.

Position Control Operation

To operate the motor by parameters set by User Program(GUI) or DLL program. (This is not connected with PT operation.)

Once position control operation is started, PT operation command is overridden. Likewise, while PT operation is executing, position control operation command is overridden.

The followings show parameters applied to position control operation. All position table item values are overridden.

Parameter Name	Setting Content	Range
Axis Max Speed	Operation speed after acceleration is finished	1~2,500,000[pps]
Axis Start Speed	Operation start speed before acceleration starts	1~35,000[pps]
Axis Acc Time	Required time until the motor reaches the axis max speed from stop status	1~9,999[ms]
Axis Dec Time	Required time until the motor reaches from the axis max speed to the stop status	1~9,999[ms]
Motion Dir	To select motion direction (CW or CCW)	0~1
Pulse per Revolution	Number of pulses per revolution. The range of 'Axis Max Speed' parameter is depend on this value.	0~9

Teaching Function

Teaching can be executed only by User Program(GUI). For more information, refer to 「[User Manual - Position Table Function](#)」 .


12. Other Operation Functions

12.1 Position Table(PT) Operation Example

Input 'PT A0~ PT A7' signals to set PT number. Input 'PT Start' number to execute speed control operation. For more information, refer to 「[User Manual - Position Table Function](#)」.

【Position Table Setting】

PT No.	Command type	Position	Low Speed	High Speed	Accel. time	Decel. time	Wait time	Continuous Action	JP Table No.
0	3	10000	1	2500	50	300	0	1	1
1	3	1000	1	500	-	-	0	1	2
2	3	5000	1	1500	50	300	300	0	3
3	3	-2500	1	1000	300	300	0	0	-

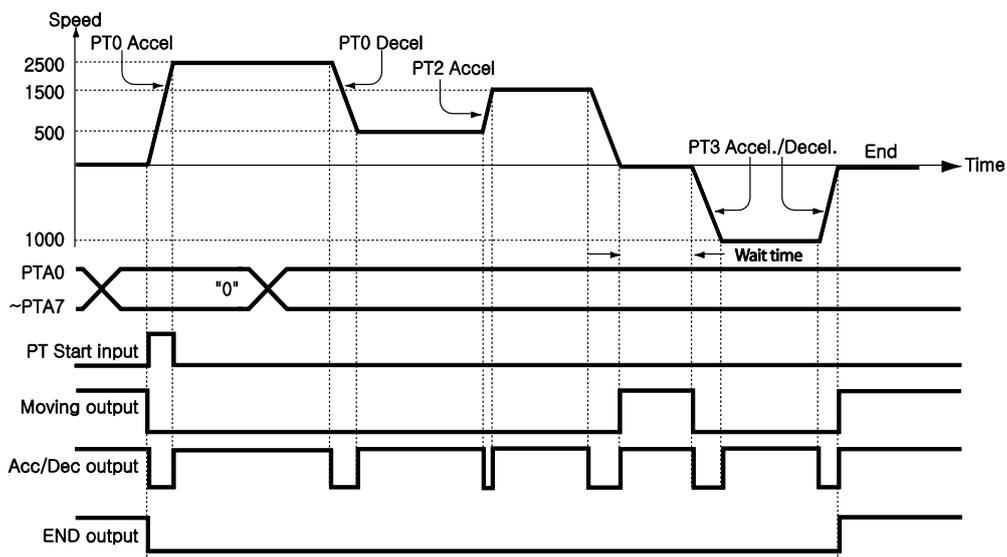


12.2 Jog Operation Example


The machine executes speed control operation at the speed set by parameters according to inputting 'Jog+' and 'Jog-' signals.

【Parameter Setting】

No.	Parameter Name	Setting Value	Unit
6	Jog Speed	1500	[pps]
7	Jog Start Speed	100	[pps]
8	Jog Acc Dec Time	200	[msec]

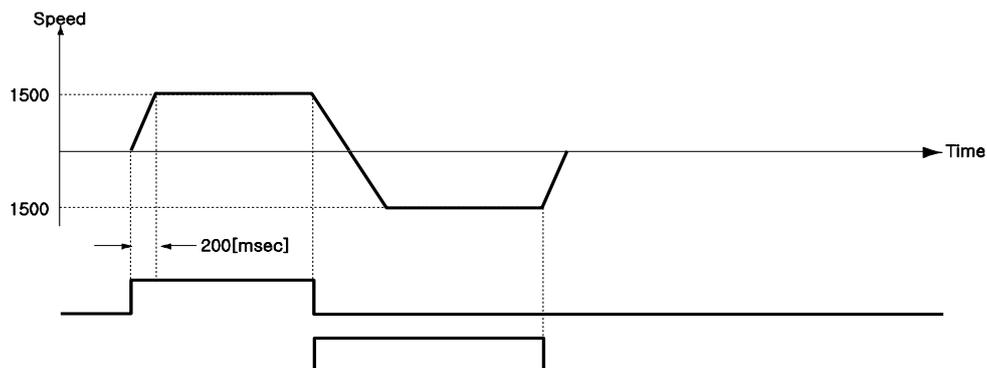

Also, when any value except 0 is set to the 'Jog Start Speed' parameter, the relation between jog command and in-position is shown below.

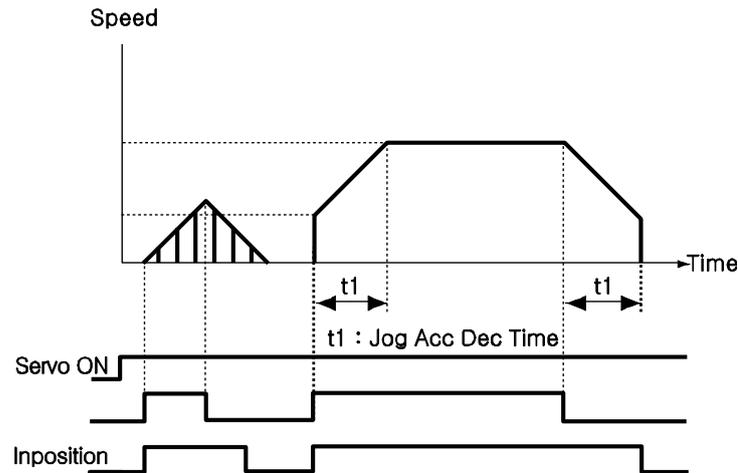

12.3 Origin Return


If the machine is operated by I/O signals, the motor can execute origin return by inputting 'Origin Search' signal. Also, the motor can execute origin return with User Program(GUI) and DLL program. The following table shows parameter types related to origin return.

Parameter Name	Description	Range
Org Speed	Operation speed when origin return starts	1~500,000[pps]
Org Search Speed	Low-speed operation speed after origin sensor is sensed and operation start speed when origin start.	1~50,000[pps]
Org Acc Dec Time	The time assigned to the acceleration/deceleration section when origin return starts and stops.	1~9,999[ms]
Org Method	To select how to return the origin	0~5
Org Dir	To select operation direction(CW or CCW)	0~1
Org Offset	After origin return is finished, the motor moves additionally as this setting value and then stops.	-134,217,727 ~ 134,217,727
Org Position Set	After origin return is finished, 'Command Pos' value is set to this setting value.	-134,217,727 ~ 134,217,727
Org Sensor Logic	To set the origin sensor signal level.	0~1
Org Torque Ratio	To set the torque ratio during Torque origin method	10~100[%]

(1) Origin Return Method Setting


To execute origin return, 'Org Method' parameter should be set as follows.

① Common Origin (In case of 'Org Method' = 0)

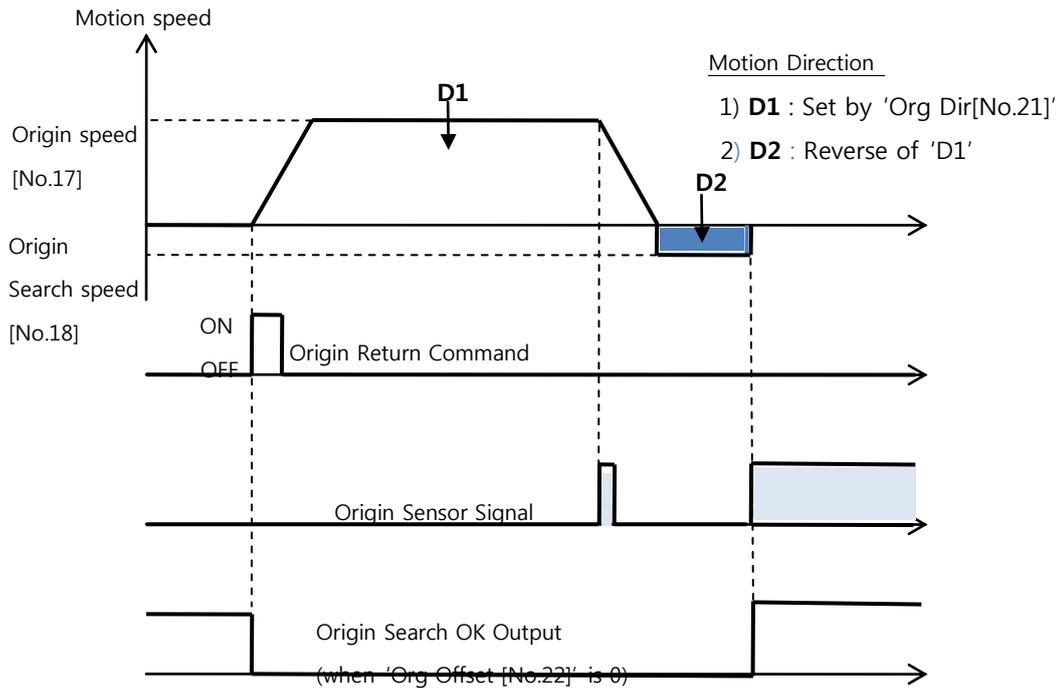


The machine moves up to the origin sensor by 'Org Speed' and 'Org Acc Dec Time' parameters and then completes precise origin return at the low speed set to 'Org Search Speed'. When the origin sensor, the motion is stop change direction and move upto origin sensor OFF. And finally move until origin sensor ON. If the limit sensor is sensed while the machine is under origin return, the machine stops and reverses its moving direction and then continues to origin return operation.

② Z-pulse Origin (In case of 'Org Method' = 1)

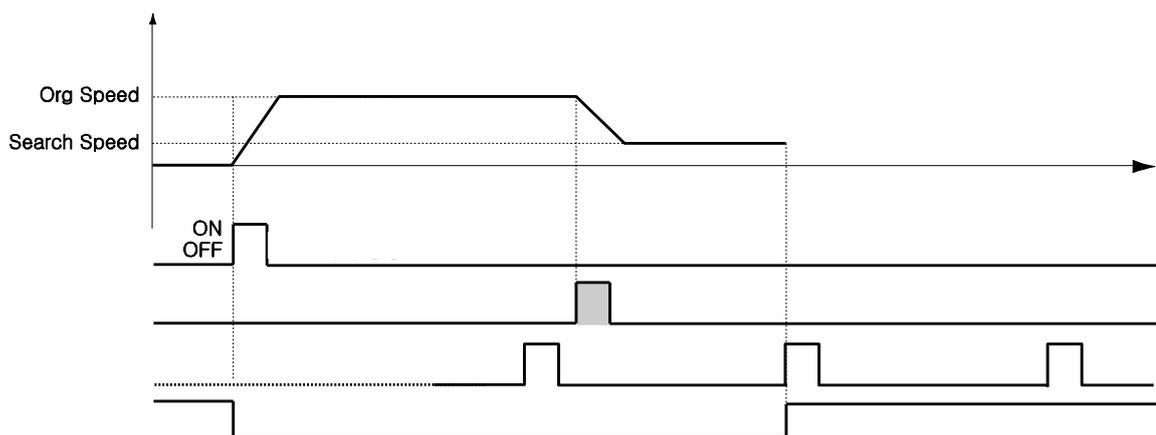

The machine moves up to the origin sensor by 'Org Speed' and 'Org Acc Dec Time' parameters and then completes Z-pulse origin return at the low speed set to 'Org Search Speed'. That is, after the origin sensor is sensed, the machine moves slowly to the original moving direction until Z-pulse signal is sensed.

③ Limit Origin (In case of 'Org Method' = 2)

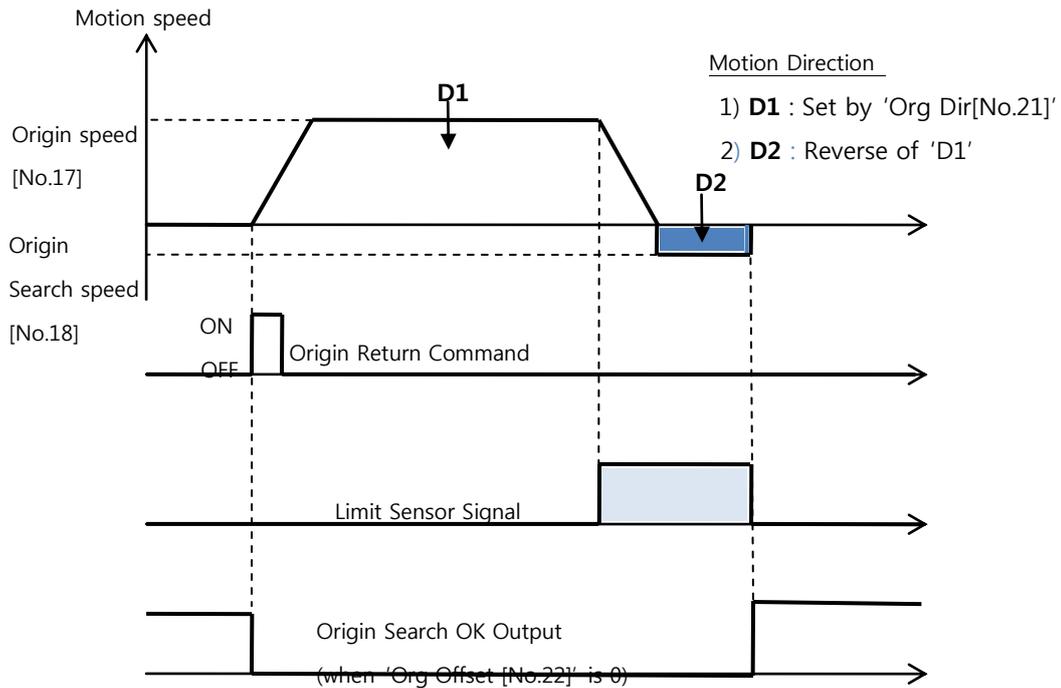

The machine moves up to the position which the limit sensor is sensed by 'Org Speed' & 'Org Search Speed' parameters, and stops by 'Org Acc Dec Time' value. The moving direction complies with as set in 'Org Dir'.

If there's no limit sensor on your system, you can set 'Origin' by 'S/W Limit Plus Value' and 'S/W Limit Minus Value' of parameters.




Caution

When the limit sensor is detected, the stop method is fixed to 'Soft Stop', not depends on parameter value.

④ Torque Origin (In case of 'Org Method' = 3)

The machine moves up to the wall which the pushing torque is reached to 'Org Torque Ratio' value. This method can be used without origin sensor and without limit sensor.

If the HW limit sensor is sensed, the motion is stop and the Origin Search OK signal Remains OFF status.

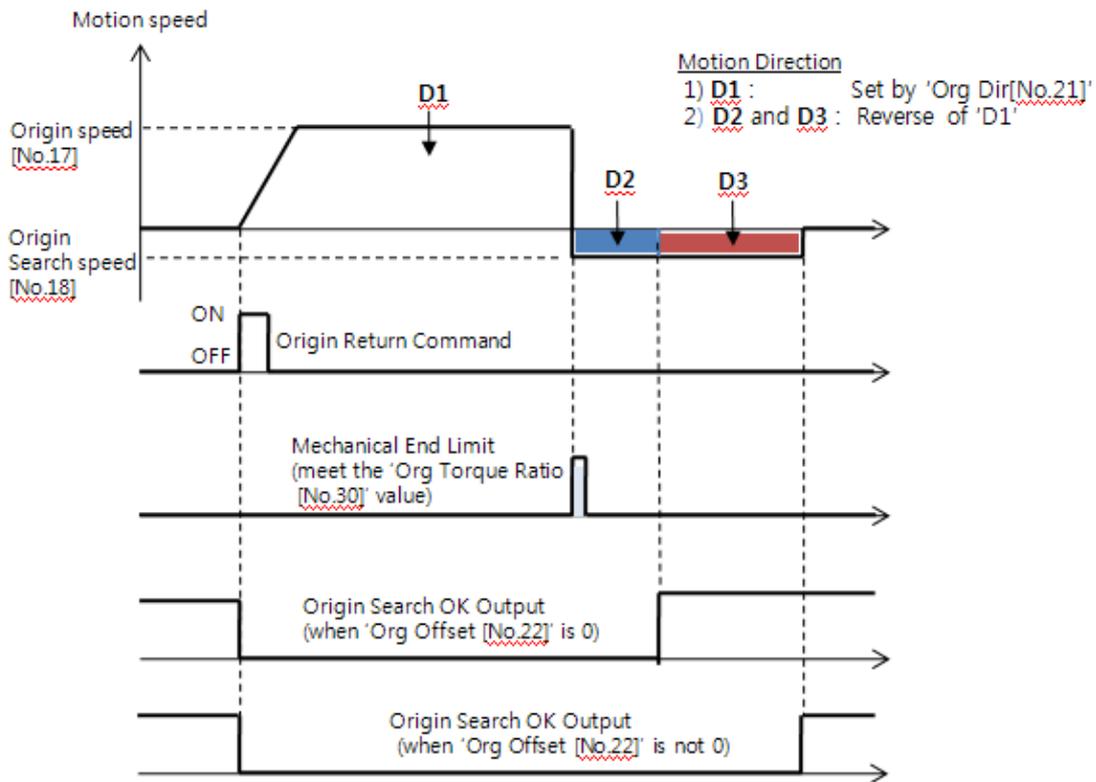

When the machine moves up to the mechanical limit by 'Org Dir' direction, it stop immediately and moves in reverse direction until 'D2' distance. If the 'Org Offset' parameter is not 0, it moves more as 'D3' distance.

* Be careful not to contact 'HW limit sensor' during torque origin command.
(By HW limit sensor, the motor will stop and command is canceled)

⑤ Torque Z Origin (In case of 'Org Method' = 4)

After the machine moves up to 'Torque Origin', it moves additionally up to meet 'Z-pulse' of encoder. The motioning of 'Torque Origin' is same as

Torque Origin (In case of 'Org Method' =3) and the remaining Z-pulse motioning is same as ② Z-pulse Origin(In case of 'Org Method' =1).

* In case of this, the 'Org Search Speed' value is working under 10000[pps].
* Be careful not to contact 'HW limit sensor' during torque origin command.

⑥ Set Origin (In case of 'Org Method' =5)

Set to origin in current mechanical position without origin sensor.

(2) Origin Return Procedure

Origin return is executed according to the following procedure.

- ① Set parameters required to origin return.
- ② If the Servo is OFF, (reset an alarm when it occurs) input a control input Servo ON command or send a communication program so that the Servo can be ON.

- ③ Start origin return operation to the rising edge of control input origin search or the communication program.

(3) Interruption of Origin Return

When the machine is under origin return, click 'Stop' or 'E-Stop' to stop the machine. In this case, the machine's origin is not edited and origin return is not completed either.

(4) Output of Origin Return Finish

The completion of origin return operation can be decided with related bit values of either 'Origin Search OK' of control output or 'Axis Status' of communication program.

12.4 Stop Operation

By using two methods of control input and communication program command, the user can input stop and emergency stop commands. Even though the emergency stop command is inputted, the Servo will be not OFF. In case emergency stop, the machine stops immediately without deceleration. So, a special caution for mechanical impact is required.

12.5 Trigger Pulse Output

This function is used when the output signal becomes ON periodically in specific condition. This function can be used in absolute coordinate system.

(1) Setting

This function is working with RS-485 communication (DLL library) method only.

This command can be executed during the positioning command or before the positioning command also. The following table shows the setting conditions and refer to

「[User Manual - Communication Function](#)」.

Setting Item	Description	Range
Start/Stop	Setting start/stop of pulse output.	0~1
Pulse Start Position	Setting the start position of first pulse output.	-134,217,727 ~ 134,217,727
Pulse Period	Setting the pulse period. (0 : pulse output only 1 time in Pulse start position. 1~ : pulse output repeatedly depends on setting.)	0~134,217,727 [pulse]
Pulse Width	Setting the pulse width.	1~1000[ms]

(2) Formula for Setting Items

To calculate the minimum 'Pulse Period' value the next formular is used.

- Motioning speed = speed[pps]
- Pulse width = pulse_width[msec]


The minimum 'Pulse Period[pulse]' = (speed / 1000) * pulse_width * 10.

For example, the motioning speed is 100,000[pps], pulse width is 5[msec] ,

The minimum 'pulse period' must set to more than '5000[pulse]' value.

(3) Signal Output

This output pin of CN1 connector for Trigger Pulse is fixed to 「Compare Out」 and the signal diagram is as follows.

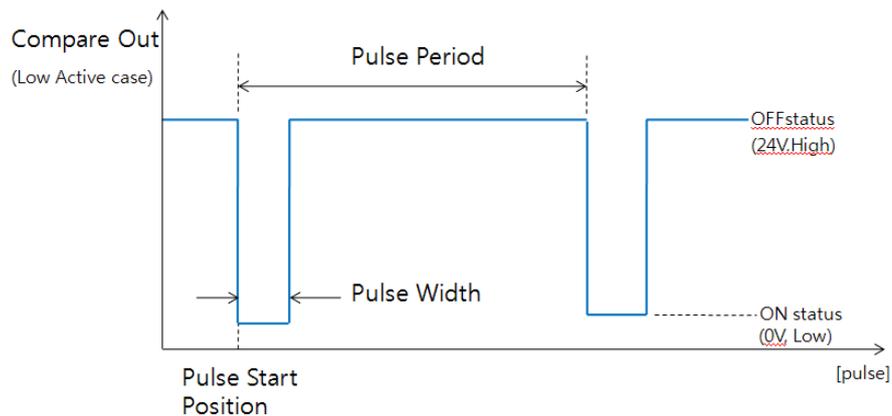

Caution

The pulse is output only in bigger position area than 'pulse start position' and is output in incremental motion direction.



Caution

The sign of current position value and the sign of 'pulse start position' must be same to pulse output.

(4) Status Check

By using DLL program, the user can check the trigger pulse output status.

Refer to 「[User Manual - Communication Function](#)」.

12.6 Push Motion

This function is used when the specified motor torque is needed during motioning and Stop(only in Stop-mode) status.

This function is **working only in absolute position value**.

(1) Function

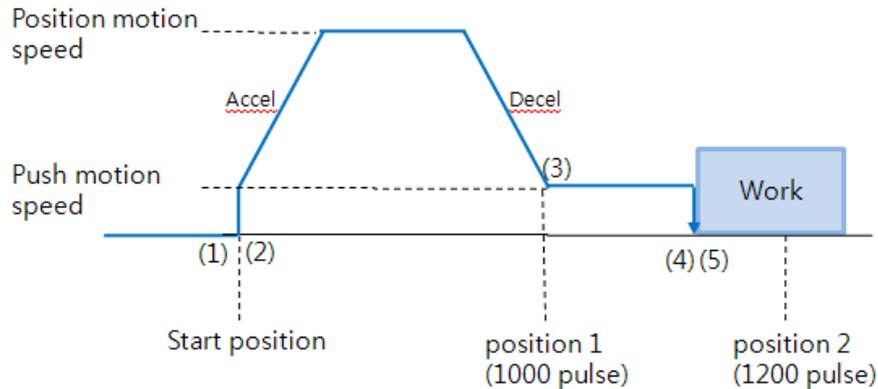


Figure 10.6.1

- ① Start Push Motion command
- ② Normal position motion command is executed.
(status : position mode)
- ③ Decelerate the speed from position motion to push motion.
(push motion speed must be lower than 200[rpm].)
- ④ Push motioning until the work detected with specified motor torque.
(status : push mode)
The motioning will stop just after the work detected.
- ⑤ When Push mode is 'Stop' :
After the work detected, the motor will stop but the motor torque will be maintained and the 'inposition' / 'PT Stopped' / 'END' signal is effective.
The maintained motor torque will be return to normal(Servo ON) status by 'stop' command.
(status : release push mode and return to position mode)

When Push mode is 'Non-stop' :

After the work detected, the motor will not stop and the motor torque will be maintained and the 'inposition' and other signal is effective.

- ⑥ Additional the next step is needed as below diagram (Figure 10.6.2).

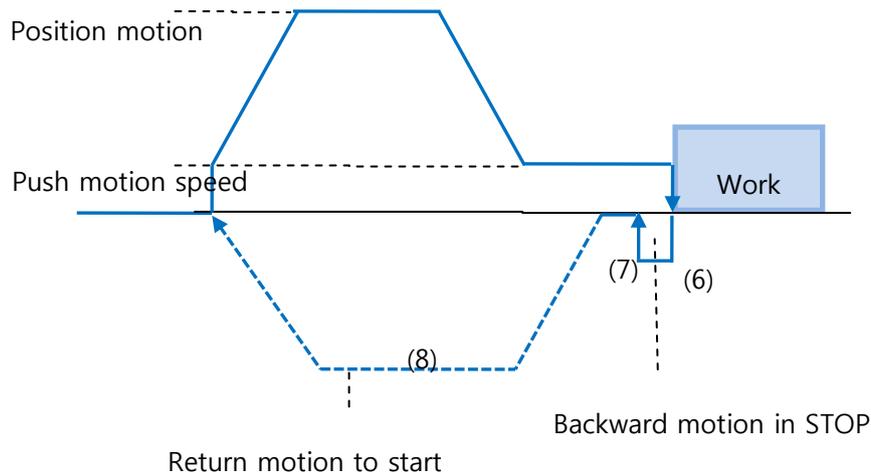


Figure 10.6.2

The **'Stop' command must be executed** before next motion command. (In Stop mode it is no need to 'stop' when there is no shock in mechanism) At this 'stop' procedure, the motor move to backward as much as the 'Push mode' parameter values. This motion will be reduce the shock in mechanism. So if the Stop command is not used, 'Backward motion' is also not executed. 'Backward motion' speed is set to 5000[pps] at this moment.

- ⑦ Time delay can be needed before returning to start position depends on mechanical conditions.
 ⑧ Return to start position.

 Caution	Non-stop mode : must be execute the 'Stop' command before next motion command in the work detect situation.
 Caution	If there is shock in mechanism, the time delay is needed after 'Stop' operation.
 Caution	Extends the distance of Position motion command when Push motion is not excuted.
 Caution	If alarm happens with 'stop' command after push motion executed, change the 'Push mode' value to bigger or smaller.
 Caution	If the work can not be detect during Push Position, the push mode is Automatically finished.

(2) Specification

The push torque is different for each motor size. Refer to 「[4.Characteristic of Motor Torque](#)」 .

Push ratio (from 20~90[%]) value is referenced to stop status torque on 'Torque

Graph'. And the accuracy is $-10 \sim +10[\%]$.

When this function is working specially in Ezi-Actuator that is combined Ezi-SERVO-PR-MI and MC-28VA cylinder, the push motion characteristic is as follows.

Item	MC-28VA with Ezi-SERVO-PR-MI
Pushing force [N] *1	20 ~ 83 (push ratio : 20~90 [%])
Pushing speed [mm/sec]	6.6 or less
Positioning repeatability [mm]	0.01
Driven method	Lead screw
Max velocity [mm/s]	24
Lead [mm]	2

*1 : Accuracy is $-10 \sim +10 [\%]$

When this function is working specially in Captive LinearStep that is combined Ezi-SERVO-PR-MI and 17C2035S4 motor, the push motion characteristic is as follows.

Item	17C2035S4 with Ezi-SERVO-PR-MI
Pushing force [N] *1	22 ~ 106 (push ratio : 20~90 [%])
Pushing speed [mm/sec]	19.05 or less
Driven method	Lead screw
Lead [mm]	6.35

*1 : Accuracy is $-10 \sim +10 [\%]$

(3) Setting Method

This function is **working only in absolute position value**. The position error can happen due to the work status in push mode. Push motion command can be executed by 2 methods. One is RS-485 communication(DLL library) method and the other is external digital signal(PT Start command) method.

① DLL library method

The following table shows the setting conditions and refer to [「User Manual - Communication Function」](#).

There is another library for status checking of push motioning.

Setting Item	Description	Range *1
Position command Start speed	Start speed value of position motion	1~35000[pps]
Position command Moving speed	Moving speed of position motion	1~500000[pps]
Position command Target position	Absolute target position value of position command ('position 1' of Figure10.6.1)	134,217,727 ~ 134,217,727
Accel time	Accel time of position motion	1~9,999[ms]
Deceleration time	Decelerate time of position motion	1~9,999[ms]
Push ratio	Motor torque value in push mode	20~90[%]
Push command Moving speed	Moving speed of Push motion (max 400[rpm])	1~66000[pps]
Push command Target position	Absolute target position value of push command	134,217,727 ~ 134,217,727

	('position 2' of Figure10.6.1) *Non-stop mode : the value must be set more than ' Position command Target Position' value. *The motor will stop if the position is exceed this value even if the work is not detected.	
Push mode	Set Stop mode(0) or Non-stop mode(1~10000) after the work detect. In case of Non-stop mode, the motor move backward as much as this value[pulse] distances.	0~10,000

*1 : The unit of [pps] in this item is referenced to 10,000[ppr] encoder.


② Input signal(PT Start) Method

Firstly the position table data must be entered before the push motioning and refer to 「[User Manual - Position Table Function](#)」.

(4) Status Check

Basically the current push motion status can be checked by DLL library and Additionally can be checked by Flag(Inposition & PT Stoped signal) and Output (END signal) as follows.

① Work detected

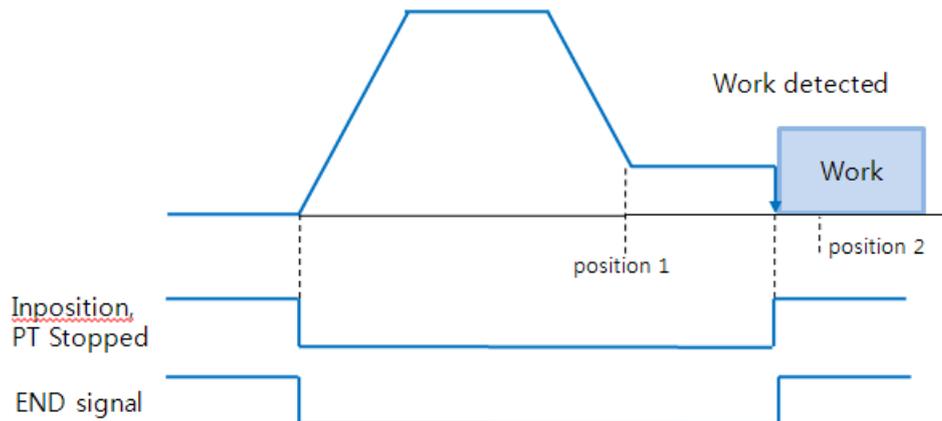

② Work not detected

The 'Inposition' and other signals are still OFF when the work is not detected. By 'stop' command these signals change to ON status. If the work is overdue after work detect('Inposition' signal is ON), the 'Inposition' signal change to OFF status. But the 'PT Stopped/END' signal is still ON after the first work detect. The push command is stopped at 'position 2' (absolute position value in push command).

(5) Alarm

Basically the alarm (#3 and #4) function is not working during push motion moving. This is because of the position error and overload alarm can be happen in push mode. If the alarm happens during return to start position after finishing push motioning, increase the parameter ' 27. Position Tracking Limit' value.

13. Communication Function

In case of RS-485, up to 16 axes can be controlled by the multi-drop link(daisy chain).

	<p>If Windows goes to the stand-by mode, serial communication is basically disconnected. So, after recovering from the stand-by mode, the user should connect communication again. This content is equally applied to the library provided with the product.</p>
---	--

13.1 Connection with the PC


There are one method of connecting between the drive and the PC by RS-485(serial communication). PC's RS-232C port can be used. By using following communication converters according to each communication type, the user can connect the PC and the drive module. The maximum communication speed is 115200[bps] with RS-232 to RS-485 converter.



For connection with the PC, refer to 「5.2 Controller Configuration」.

1) Cable of Connecting RS232 Port (to PC) and Converter (RS232 ↔ RS-485)

Normally Power does not need to be supplied to the converter module. But when the communication have problems without power, DC 5~24V external power can be connected. The signal is wired as follows.

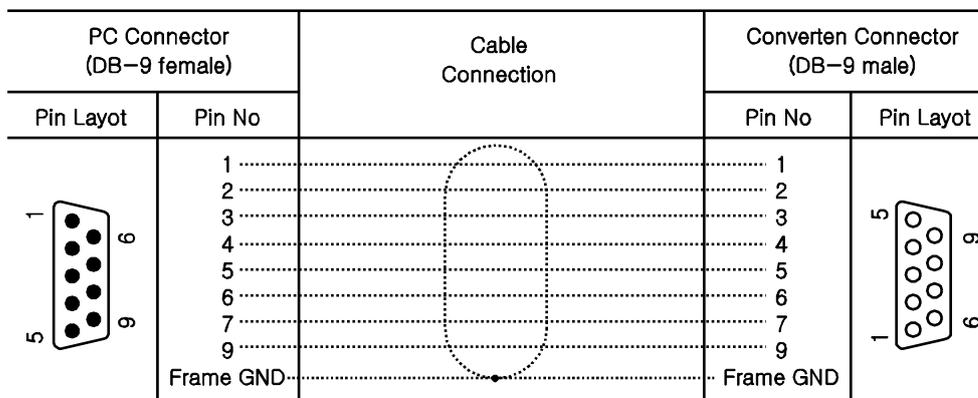

2) Cable of connecting RS-485 Converter and Drive Module(CN5 : Ezi-SERVO-PR only)

Connector Type : RJ45

Cable Type : LAN cable, CAT5E or better (UTP or STP)

Signal Wiring : Standard Straight Wiring

(1↔1, 2↔2, 3↔3, ..., 8↔8)

If multi-axis connection is required at one segment, up to 16 drive modules can be connected by the daisy-chain method. The pin signal content is as follows.

RJ45 Pin No.	UTP CAT5E cable	Function
1	White/Orange	GND
2	Orange	GND
3	White/Green	Data+
4	Blue	GND
5	White/Blue	GND
6	Green	Data-
7	White/Brown	GND
8	Brown	GND
case		Frame GND



Caution

The cable length of RS-485 Converter↔Drive or Drive↔Drive must be longer than 60 cm.

3) Cable of connecting RS-485 Converter and Drive Module(CN5) : Ezi-SERVO-PR-MI and Ezi-SERVO-ALL

Signal Wiring : Standard Straight Wiring

(1↔1, 2↔2, 3↔3)

If multi-axis connection is required at one segment, up to 16 drive modules can be connected by the daisy-chain method. The pin signal content is as follows.


Pin No.	Function
1	Data+
2	Data-
3	GND



Caution

Signal cable 'Data+' and 'Data-' are differential type signals. These two signal cables must be **twisted**.

13.2 Communication Interface Circuit

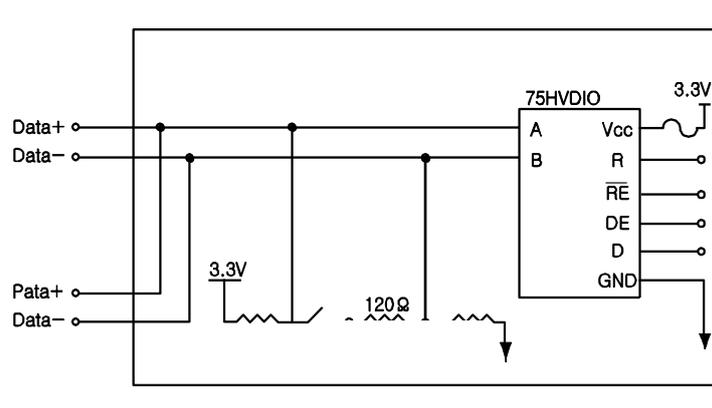

The above figure shows an I/O circuit of RS-485 communication interface signal. When communication is connected, Ezi-SERVO Plus-R maintains to receive stand-by status. It performs sending only when it receives the signal from upper communication and then replies. For more information about communication function, refer to 「[User Manual - Communication Function](#)」 in a separate volume.

14. Protective Function

14.1 Alarm Type

When an alarm occurs while the controller is operating, a red LED among status display LEDs flash and the following protective function will be displayed according to the number of LED flash counting.

Alarm Table

Flash Count	Alarm Name	Description
1	Overcurrent	The current through power devices in inverter exceeds the limit value *1
2	Overspeed	Command speed for motor exceeds 3300[rpm].
3	Position Tracking	Position error value is higher than specified value*1 in position command status . *2
4	Overload	The motor is continuously operated more than 5 second under a load exceeding the max. torque.
5	Overheat	The internal temperature of the drive exceeds 85℃ .
6	Over regenerative voltage	Back-EMF more than limit value. *3
7	Motor connection	The connection of drive and motor is defective.
8	Encoder connection	The connection of drive and encoder is defective.
9	Motor voltage error	The power supplied to the motor is less than low limit value.*4
10	Inposition error	After operation is finished, a position error occurs.
11	System error	Drive system is halted(Watch Dog Timer).
12	ROM error	Read/Write error on ROM device in drive system.
15	Pos. Error Overflow	Position error value is higher than specified value*1 in motor stop status. *6

*1 4.5A : EzS-NDR-20, EzS-NDR-28, EzS-NDR-42, EzS-NDR-56, EzS-NDR-60 model
9.0A : EzS-NDR-86 model

*2 Values[pulse] of parameter 'Pos Tracking Limit[No.27]

*3 70V : EzS-NDR-20, EzS-NDR-28, EzS-NDR-42, EzS-NDR-56, EzS-NDR-60 model
90V : EzS-NDR-86 model

*4 20V : EzS-NDR-20, EzS-NDR-28, EzS-NDR-42, EzS-NDR-56, EzS-NDR-60 model
40V : EzS-NDR-86 model


*6 Values[pulse] of parameter 'Pos. Error Overflow Limit[No.33]

14.2 Acquiring Alarm Information

When an alarm occurs, the motor become Servo OFF and then stops by free run and at the same time displays alarm message.

Also, 'AlarmBlink' signal repeats On/Off according to the timing as illustrated below. The red LED flash every 0.5 second in accordance with alarm number and wait for 2 seconds. And then red LED flash repeatedly until inputting 'AlarmReset' signal.

(Example) Alarm 3 : 'AlarmBlink' display signal occurred when the step-out is occurred.

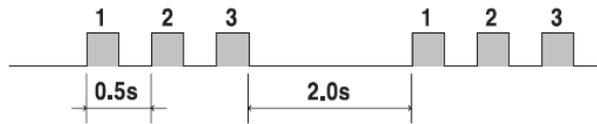

14.3 Alarm Check and Release

If an alarm occurs, remove its cause and then release it. The alarm can be released as follows. In case of alarms of which 'Reset' column is indicated to 'Invalid', power must get down prior to releasing the alarms.

Flash Count	Alarm Name	Description	Reset
1	Overcurrent	1)Check the motor' s short-circuit (A, /A, B, /B) 2)Check the mechanical status such as parameter setting.	Valid
2	Overspeed	1)Check parameter setting, and abnormal operation of the motor. 2)Check the speed command of upper controller(ex:PLC).	Valid
3	Position Tracking	1)Get down the load or increase the acceleration or deceleration speed. 2)Check assemble status of mechanism. 3)Check the brake signal cable. 4)Check the motor' s short-circuit (A, /A, B, /B) 5)Check the encoder cable connection status. 6)Check the parameter (27:Position Tracking Limit) setting value.	Valid
4	Overload	1)Compare the motor' s rating with load scale. 2)Check assemble status of mechanism. 3)Check 'SW limit' value of parameter. 4)Check the status of sensors. 5)Check the motorDB for driver and motor. 6) Check the motor' s short-circuit (A, /A, B, /B)	Valid
5	Overheat	1)Get down the ambient temperature or install a cooling fan. 2)Check the distance is over 50mm between drivers.	Valid
6	Over regenerative voltage	1)In case of high-speed operation, check if the acceleration or deceleration speed is low.	Valid
7	Motor connection	1)Check the connection status of drive and motor.	Invalid
8	Encoder connection	1)Check the connection status of drive and encoder. 2)Check the screw condition, cabling short-circuit of encoder.	Invalid
9	Motor voltage error	1)Check if power is supplied to the drive.	Invalid

		2)Check the diameter and length of power cable to driver.	
10	Inposition error	1)Check if parameters are set correctly or the machine is over-loaded. 2)Check the vibration of mechanism and belt tension. 3)Check the cabling status of motor and encoder.	Valid
11	System error	1)Check if current of power supply is supplied to the drive.	Invalid
12	ROM error	1)Contact to distributor.	Invalid
15	Pos. Error Overflow	1)Get down the load or increase the acceleration or deceleration speed. 2)Check the brake and encoder is working correctly or not.	Valid

14.4 Alarm Log

If an alarm occurs, its log informations are save in ROM area in the drive.

- ① The maximum number of alarm logs are 30.
- ② The inquiry of alarm log is possible only on Servo OFF status.
- ③ To remove alarm log, use the 'Reset Alarm Logs' menu.



15. Parameter

15.1 Parameter List

No	Name	Unit	Lower Limit	Upper Limit	Default
0	Pulse per Revolution		0	9	9
1	Axis Max Speed	[pps]	1	2,500,000	500,000
2	Axis Start Speed	[pps]	1	35,000	1
3	Axis Acc Time	[msec]	1	9,999	100
4	Axis Dec Time	[msec]	1	9,999	100
5	Speed Override	[%]	1	500	100
6	Jog Speed	[pps]	1	2,500,000	5,000
7	Jog Start Speed	[pps]	1	35,000	1
8	Jog Acc Dec Time	[msec]	1	9,999	100
9	Servo Alarm Logic		0	1	0
10	Servo On Logic		0	1	0
11	Servo Alarm Reset Logic		0	1	0
12	S/W Limit Plus Value	[pulse]	-134,217,727	+134,217,727	+134,217,727
13	S/W Limit Minus Value	[pulse]	-134,217,727	+134,217,727	-134,217,727
14	S/W Limit Stop Method		0	1	1
15	H/W Limit Stop Method		0	1	1
16	Limit Sensor Logic		0	1	0
17	Org Speed	[pps]	1	500,000	5,000
18	Org Search Speed	[pps]	1	500,000	1,000
19	Org Acc Dec Time	[msec]	1	9,999	50
20	Org Method		0	4	0
21	Org Dir		0	1	0
22	Org Offset	[pulse]	-134,217,727	+134,217,727	0
23	Org Position Set	[pulse]	-134,217,727	+134,217,727	0
24	Org Sensor Logic		0	1	0
25	Position Loop Gain		0	15	4
26	Inpos Value		0	15	0
27	Pos Tracking Limit	[pulse]	0	+134,217,727	5,000
28	Motion Dir		0	1	0
29	Limit Sensor Dir		0	1	1
30	Org Torque Ratio	[%]	20	90	50
31	Pos. Error Overflow Limit *2	[pulse]	0	+134,217,727	5,000
32	Pos. Value Counting Method *2	[pulse]	0	1	0
33	Servo ON Method *3		0	1	1
34	Brake Delay Time *3	[msec]	10	5000	400
35	Reserved				
36	Run Current *4	*10 [%]	5	15	10
37	Stop Current *4	*10 [%]	2	10	5
38	Boost Current *4	*50 [%]	0	7	0

*1 It can be applied over the Firmware version of 08.13.045.1

*2 It can be applied over the Firmware version of 06.03.043.10

- *3 It can be applied over the Firmware version of 06.0x.063.51
- *4 It can be applied over the Firmware version of 06.0x.063.61

15.2 Encoder Setup

The setup of encoder can do in 'No.0 (Pulse per Revolution)' item on next table. Normally the resolution of encoder is 10000. If the resolution is 20000, 32000 or other value, you have to set '0' in parameter setup.

If you don't use default value for 'No.0 (Pulse per Revolution)', 'Position Error' can happen because of the function of Electronic Gear Ratio.

15.3 Parameter Description

No.	Description	Unit	Lower Limit	Upper Limit	Default																								
0	<p>Pulse per Revolution : Number of pulses per revolution. If this value is changed, the motor is set to Servo OFF.</p> <table border="1"> <thead> <tr> <th>Value</th> <th>Pulse/Revolution</th> <th>Value</th> <th>Pulse/Revolution</th> </tr> </thead> <tbody> <tr> <td>0</td> <td>500 *1</td> <td>5</td> <td>3600</td> </tr> <tr> <td>1</td> <td>500</td> <td>6</td> <td>5000</td> </tr> <tr> <td>2</td> <td>1000</td> <td>7</td> <td>6400</td> </tr> <tr> <td>3</td> <td>1600</td> <td>8</td> <td>7200</td> </tr> <tr> <td>4</td> <td>2000</td> <td>9</td> <td>10000</td> </tr> </tbody> </table> <p>*1 : In case of encoder resolution is 2000,4000, 16000, 20000 32000</p>	Value	Pulse/Revolution	Value	Pulse/Revolution	0	500 *1	5	3600	1	500	6	5000	2	1000	7	6400	3	1600	8	7200	4	2000	9	10000		0	9	9
Value	Pulse/Revolution	Value	Pulse/Revolution																										
0	500 *1	5	3600																										
1	500	6	5000																										
2	1000	7	6400																										
3	1600	8	7200																										
4	2000	9	10000																										
1	<p>Axis Max Speed : When position moving commands(absolute move, incremental move) are given, this mode sets the maximum speed which the motor can operate. So, the motor cannot be operated faster than this value in any case. This value is set to [pps] unit. Upper Limit value has limit by encoder resolution value. *in case of 10,000 : 500,000 In case of 32,000 : 1,600,000</p>	pps	1	2,500,000	500,000																								
2	<p>Axis Start Speed : When position moving commands(absolute move, incremental move) are given, this mode sets the operation start speed to [pps] unit.</p>	pps	1	35,000	1																								
3	<p>Axis Acc Time : When position moving commands(absolute move, incremental move) are given, this mode sets the acceleration section of operation start segment to [msec] unit. Possible range is different from Axis Speed. (Ex.1) Axis Start Speed=1, Move Speed=400000 : 1~14316 [msec] (Ex.2) Axis Start Speed=1, Move Speed=10000 : 1~356 [msec]</p>	msec	1	9,999	100																								
4	<p>Axis Dec Time : When position moving commands(absolute move, incremental move) are given, this mode sets the deceleration section of operation stop segment to [msec] unit. Possible range is different from Axis Speed same as 'Axis Acc Time' parameter</p>	msec	1	9,999	100																								
5	<p>Speed Override : When position moving commands(absolute move, incremental move) are given, the operation speed is subject to the ratio set to 'Move Speed' . (Ex) If current move speed is 10,000 and speed override is 200, actual motion speed is set to 20,000.</p>	%	1	500	100																								
6	<p>Jog Speed : When jog position moving command is given, this mode sets the motor revolution value to [pps] unit.</p>	pps	1	2,500,000	5000																								
7	<p>Jog Start Speed : When jog position moving command is given, this mode sets the operation start speed to [pps] unit.</p>	pps	1	35,000	1																								
8	<p>Jog Acc Dec Time : In case of jog operation, this mode sets the time of acceleration and deceleration sections to [msec] unit. Possible range is different from Axis Speed. (Ex.1) Axis Start Speed=1, Move Speed=400000 : 1~14316 [msec] (Ex.2) Axis Start Speed=1, Move Speed=10000 : 1~356 [msec]</p>	msec	1	9,999	100																								

9	Servo Alarm Logic : When the motor or the drive is defective and so alarm signal output is ON through CN1 connector, this mode sets the output signal level. <ul style="list-style-type: none"> ◆ 0 : 0 V (Active low level) ◆ 1 : 24V (Active high level) 		0	1	0
10	Servo On Logic : By using the input pin of CN1 connector, the drive may be converted into Servo ON. In this case, this mode sets the input signal condition so that the drive can be Servo ON. <ul style="list-style-type: none"> ◆ 0 : When 0 V (low level) is inputted, servo is set to ON. ◆ 1 : When 24V(high level) is inputted, servo is set to ON. 		0	1	0
11	Servo Alarm Reset Logic : When the motor or the drive is detected to generate alarm, this mode sets the input signal level to release the alarm signal. Before releasing the alarm signal, the user must release its cause. <ul style="list-style-type: none"> ◆ 0 : 0 V (Active low level) ◆ 1 : 24V(Active high level) 		0	1	0
12	S/W Limit Plus Value : When position moving commands(absolute move, incremental move, jog) are given, this mode set the maximum input limit that the motor can move to the plus(+) direction with 28 bits. When position reach to this value during 'Limit Origin' , it will be recognized to the Origin. When this value set to '0' , S/W Limit function is canceled	pulse	-134,217,727	+134,217,727	+134,217,727
13	S/W Limit Minus Value : When position moving commands(absolute move, incremental move, jog) are given, this mode set the minimum input limit that the motor can move to the minus(-) direction with 28 bits. When position reach to this value during 'Limit Origin' , it will Be recognized to Origin. When this value set to '0' , S/W Limit function is canceled	pulse	-134,217,727	+134,217,727	-134,217,727
14	S/W Limit Stop Method : Sets how to stop the motor by SW Limit Plus/Minus Value' , not stop motion by the limit sensor. <ul style="list-style-type: none"> ◆ 0 : stops the motor immediately by emergency stop mode. ◆ 1 : stops the motor gradually by soft stop mode. 		0	1	1
15	H/W Limit Stop Method: In case of stop motion by the limit sensor, this mode sets how to stop the motor. <ul style="list-style-type: none"> ◆ 0 : stops the motor immediately by emergency stop mode. ◆ 1 : stops the motor gradually by soft stop mode. 		0	1	1
16	Limit Sensor Logic : Sets the signal level so that the motor can recognize limit sensor' s input to ON. <ul style="list-style-type: none"> ◆ 0 : 0 V (Active low level) ◆ 1 : 24V(Active high level) 		0	1	0

17	Org Speed : In case of origin return command, this mode sets the operation speed until the motor senses the origin sensor to [pps] unit.	pps	1	500,000	5,000
18	Org Search Speed : In case of origin return command, The low operation speed for precise origin return after the motor senses the origin sensor is set to [pps] unit by this mode.	pps	1	500,000	1,000
19	Org Acc Dec Time : In case of origin return command, the acceleration/deceleration section time of the operation start/stop segment is set to [msec] unit by this mode.	msec	1	9,999	50
20	Org Method : The user can select origin return command types. <ul style="list-style-type: none"> ◆ 0 : The motor moves up to the origin sensor spot by 'Org Speed' and then executes precise origin return at the low value of 'Org Search Speed' . ◆ 1 : The motor moves up to the origin sensor spot by 'Org Speed' and then executes Z-pulse origin return at the low value of 'Org Search Speed' . ◆ 2 : The motor moves up to the limit sensor spot by 'Org Speed' and then immediately stops. ◆ 3 : The motor moves up to the wall by 'Org Torque Ratio' and then immediately stops. ◆ 4 : The motor moves up to the wall by 'Org Torque Ratio' and then executes Z-pulse origin return at the low value of 'Org Search Speed' . ◆ 5 : To set origin in current mechanical position.. <p>For more information, refer to '12.3 Origin Return' .</p>		0	5	0
21	Org Dir : In case of origin return, this mode sets the revolution direction of the motor. <ul style="list-style-type: none"> ◆ 0 : moves the motor clockwise. ◆ 1 : moves the motor counterclockwise. 		0	1	0
22	Org Offset : After origin return is completed, the motor moves additionally as this setting value and then stops. 'Command Pos/Actual Pos' is set to '0' .	pulse	-134,217, 727	+134,217, 727	0
23	Org Position Set : After origin return is completed, 'Command Pos/Actual Pos' value is set to this setting value.	pulse	-134,217, 727	+134,217, 727	0
24	Org Sensor Logic : Sets the origin sensor signal level so that the motor can recognize origin sensor's input to ON. <ul style="list-style-type: none"> ◆ 0 : 0 V (low level) ◆ 1 : 24V(high level) 		0	1	0
25	Position Loop Gain : After the motor stops, this mode controls the motor's response by a load attached to the motor. The user can control this value by the motor's load and so get the motor's performance that responds fast and stably. Set this mode as follows. <ol style="list-style-type: none"> 1) Set the value to '0' . 2) Increase the value until the motor's response is stabilized. 3) Previously adjust the setting status by increasing/decreasing one or two steps of the current setting value. 		0	15	4

Value	Integral Part's Time Constant*	Proportional Gain*	Value	Integral Part's Time Constant*	Proportional Gain*
0	1	1	8	2	3
1	1	2	9	2	4
2	1	3	10	2	5
3	1	4	11	3	1
4	1	5	12	3	2
5	1	6	13	3	3
6	2	1	14	3	4
7	2	2	15	3	5

* The above value is not the actual value used inside the drive but the relative value.

26


Inpos Value :

Sets the output condition of the in-position finish signal. After position command pulse is finished, when the position deviation from target position is within 'Inpos Value', this mode displays in-position finish signal.

Value	In-position [pulse] Fast Response	Value	In-position [pulse] Accurate Response
0	0	8	0
1	1	9	1
2	2	10	2
3	3	11	3
4	4	12	4
5	5	13	5
6	6	14	6
7	7	15	7

0 15 0

Fast response and accurate response can be controlled as illustrated below.

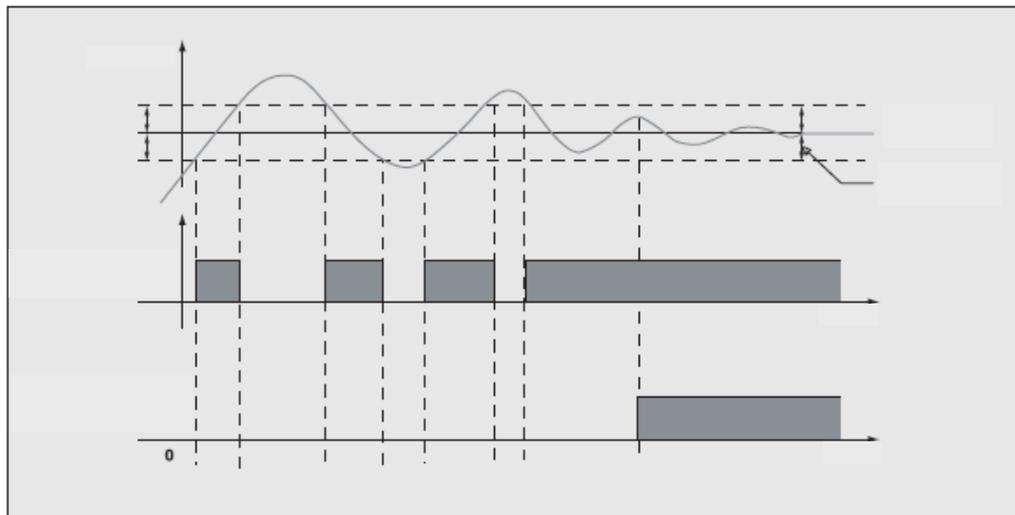

27

Pos Tracking Limit :

Acts to protect the motor and the drive. While the motor is run, when 'Position Error' is greater than this setting value, this mode generates an alarm to stop a flow of electricity to the motor and then set it to Servo OFF.

pulse

1

+134,217,727

5,000

28	Motion Dir : When the motor operates by position command, this mode sets the revolution direction of the motor. ◆ 0 : moves the motor clockwise. ◆ 1 : moves the motor counterclockwise. If this parameter is changed, normally 'Limit Sensor Dir' is also changed.		0	1	0
29	Limit Sensor Dir : Sets the limit sensor direction to stop the motor to the limit spot under operation. ◆ 0 : When operation direction is 'CW' , input the sensor signal to the Limit+ direction, and the motor will stop. ◆ 1 : When operation direction is 'CW' , input the sensor signal to the Limit- direction, and the motor will stop. If this parameter is changed, normally 'Motion Sensor Dir' is also changed.		0	1	0
30	Org Torque Ratio : This parameter can be used only when 'Origin Method' is '3' . To set the maximum torque value to stop the motor with some material(wall)	%	20	90	50
31	Pos. Error Overflow Limit : Acts to protect the motor and the drive. While the motor stops and is set to Servo ON, when 'Position Error' is greater than this setting value, this mode generates an alarm to stop a flow of electricity to the motor and then set it to Servo OFF. *2	pulse	1	+134,217,727	5,000
32	Pos. Value Counting Method : To select the display type of 'position' value. ◆ 0 : When the position value is display in positive and negative value together. ◆ 1 : When the position value is display only in positive value. This type can be used in one direction motioning.		0	1	0
33	Servo ON Method : To select the Servo ON processing depends on mechanical characteristics. ◆ 1 : When the normal process is enough and it takes about 400[msec]. ◆ 0 : For the safe Servo ON process on big friction mechanism and it takes about 2~3 [sec]. *3		0	1	1
34	Brake Delay Time : To set the delay time of brake control signal depends on Servo ON process. *3	msec	10	5000	400
35	Run Current : To set the maximum value of the current of motor during operates by position command. *4	*10[%]	5	15	10
36	Stop Current : To set the maximum value of the current of motor while the motor stop. *4	*10[%]	2	10	5
37	Boost Current : To set the maximum value of the current of motor during accelerate or decelerate operation. *4	*50[%]	0	7	0

*1 It can be applied over the Firmware version of 08.13.045.1

*2 It can be applied over the Firmware version of 06.03.043.10

*3 It can be applied over the Firmware version of 06.0x.063.51

*4 It can be applied over the Firmware version of 06.0x.063.61

Appendix

Option for RS-485 Communication

■ RS485 Converter : Common

Available to communicate between the PC and the drive. One module per multi-drop link is required.

Type	Item	Max comm. Speed [bps]	External Power
RS485 to RS232	FAS-RCR	115,200	No need (5~24VDC optional)



FAS-RCR

■ RS232 Connection Cable for FAS-RCR : Common

Universal DB-9 male-female type cable is used.

Item	Length
CGNR-C-1R8F	1.8m
CGNR-C-003F	3m
CGNR-C-005F	5m



For more information wiring diagram and connector, refer to 「[13. Communication Function](#)」.

■ RS-485 Connection Cable : Ezi-SERVO-PR only

Universal RJ-45 (STP:CAT5E category) straight type cable is used.

Item	Length
CGNR-R-0R6F	60cm
CGNR-R-001F	100cm
CGNR-R-1R5F	150cm
CGNR-R-002F	200cm
CGNR-R-003F	300cm
CGNR-R-005F	500cm



For more information wiring diagram and connector, refer to 「[13. Communication Function](#)」.

For cabling position, refer to ⑤ of 「[5.2 Controller Configuration](#)」.

■ RS-485 Connection Cable : Ezi-SERVO-PR-MI / Ezi-SERVO-ALL42 / Ezi-SERVO-ALL56

Item	Length
CGNA-R-0R5F	50cm
CGNA-R-001F	100cm
CGNA-R-1R5F	150cm
CGNA-R-002F	200cm
CGNA-R-003F	300cm
CGNA-R-005F	500cm

For more information wiring diagram and connector, refer to 「13. Communication Function」.

■ RS-485 Connection Cable : Ezi-SERVO-ALL60

Item	Length[m]	Remark
CWPA-R-0R6F	0.6	Normal Cable
CWPA-R-001F	1	
CWPA-R-1R5F	1.5	
CWPA-R-002F	2	
CWPA-R-003F	3	
CWPA-R-005F	5	

Item	Length[m]	Remark
CWPA-R-0R6M	0.6	Robot Cable
CWPA-R-001M	1	
CWPA-R-1R5M	1.5	
CWPA-R-002M	2	
CWPA-R-003M	3	
CWPA-R-005M	5	

*Cable to connect Ezi-SERVO-ALL 60 Series by Network.

For more information wiring diagram and connector, refer to 「13. Communication Function」.

Option for Interface Board : Ezi-SERVO-PR only

■ Terminal Block

Type	Item	
Interface (Terminal Block) Board	TB-Plus	

No. of CN1	Signal name	Signal name of TB-Plus
1	Limit+	L+
2	Limit-	L-
3	Origin	ORI
4	IN1	I1
5	IN6	I6
6	IN7	I7
14	IN2	I2
15	IN3	I3
16	IN4	I4
17	IN5	I5
18	IN8	I8
19	IN9	I9

No. of CN1	Signal name	Signal name of TB- Plus
7	COMP	C0
8	OUT1	O1
9	OUT2	O2
10	OUT3	O3
11	OUT4	O4
12	OUT5	O5
13	OUT6	O6
20	OUT7	O7
21	OUT8	O8
22	OUT9	O9
23	Brake+	B+
24	Brake-	B-

■ Extension cable for Interface Board

Available to extend the distance between the terminal block board and the drive.

Item	Length[m]	Remark
CIFD-S-□□□F	□□□	Normal Cable
CIFD-S-□□□M	□□□	Robot Cable

□ is for Cable Length, The unit is 1m and Max, 20m length,



The cable connection is 1:1 straight type.

Use	Item	Specification	Maker
Terminal Block connector	Connector	DB-26 male type	
Drive connector (CN1)	Connector Housing	10126-30000VE	3M
	Backshell	10320-52A0-008	3M

Option for Motor Drive : Ezi-SERVO-PR only

■ Cable for Input/Output Signal

Available to connect between Control System and Ezi-SERVO Plus-R.

Item	Length[m]	Remark
CSVR-S-□□□F	□□□	Normal Cable
CSVR-S-□□□M	□□□	Robot Cable

□ is for Cable Length. The unit is 1m and Max. 20m length.

Refer to ① of 「5.2 Controller Configuration」.

■ Cable for Power

Available to connect between Power and Ezi-SERVO Plus-R.

Item	Length[m]	Remark
CSVO-P-□□□F	□□□	Normal Cable
CSVO-P-□□□M	□□□	Robot Cable

□ is for Cable Length. The unit is 1m and Max. 2m length.

Next is for 86mm drive.

Item	Length[m]	Remark
CSVP-P-□□□F	□□□	Normal Cable
CSVP-P-□□□M	□□□	Robot Cable

□ is for Cable Length. The unit is 1m and Max. 2m length.

Refer to ④ of 「5.2 Controller Configuration」.

■ Extension Cable for Motor

Available to extended connection between motor and Ezi-SERVO Plus-R.

Item	Length[m]	Remark
CSVO-M-□□□F	□□□	Normal Cable
CSVO-M-□□□M	□□□	Robot Cable

□ is for Cable Length. The unit is 1m and Max. 20m length.

Next is for 86mm drive.



Item	Length[m]	Remark
CSVP-M-□□□F	□□□	Normal Cable
CSVP-M-□□□M	□□□	Robot Cable

□ is for Cable Length. The unit is 1m and Max. 20m length.

Refer to ③ of 「5.2 Controller Configuration」.



Wiring Diagram

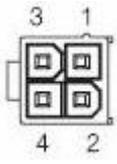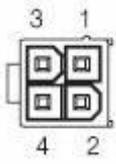Drive Connector (CN3)		Cable Connection	Motor Connector	
Pin Layout	Pin No.		Pin No.	Pin Layout
	1		1	
	2		2	
	3		3	
	4		4	

Connector Specification

Item	Specification	Maker
Housing	5557-04	MOLEX
Terminal	5556	MOLEX

■ Extension cable for Encoder

Available to extend the distance between the encoder and Ezi-SERVO Plus-R.



Item	Length[m]	Remark
CSVO-E-□□□F	□□□	Normal Cable
CSVO-E-□□□M	□□□	Robot Cable

□ is for Cable Length. The unit is 1m and Max. 20m length.

Refer to ② of 「5.2 Controller Configuration」.



Wiring Diagram

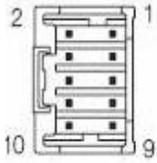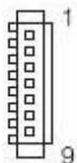Drive Connector (CN2)		Cable Connection	Motor Connector	
Pin Layout	Pin No.		Pin No.	Pin Layout
	1		1	
	2		2	
	3		3	
	4		4	
	5		5	
	6		6	
	7		7	
	8		8	
	9		9	

Connector Specification

Type	Item	Specification	Maker
Drive Connector (CN2)	Housing	51353-100	MOLEX
	Terminal	56134-9000	MOLEX
Motor Connector	Housing	SMP-09V-NC	JST
	Terminal	SHF-001T-0.8BS	JST

■ Connector for cabling

These connectors are serviced together with Ezi-SERVO Plus-R except when purchasing option cables.

CN1 : Input/Output Connector

Item	Specification	Maker
Connector	10126-3000PE	3M
Shell	10326-52FO-008	3M

CN2 : Encoder Connector

Item	Specification	Maker
Housing	51353-1000	MOLEX
Terminal	56134-9000	MOLEX

CN3 : Motor Connector

Item	Specification	Maker
Housing	5557-04	MOLEX
Terminal	5556	MOLEX

CN4 : Power Connector

Item	Specification	Maker
Housing	5557-02	MOLEX
Terminal	5556	MOLEX

CN3 : Motor Connector (86mm motor drive only)

Item	Specification	Maker
Terminal Block	AK950-4	PTR

CN4 : Power Connector (86mm motor drive only)

Item	Specification	Maker
Terminal Block	AK950-2	PTR

Option for Motor Drive : Ezi-SERVO-PR-MI only

■ Cable for Input/Output Signal

Available to connect between Control System and Ezi-SERVO-PR-MI.

Item	Length[m]	Remark
CSVA-S-□□□F	□□□	Normal Cable
CSVA-S-□□□M	□□□	Robot Cable

□ is for Cable Length, The unit is 1m and Max, 20m length,

Refer to ① of 「5.2 Controller Configuration」.

■ Cable for Power

Available to connect between Power and Ezi-SERVO-PR-MI.

Item	Length[m]	Remark
CMNB-P-□□□F	□□□	Normal Cable
CMNB-P-□□□M	□□□	Robot Cable

□ is for Cable Length, The unit is 1m and Max, 2m length,

Refer to ④ of 「5.2 Controller Configuration」.

■ Extension Cable for Motor

Available to extended connection between motor and Ezi-SERVO-PR-MI.

Item	Length[m]	Remark
CMNB-M-□□□F	□□□	Normal Cable
CMNB-M-□□□M	□□□	Robot Cable

□ is for Cable Length, The unit is 1m and Max, 20m length,

Refer to ③ of 「5.2 Controller Configuration」.

■ Extension cable for Encoder

Available to extend the distance between the encoder and Ezi-SERVO-PR-MI.

Item	Length[m]	Remark
CSVI-E-□□□F	□□□	Normal Cable
CSVI-E-□□□M	□□□	Robot Cable

□ is for Cable Length, The unit is 1m and Max, 20m length,

Refer to ② of 「5.2 Controller Configuration」.

■ Connector for cabling

These connectors are serviced together with Ezi-SERVO-PR-MI except when purchasing Option cables.

ITEM		Specification	Marker
Signal Connector (CN1)	Housing	501646-1600	MOLEX
	Terminal	501648-1000(AWG 26~28)	MOLEX
Encoder Connector (CN2)	Housing	501646-1000	MOLEX
	Terminal	501648-1000(AWG 26~28)	MOLEX
Motor Connector (CN3)	Housing	PAP-04V-S	JST
	Terminal	SPHD-001T-P0,5	JST
Power Connector (CN4)	Housing	PAP-02V-S	JST
	Terminal	SPHD-001T-P0,5	JST
RS-485 Connector (CN5, CN6)	Housing	33507-0300	MOLEX
	Terminal	50212-8100	MOLEX

Option for Motor Drive : Ezi-SERVO-PR-ALL42 / ALL56

■ Cable for Input/Output Signal

Available to connect between Control System and Ezi-SERVO-ALL.

Item	Length[m]	Remark
CSVA-S-□□□F	□□□	Normal Cable
CSVA-S-□□□M	□□□	Robot Cable

□ is for Cable Length. The unit is 1m and Max. 20m length.

■ Cable for Power

Available to connect between Power and Ezi-SERVO-ALL.

Item	Length[m]	Remark
CSVA-P-□□□F	□□□	Normal Cable
CSVA-P-□□□M	□□□	Robot Cable

□ is for Cable Length. The unit is 1m and Max. 2m length.

■ Connector for cabling

These connectors are serviced together with Ezi-SERVO-ALL except when purchasing Option cables.

CN1 : I/O Connection Connector

Item	Specification	Maker
Housing	501646-1600	MOLEX
Terminal	501648-1000 (AWG 26~28)	MOLEX

CN2 : Power Connection Connector

Item	Specification	Maker
Terminal Block	AKZ1550/2F-3,81	PTR

CN3, CN4 : RS-485 Communication Connector

Item	Specification	Maker
Housing	33507-0300	MOLEX
Terminal	50212-8100	MOLEX

Option for Motor Drive : Ezi-SERVO-PR-ALL60

■ Cable for Input/Output Signal

Available to connect between Control System and Ezi-SERVO-ALL.

Item	Length[m]	Remark
CWPA-S-□□□F	□□□	Normal Cable
CWPA-S-□□□M	□□□	Robot Cable

□ is for Cable Length. The unit is 1m and Max. 20m length.

Item	Length[m]	Remark
CAPA-S-□□□F*1	□□□	Normal Cable
CAPA-S-□□□M	□□□	Robot Cable

*1 Ezi-SERVO-ALL-60L-ABS

■ Cable for Power

Available to connect between Power and Ezi-SERVO-ALL.

Item	Length[m]	Remark
CWPA-P-□□□F	□□□	Normal Cable
CWPA-P-□□□M	□□□	Robot Cable

□ is for Cable Length. The unit is 1m and Max. 2m length.

■ Connector for cabling

These connectors are serviced together with Ezi-SERVO-ALL except when purchasing Option cables.

CN1 : Input/Output Connector

Item	Specification	Maker
Connector	99-5461-40-19	Binder

CN5, CN6 : RS-485 Communication Connector

Item	Specification	Maker
Connector	99-0405-00-03	Binder

CN3 : Power Connection Connector

Item	Specification	Maker
Connector	99-0410-00-04	Binder



FASTECH Co., Ltd.

Rm #1202, Bucheon Technopark 401 Dong, Yakdae-dong,
Wonmi-Gu, Bucheon-si, Gyeonggi-do, Rep. Of Korea (Zip:420-734)
TEL : 82-32-234-6300, 6301 FAX : 82-32-234-6302
Email : fastech@fastech.co.kr Homepage : www.fastech.co.kr

● Please note that the specifications are subject to change without notice due to product improvements.

© Copyright 2008 FASTECH Co.,Ltd.

All Rights Reserved. Mar 20, 2018 Rev.08.06.23